

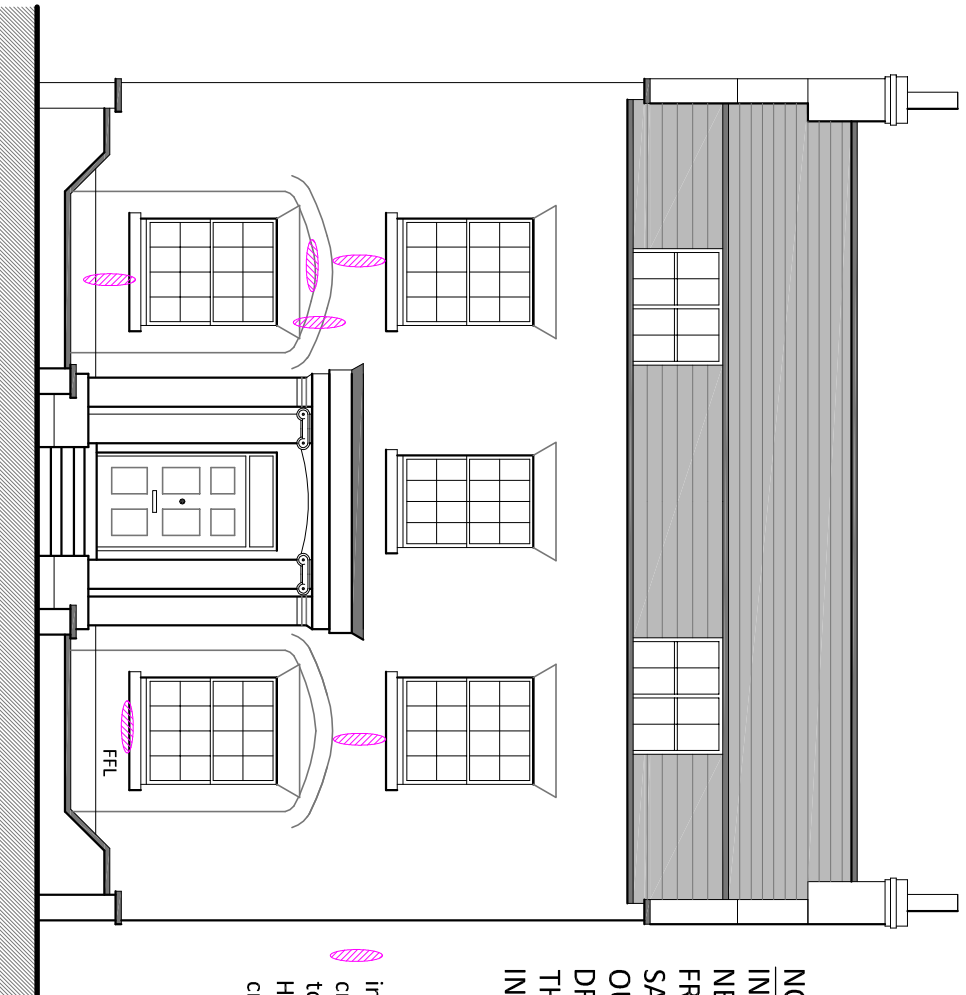


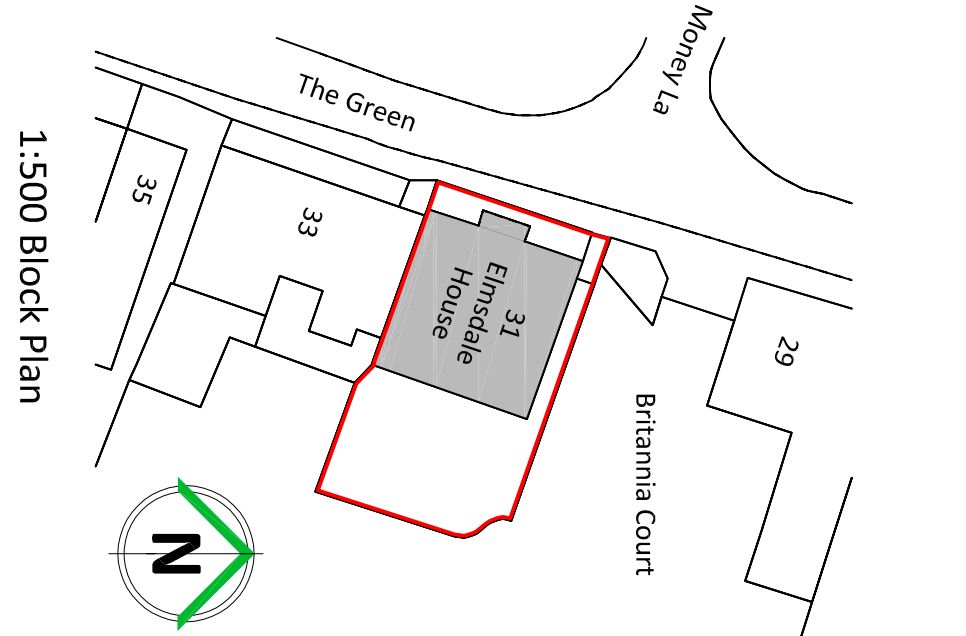

NOTE:- ALL WINDOWS TO BE INSPECTED & CHECKED. ANY NECESSARY REPAIRS TO FRAMES, WINDOW BARS, SASHES ETC TO BE CARRIED OUT WITH 'REPAIR CARE DRY-FLEX 4' IN ACCORDANCE THE MANUFACTURERS INSTRUCTIONS


indicates structural cracks in brickwork to be repaired with Helifix masonry crack stitching

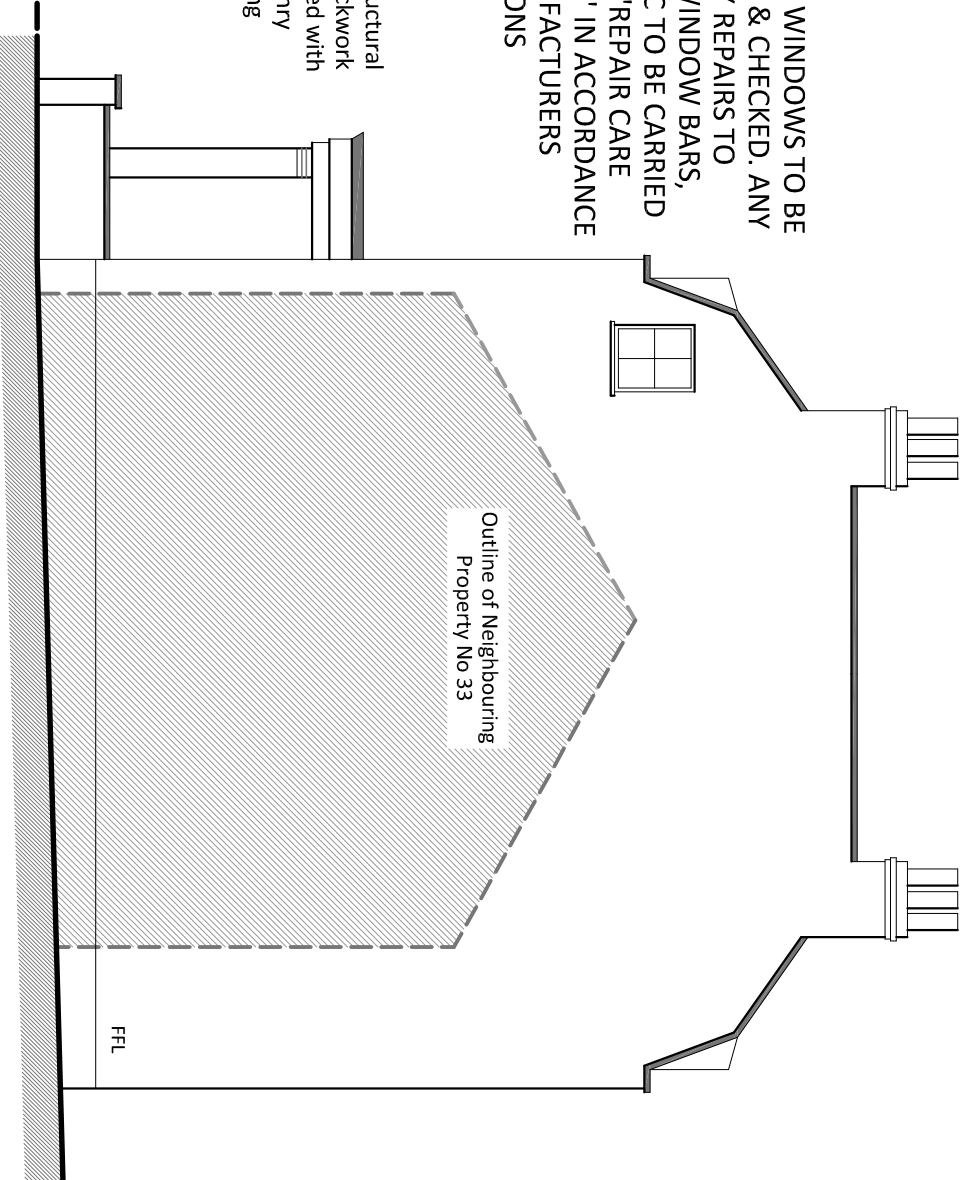


Front Elevation (West Facing)

Side Elevation (South Facing)

1:500 Block Plan

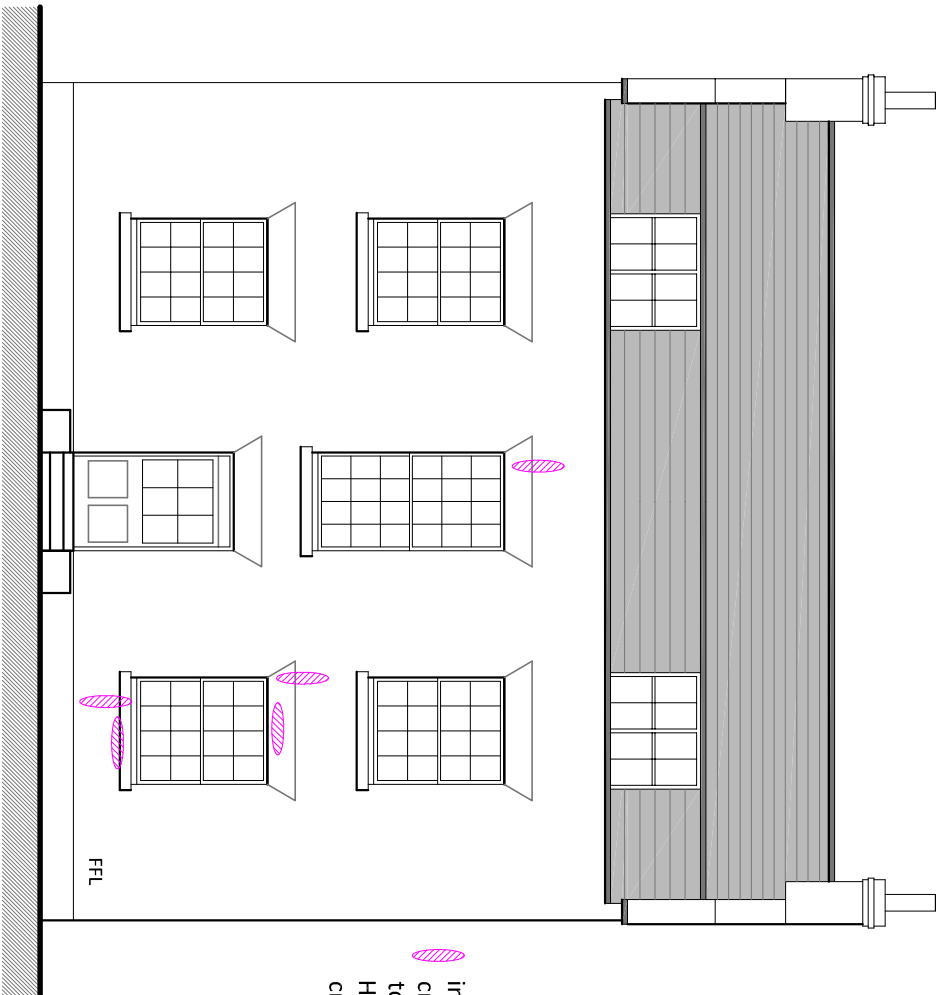


indicates structural cracks in brickwork to be repaired with Helifix masonry crack stitching

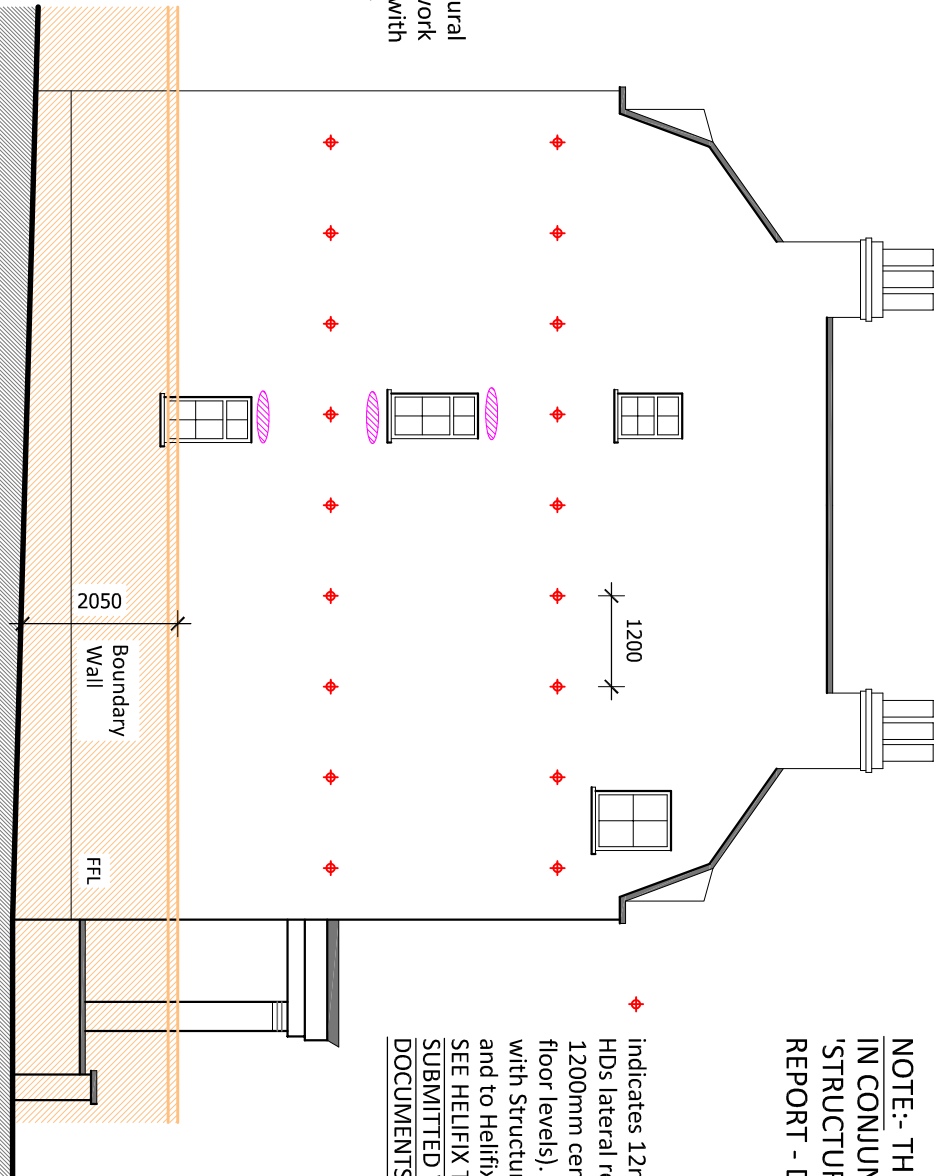

NOTE:- THIS DRAWING IS TO BE READ IN CONJUNCTION WITH THE 'STRUCTURAL ENGINEER'S SURVEY REPORT - Dated 15th June 2021

 indicates 12mm dia. Helifix Bow Tie HDs lateral restraint straps @ 1200mm centres (at First & Second floor levels). Installation in accordance with Structural Engineer's instructions and to Helifix Technical Specification. SEE HELIFIX TECHNICAL BROCHURE SUBMITTED WITH APPLICATION DOCUMENTS



EXTERNAL
STRUCTURAL
REPAIRS

Elmsdale House,
31 The Green,
Money Lane,
West Drayton
UB7 7PN

dwg no:- 21.35.11 scale:- 1:100 @ A3 date:- 11 Jan 2022

pgs design
mobile: 07827 930918
pgsdesign2014@gmail.com

Rear Elevation (East Facing)

Side Elevation (North Facing)