

Trevor Heaps

Arboricultural Consultancy Ltd.

12 Plover Drive, Milford-on-Sea, Hampshire, SO41 0XF - Tel: 07957 763 533

Email: trevor@trevorheaps.co.uk • www.trevorheaps.co.uk



Tree Risk Assessment Report

For

Dene Road, Northwood

HA6 2DD

Prepared for Dene Road Residents' Association

Prepared by Trevor Heaps BSc, MICFor, R. Arbor.A.

Date: 7th June 2024

Ref: TH 4639



Summary

This report demonstrates that the trees along Dene Road have been visually checked by a suitably-qualified tree expert.

Some tree defects were noted, and remedial work has been specified (and/or specific re-inspection timescales are specified). The remedial work should be implemented as soon as practically possible or at least within the recommended timescales.

Unless otherwise stated, recommendations are made on the basis that trees will be re-inspected within 3 years from the date of the last inspection. However, all trees should be inspected after extreme and severe weather events, and in the event of any nearby disturbance that could adversely affect tree stability, such as mechanical excavations close to tree stems, or loss of sheltering trees.

Note. Several residents noted the gradual loss of trees from within Dene Road. It is suggested that new trees are planted within the grass verges wherever trees are removed, or wherever large spaces exist.

Contents

1.0	Introduction	1
2.0	Instruction	1
3.0	Statutory tree protection	2
4.0	Ecological constraints	2
5.0	The tree survey.....	2
6.0	The trees	3
7.0	Recommendations.....	3
8.0	Signature.....	4
	Appendix 1 - Professional résumé	5
	Appendix 2 - Tree data schedule	6
	Appendix 3 - Tree data schedule explanatory notes	10
	Appendix 4-References.....	11
	Appendix 5 – Site plan	End of Report

1.0 Introduction

1.1 I am Trevor Heaps, Director of Trevor Heaps Arboricultural Consultancy Ltd. I hold a First-Class Honours Degree in Arboriculture; I am a Chartered Arboriculturist and a professional member of the Institute of Chartered Foresters; and I am also a Registered Consultant with the Arboricultural Association. Further information about my qualifications and experience is provided in Appendix 1.

1.2 The basic principle in Law is that a tree owner has a duty to take reasonable care to protect those reasonably likely to be affected by their trees.

1.3 Subsequently, a tree owner, or those responsible for the tree(s), must take steps to ensure they are aware of foreseeable risks that may cause harm; and they should take appropriate remedial action to protect those who are reasonably likely to be affected.

1.4 Guidance issued by the Government, the Forestry Commission and the Arboricultural Association advises that a regular tree survey is undertaken by a suitably qualified tree expert. Failure to do so may leave those responsible liable to prosecution.

1.5 Contact details:

Who	Name	Organisation	Details
Arboricultural Consultant	Trevor Heaps	THAC Ltd. 12 Plover Drive, Milford-on-Sea, Hampshire, SO41 0XF	Tel: 07957 763 533 E-mail: trevor@trevorheaps.co.uk
Client		Stonor Enterprises	
London Borough of Hillingdon - LPA	Tree Officer	Civic Centre, High Street, Uxbridge, UB8 1UW	Tel: 01895 556000 E-mail: trees@hillingdon.gov.uk

2.0 Instruction

2.1 We are instructed to carry out a tree survey to assess the condition of all trees along Dene Road.

2.2 Based on the data collected during the tree survey, we are to provide a report to make recommendations to manage all identifiable, foreseeable, and significant risks.

2.3 The purpose of this report is to demonstrate that the trees have been visually checked by a suitably qualified tree expert and to ensure that all reasonable measures are taken to ensure that persons and property are not at risk of harm from them.

3.0 Statutory tree protection

3.1 According to the Council's website, some trees along Dene Road are covered by a Tree Preservation Order (TPO); which means that if any tree works are required (to the trees covered by the TPO), an application must be made to the Council.

4.0 Ecological constraints

4.1 The Wildlife and Countryside Act 1981 (as amended by the Countryside and Rights of Way Act 2000) provides statutory protection to birds, bats and other species that inhabit trees.

4.2 These animals could impose significant constraints on the timing of any recommended tree works. You are therefore advised to seek advice from a suitably qualified ecologist prior to the start of any tree works.

5.0 The tree survey

5.1 The trees were inspected by Trevor Heaps on the 6th June 2024.

5.2 The weather was dry and sunny - visibility was good.

5.3 The trees were inspected from ground level.

5.4 The trees were inspected using the Visual Tree Assessment (VTA) methodology, developed by Mattheck & Breloer (The Body Language of Trees, 1994).

5.5 Neither root nor soil samples were taken for analysis.

6.0 The trees

6.1 The locations of all trees surveyed are shown on the site plan in Appendix 4. Further information about the trees can be found in appendices 2 & 3.

6.2 To help visualise the general condition of the trees on the site plan, they are colour coded as follows:

- **Tree coloured green – Acceptable** - These are in a normal condition with no significant defects.
- **Tree coloured amber – Be aware** - These are either located in an unsustainable position (a large species of tree close to property for example) or defects have been noted that could lead to future problems. Recommendations are made to remove the tree or the defects or reduce the defects to an acceptable level.
- **Tree coloured red – Take action** - These are hazardous to life and property and cannot be made safe by remedial works alone. These will need to be removed.
- **Tree coloured purple – N/A** - These have been removed since the last survey.

7.0 Recommendations

7.1 All recommendations are described in the tree data schedule in Appendix 3.

7.2 Any urgent works are highlighted red. These must be organised as a matter of urgency and carried out as soon as possible.

7.3 If lower priority works have been recommended, they are highlighted green, and should be carried out within the given timescales.


7.4 To help prioritise work, a risk index figure (between 0-100) has been provided. The larger the number, the more important the work will be.

7.5 If re-inspection timescales (other than every 3 years) are specified, these are highlighted yellow.

8.0 Signature

8.1 This report represents a true and factual account of all potential arboricultural issues and makes recommendations for appropriate remedial action.

Signed

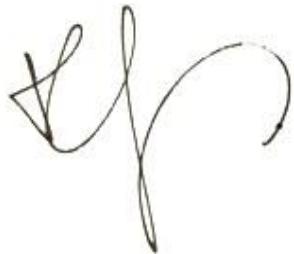

Trevor Heaps

Chartered Arboriculturist

BSc (Hons), MArborA, MICFor.

Dated

7th June 2024

Appendix 1 - Professional résumé

I am Trevor Heaps, Director of Trevor Heaps Arboricultural Consultancy Ltd. I hold a First-Class Honours Degree in Arboriculture; I am a Chartered Arboriculturist and a professional member of the Institute of Chartered Foresters; and I am also a Registered Consultant with the Arboricultural Association.

Professional training

- Arboriculture and Bats: Scoping Surveys for Arborists (BCT & AA) – October 2017
- Tree Science (AA) – June 2016
- OPM (Oak Processionary Moth) Training (FC) – May 2016
- Visual Tree Assessment (Arboricultural Association) - October 2015
- Trees and the Law (Dr Charles Mynors) - June 2015
- Mortgage (Home Buyers) Report Writing (LANTRA / CAS) - February 2015
- Tree Preservation Orders - effective application (LANTRA / CAS) - November 2014
- Professional Tree Inspection 3-day course (LANTRA / AA) - July 2014
- Arboricultural Consultancy Course (AA) - May 2014
- Further down the subsidence trail 1-day course (AA) - April 2013
- Getting to grips with subsidence 1-day course (AA) - November 2012

AA – Arboricultural Association

BCT – Bat Conservation Trust

CAS – Consulting Arborist Society

FC – Forestry Commission

Appendix 2 - Tree data schedule

Ref	Species	Comments	Likelihood of problem occurring within 3 years	Risk Index (0-100 / low-high)	Recommendations	Priority	When to re-inspect
T1	<i>Tilia X europaea</i> (Common Lime)	Lapsed pollard. Decay noted at base. Quite sparse. Outside 63. Sounds hollow when tapper	Possible	9.375	Re-pollard.	Within 1 year	Within 3 years
T2	<i>Tilia X europaea</i> (Common Lime)	Lapsed pollard. Decay noted at base. Very sparse. Die-back in crown. Outside 59. Large decaying cavity on house side	Likely	18.75	Remove.	As soon as practicable	N/A to be removed
T3	<i>Tilia X europaea</i> (Common Lime)	Lapsed pollard. Ganoderma noted at base. <i>Kretzschmaria deusta</i> noted. Outside 57	Likely	18.75	Remove.	Within 1 year	N/A to be removed
T4	<i>Acer platanoides</i> 'Crimson King' (Norway Maple 'Crimson King')	Outside 55	Unlikely or N/A	0		N/A	Within 3 years
T5	<i>Tilia X europaea</i> (Common Lime)	Crown reduced in past. Epicormics. Outside 53	Unlikely or N/A	0		N/A	Within 3 years
T6	<i>Fraxinus excelsior</i> (Ash)	Hard to inspect base due to location and undergrowth.	Unlikely or N/A	0		N/A	Within 3 years
T7	<i>Tilia X europaea</i> (Common Lime)	Hard to inspect base due to basal growth. Lapsed pollard managed by crown reductions. Epicormics. Old tear-out wound noted.	Unlikely or N/A	0	Remove epicormics from base of tree and re-inspect for defects. Re-pollard to 5m	Within 1 year	Within 3 years
T8	<i>Fraxinus excelsior</i> (Ash)	Hard to inspect base due to location and undergrowth.	Unlikely or N/A	0		N/A	Within 3 years
T9	<i>Prunus cerasifera</i> 'Pissardii' (Purple-leaved Plum)	Dead / dying tree	Likely	12.5	Remove.	Within 1 year	N/A to be removed
T10	<i>Acer pseudoplatanus</i> (Sycamore)	Hard to inspect base due to location and undergrowth.	Unlikely or N/A	0		N/A	Within 3 years
T11	<i>Tilia cordata</i> (Small-leaved Lime)	Hard to inspect base due to location and undergrowth.	Unlikely or N/A	0		N/A	Within 3 years
T12	<i>Fraxinus excelsior</i> (Ash)	Hard to inspect base due to location and undergrowth.	Unlikely or N/A	0		N/A	Within 3 years
T13	<i>Quercus robur</i> (Common Oak)	Hard to inspect base due to location and undergrowth. Suppressed.	Unlikely or N/A	0		N/A	Within 3 years

Ref	Species	Comments	Likelihood of problem occurring within 3 years	Risk Index (0-100 / low-high)	Recommendations	Priority	When to re-inspect
T14	Aesculus hippocastanum (Horse Chestnut)	Hard to inspect base due to location and undergrowth.	Unlikely or N/A	o		N/A	Within 3 years
G15	Fraxinus excelsior (Ash)	Sparse.	Unlikely or N/A	o		N/A	Within 3 years
G16	Acer campestre (Field Maple)	Hard to inspect base due to location and undergrowth.	Unlikely or N/A	o		N/A	Within 3 years
T17	Tilia X europaea (Common Lime)	Crown reduced in past. Outside 51	Unlikely or N/A	o		N/A	Within 3 years
T18	Tilia X europaea (Common Lime)	Hard to inspect base due to basal growth. Epicormics. Ganoderma noted at base. Jct College Way. Large vertical cavity on roadside	Unlikely or N/A	o	Re-pollard. Remove epicormics from base of tree and re-inspect for defects.	Within 1 year	Within 3 years
T19	Tilia X europaea (Common Lime)	Hard to inspect base due to basal growth. Crown reduced in past. Epicormics. Outside 47	Unlikely or N/A	o	Remove epicormics from base of tree and re-inspect for defects.	Within 1 year	Within 3 years
T20	Tilia X europaea (Common Lime)	Hard to inspect base due to basal growth. Lapsed pollard managed by crown reductions. Opp High Elms Close. Quite recently pruned. Heavy epicormic growth covering tree	Unlikely or N/A	o	Remove epicormics from base of tree and re-inspect for defects.	Within 1 year	Within 3 years
T21	Acer platanoides 'Crimson King' (Norway Maple 'Crimson King')	Entrance to Sunshine House	Unlikely or N/A	o		N/A	Within 3 years
T22	Acer platanoides 'Crimson King' (Norway Maple 'Crimson King')	Entrance to Sunshine House	Unlikely or N/A	o		N/A	Within 3 years
T23	Tilia X europaea (Common Lime)	Hard to inspect base due to basal growth. Lapsed pollard managed by crown reductions. Leaning (not significant). Is 46	Unlikely or N/A	o	Remove epicormics from base of tree and re-inspect for defects.	Within 1 year	Within 3 years

Ref	Species	Comments	Likelihood of problem occurring within 3 years	Risk Index (0-100 / low-high)	Recommendations	Priority	When to re-inspect
T24	<i>Tilia X europaea</i> (Common Lime)	Hard to inspect base due to basal growth. Opp Wildwood. Quite recently pruned. Heavy epicormic growth covering tree	Unlikely or N/A	0	Remove epicormics from base of tree and re-inspect for defects.	Within 1 year	Within 3 years
T25	<i>Tilia X europaea</i> (Common Lime)	Dead tree.	Likely	18.75	Remove.	Within 1 year	N/A to be removed
T26	<i>Tilia X europaea</i> (Common Lime)	Hard to inspect base due to basal growth. Exit for Sunshine House. Quite recently pruned. Heavy epicormic growth covering tree	Unlikely or N/A	0	Remove epicormics from base of tree and re-inspect for defects.	Within 1 year	Within 3 years
T27	<i>Tilia X europaea</i> (Common Lime)	Hard to inspect base due to basal growth. Minor deadwood in crown. Opp exit for Sunshine House. Heavy epicormic growth covering tree. Cavity at 1m sealing well.	Unlikely or N/A	0	Remove epicormics from base of tree and re-inspect for defects.	Within 1 year	Within 3 years
T28	<i>Tilia X europaea</i> (Common Lime)	Hard to inspect base due to basal growth. Minor deadwood in crown. Near exit for Sunshine House. Heavy epicormic growth covering tree	Unlikely or N/A	0	Remove deadwood. Remove epicormics from base of tree and re-inspect for defects.	Within 1 year	Within 3 years
T29	<i>Tilia X europaea</i> (Common Lime)	Outside 42	Unlikely or N/A	0		N/A	Within 3 years
T30	<i>Tilia X europaea</i> (Common Lime)	Hard to inspect base due to basal growth. Epicormics. Opp 42, Significant decay on roadside	Likely	18.75	Pollard to 6-8m OR remove	As soon as practicable	Within 3 years
T31	<i>Tilia X europaea</i> (Common Lime)	Outside 40. Cavity at base to 1m sealing well.	Unlikely or N/A	0		N/A	Within 3 years
T32	<i>Fraxinus excelsior</i> (Ash)	Growing on third-party land. Very sparse. Die-back in crown. Opp 29 (within 38 or 40)	Possible	12.5	Notify tree owner (tree's condition should be assessed)	Within 1 year	Within 3 years

Ref	Species	Comments	Likelihood of problem occurring within 3 years	Risk Index (0-100 / low-high)	Recommendations	Priority	When to re-inspect
T33	<i>Tilia X europaea</i> (Common Lime)	Hard to inspect base due to basal growth. Epicormics. Outside 38. Extensive cavity on back of stem	Possible	9.375	Pollard to 5m OR remove	As soon as practicable	Within 3 years
T34	<i>Betula pendula</i> (Silver Birch)	Outside 38	Unlikely or N/A	o		N/A	Within 3 years
T35	<i>Betula pendula</i> (Silver Birch)	Outside 36	Unlikely or N/A	o		N/A	Within 3 years
T36	<i>Tilia X europaea</i> (Common Lime)	Outside 36	Unlikely or N/A	o		N/A	Within 3 years
T37	<i>Tilia X europaea</i> (Common Lime)	Hard to inspect base due to basal growth. Epicormics. Minor die-back in crown. Opp Felden	Unlikely or N/A	o	Remove deadwood. Remove epicormics from base of tree and re-inspect for defects.	Within 1 year	Within 3 years
T38	<i>Tilia X europaea</i> (Common Lime)	Hard to inspect base due to location and undergrowth. Epicormics. Minor die-back in crown. Outside 33/32. Sounds slightly hollow when tapped	Unlikely or N/A	o	Remove deadwood. Remove epicormics from base of tree and re-inspect for defects.	Within 1 year	Within 3 years
T39	<i>Tilia X europaea</i> (Common Lime)	Outside 30a	Unlikely or N/A	o		N/A	Within 3 years
T40	<i>Tilia X europaea</i> (Common Lime)	Outside 30a	Unlikely or N/A	o		N/A	Within 3 years
T41	<i>Tilia X europaea</i> (Common Lime)	Epicormics. Minor die-back in crown.	Unlikely or N/A	o		N/A	Within 3 years
T42	<i>Tilia X europaea</i> (Common Lime)	Dead tree. Growing on third-party land. Looks to be within 17 Dene Road	Likely	25	Notify tree owner (dead / dying tree within falling distance).	As soon as practicable	N/A on third-party land
G43	<i>Pinus ssp.</i> (Pine)	Ivy (heavy covering). Quite sparse. Opp 24a	Unlikely or N/A	o	Remove ivy to 2-3m up stem and reinspect for defects	Within 1 year	Within 3 years
T44	<i>Tilia X europaea</i> (Common Lime)	Epicormics. Minor deadwood in crown. Opp 22a	Unlikely or N/A	o	Remove deadwood. Remove epicormics from base of tree and re-inspect for defects.	Within 1 year	Within 3 years
T45	<i>Tilia X europaea</i> (Common Lime)	Epicormics. Minor deadwood in crown. Opp 22. Dense epicormics	Unlikely or N/A	o	Remove deadwood. Remove epicormics from base of tree and re-inspect for defects.	Within 1 year	Within 3 years

Appendix 3 - Tree data schedule explanatory notes

This section explains the terms used in the **Tree data schedule** (Appendix 2).

Ref: Each item of vegetation has its own unique number prefixed by a letter such that:

T1=Tree **S2**=Shrub or stump **G3**=Group **H4**=Hedge **W5**=Woodland

Species: Common names are given (with Latin names given in brackets)

VTA – Visual Tree Assessment

1 (tree coloured green) – Acceptable - These are in a normal condition with no significant defects.

2 (tree coloured amber) – Be aware - These are either located in an unsustainable position (a large species of tree close to property for example) or defects have been noted that could lead to future problems. Recommendations are made to remove the tree or the defects or reduce the defects to an acceptable level.

3 (tree coloured red) – Take action - These are hazardous to life and property and cannot be made safe by remedial works alone. These will need to be removed.

4 (tree coloured purple) – N/A – These have been removed since the last survey.

Comments: Tree form and pruning history are recorded along with an account of any significant defects

Likelihood of failure or problem occurring: The tree surveyor's opinion on how likely it is the tree or part of it will fail or cause an issue (such as direct or indirect damage) within 1 year.

Risk Index: An estimate of risk (0 = no risk to 100 = very high risk) based on a calculation made from the assumed occupancy, the size of the tree (or defect) and the assumed likelihood of a problem occurring (see above). This allows work to be prioritised.

Recommendations: These are based on any defects / problems observed and are intended to ensure that the tree is maintained in an acceptable condition.

Priority: Depending upon the threat posed by the tree, and the likelihood of a problem occurring, any recommendations made should be carried out within the prescribed timescales.

When to re-inspect: The suggested interval before the next inspection should be carried out.

Appendix 4–References

¹OPSTD/Agriculture and Waste Recycling Sector/ Agriculture Safety Section (2015), *Management of the risk from falling trees or branches*. Available at https://www.hse.gov.uk/foi/internalops/sims/ag_food/010705.htm# (Accessed: 14 January 2020).

²Forestry Commission (2011), *Common sense risk management of trees, Managing trees for safety*.

³Arboricultural Association (2016), *Tree Surveys: A guide to good practice, Guidance Note 7*.

⁴Mattheck & Breloer (1994), *The Body Language of Trees*, 1994.

⁵Watson and Green (2011), *Fungi on Trees – an Arborists' Field Guide*.

Appendix 5 - Site Plan

Aerial photo showing the approximate locations of the tree/s (Google Earth background). See Appendices 3 & 4 for an explanation of the colours used.

