

Level and Crack Monitoring

Our Ref: 509702

Date of Issue: 19/08/2019

Provider Details

CET Property Services - 0116 2605309

Monitoring Details

Instruction Date:	25/04/2018		
Number of visits	5	Visit Frequency (Wks)	8

Visit Dates (future dates are estimated)

Setup	1	2	3	4	5	6
21/06/18						

Client Details

Insurance Co.:	
Client Ref:	6757279
Client Name:	Sedgwick
Technical Mgr:	Mike Robinson
Customer support	Jake Anderton
Tel:	01622 608831
Email:	#N/A


Risk Address

Occupier:	Removed for data protection purposes
Address:	15 Mallard Way
Address:	Northwood
Town:	Middlesex
County:	
Post Code:	HA6 2GG
Contact Name	Removed for data protection purposes

Level and Crack Monitoring - Site Sketch

Our Ref: 509702

Date of Issue: 19/08/2019

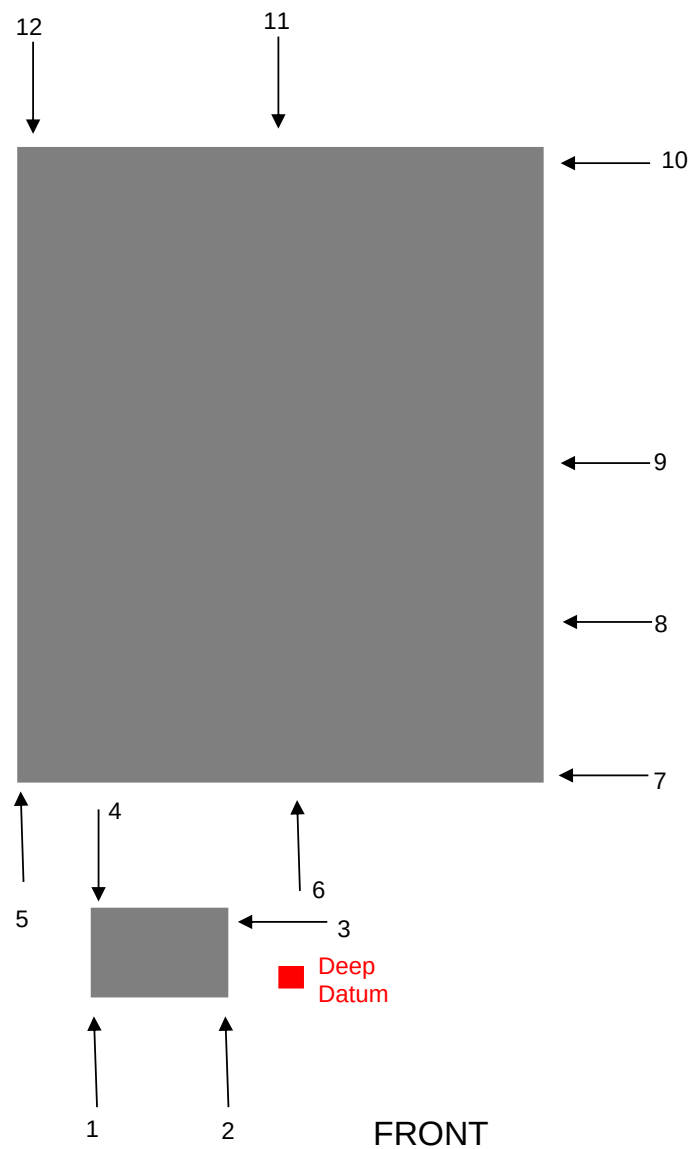

Level Monitoring - Reduced Levels (in metres)

Our Ref:

509702

Date of Issue:

19/08/19

Reading Date	21/6/18	13/8/18	19/11/18	6/3/19	29/5/19	19/8/19						
Point / Reading	1	2	3	4	5	6	7	8	9	10	11	12
1	10.4078	10.3908	10.3936	10.4041	10.4043	10.3861						
2	10.3889	10.3700	10.3737	10.3852	10.3832	10.3661						
3	10.3916	10.3734	10.3769	10.3883	10.3874	10.3702						
4	10.4151	10.3990	10.4013	10.4104	10.4119	10.3939						
5	10.2803	10.2792	10.2799	10.2800	10.2799	10.2818						
6	10.2841	10.2837	10.2840	10.2852	10.2849	10.2863						
7	10.2836	10.2816	10.2822	10.2831	10.2833	10.2846						
8	10.2789	10.2780	10.2784	10.2793	10.2778	10.2798						
9	10.2792	10.2784	10.2791	10.2793	10.2789	10.2807						
10	10.2818	10.2821	10.2831	10.2838	10.2823	10.2846						
11	10.2778	10.2779	10.2792	10.2797	10.2783	10.2798						
12	10.2788	10.2798	10.2806	10.2806	10.2796	10.2813						
Not Used												
Not Used												
Not Used												
Not Used												
Tech Initials	NM	DL	AH	MT	MT	AH						
Level S/N.	521947	521856	521816	522222	521947	521947						

Level Monitoring - Movement (in millimetres)

Our Ref:


509702

Date of Issue

19/08/19

[illegible]

Level Monitoring - Movement relative to datum against Date

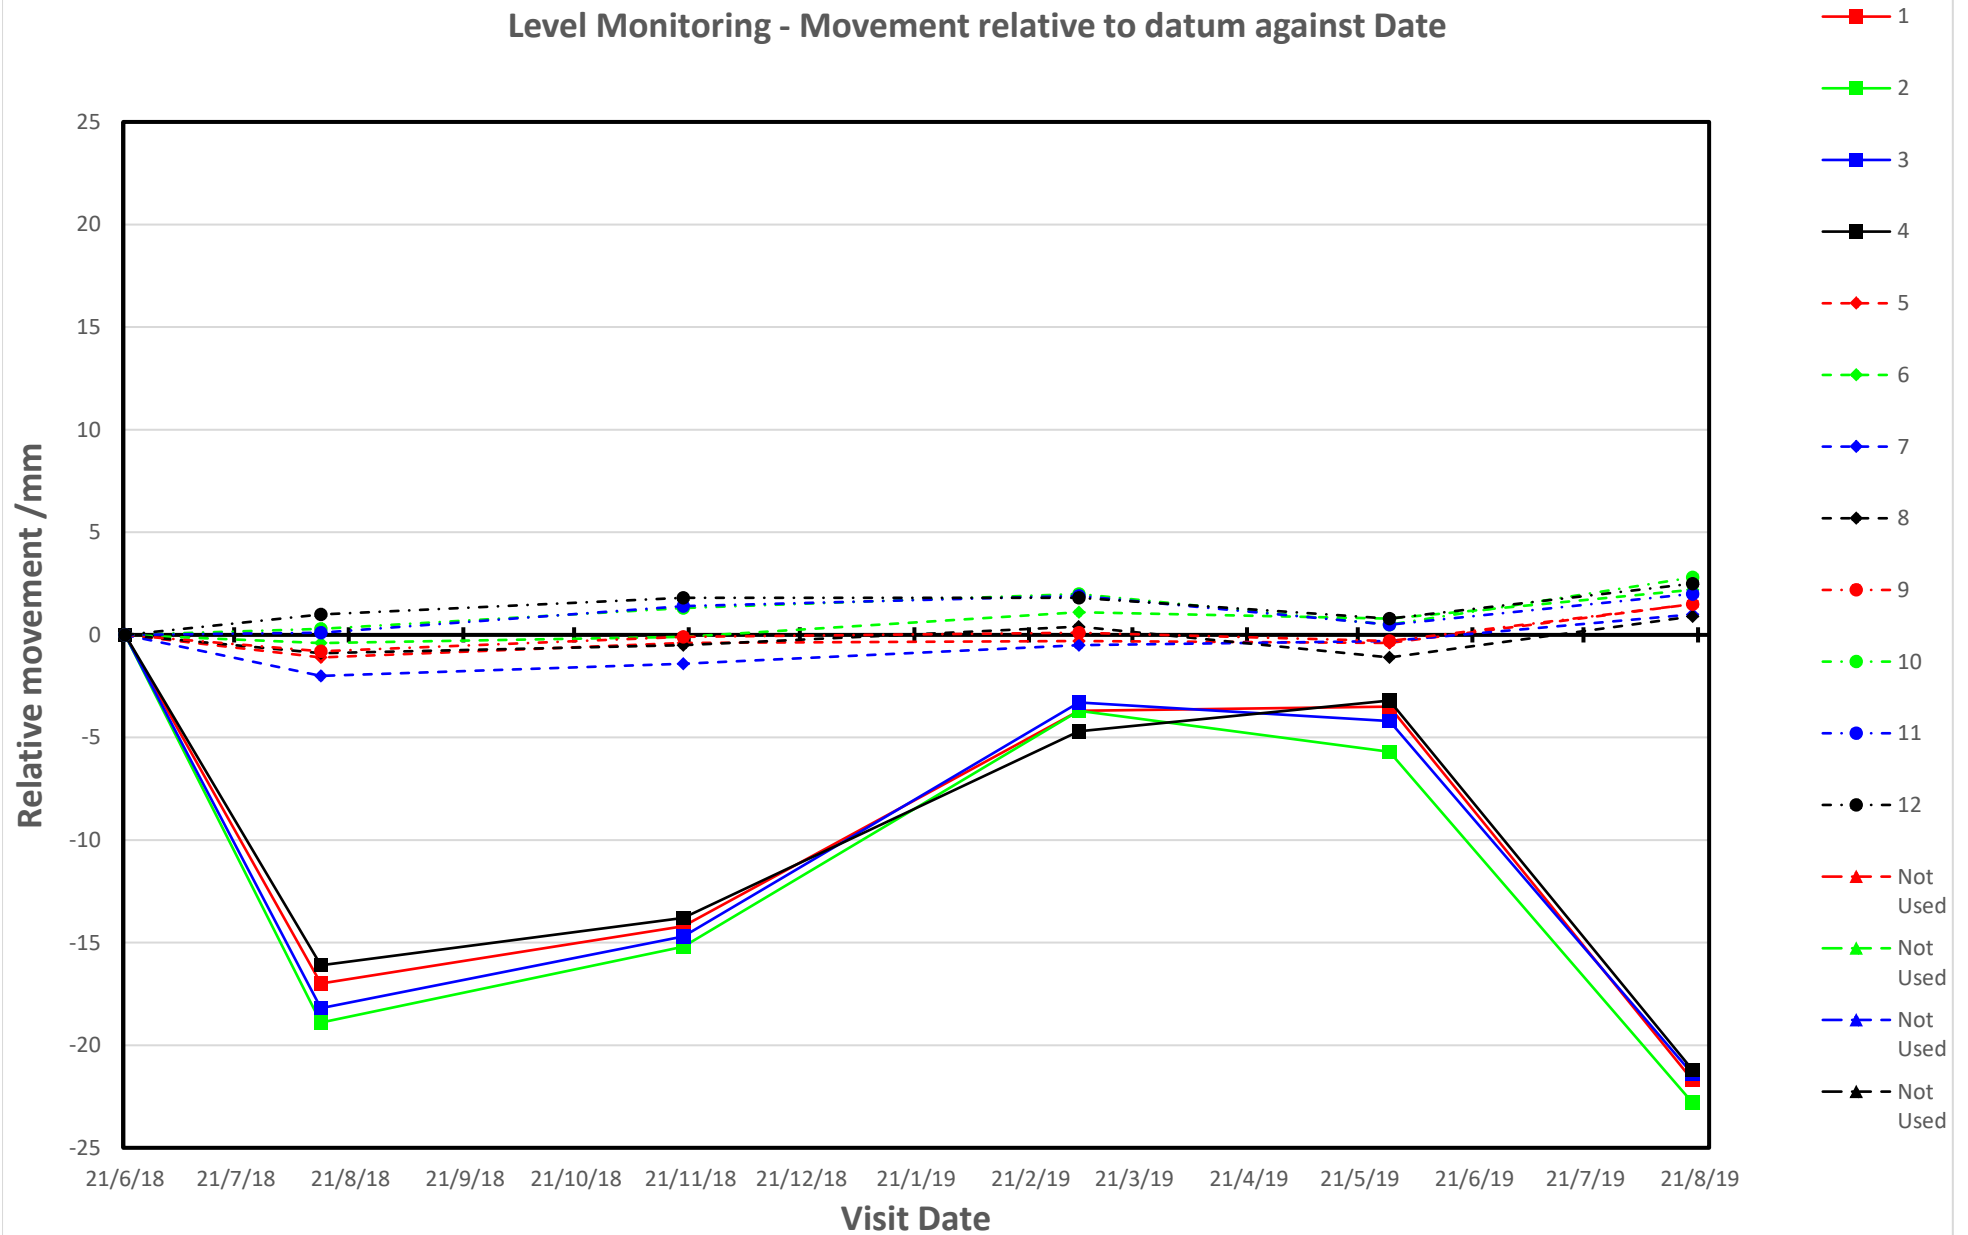



Our ref	Client ref	Client Name	Issue Date
509702	6757279	Sedgwick	19/08/2019

Stud locations

1	INT Kitchen Wall to Lounge Next To Radiator
2	EXT on Bin Store RH ELE LHS of Lintel
3	EXT on Bin Store RH ELE LHS of Lintel
4	
5	
6	

Additional instructions / notes

Crack Monitoring - Readings

Studs nos.	Align-ment	Visit Date	21/06/18	Visit Date	13/08/18	Visit Date	19/11/18	Visit Date	06/03/19	Visit Date	29/05/19	Visit Date	19/08/19
		Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w
1	H	38.65	0.84	38.59	0.78	38.37	0.74	38.03	0.51	38.15	0.88	38.43	0.95
1	D												
1	Check												
2	H	55.62	2.88	56.11	3.48	56.04	2.98	54.41	3.55	54.38		55.35	
2	V	64.58	9.02	64.90	8.84	64.50	8.44	64.49	10.42	64.57	10.52	65.11	10.89
2	Check												
3	D												
3	H	84.29				84.11	83.93	83.00				84.50	
3	Check												
4	H												
4	D												
4	Check												
5	H												
5	D												
5	Check												
6	H												
6	D												
6	Check												
Calliper nos :		2860		4044		4191		4044		4044		7539	
Technician :		NM/RH		DL		AH		mt		MT		AH	

Our ref	Client ref	Client Name	Issue Date
509702	6757279	Sedgwick	19/08/2019

Crack Monitoring - Movement Against Time

