

Monitoring Details:

Provider Name: CET

Monitoring Interval: Every 4 weeks

Instruction Date: 30/08/2022

Number of Visits: MUFN

Reading Date:

Visits Completed: 8

Date of Issue: 13/10/2023

Visits Outstanding: MUFN

Client Details:

Client: Sedgwick

Engineer / Handler: Gen Samuda

Job Reference: 6856747

Monitored Address:


Occupier: Mr Arif Sayani

Address: 14 Watford Road, NORTHWOOD, Middlesex, HA6 3NR

Telephone: 07881814756

Email: -

Site Plan

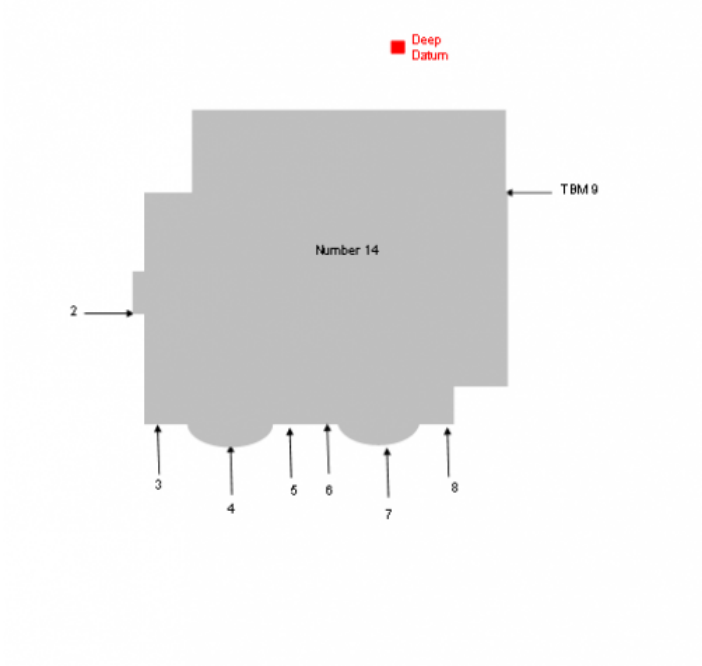

Level Readings

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	24/10/18	20/12/18	01/03/19	02/05/19	28/06/19	22/08/19	09/10/19	06/12/19	01/04/20	20/05/20
1	9.8238	9.8246	9.8256	9.8250	9.8251	9.8232	9.8235	9.8249	9.8250	9.8237
2	9.9638	9.9650	9.9656	9.9659	9.9671	9.9646	9.9613	9.9626	9.9650	9.9637
3	9.8175	9.8191	9.8202	9.8209	9.8215	9.8138	9.8121	9.8146	9.8181	9.8165
4	9.5754	9.5793	9.5808	9.5820	9.5828	9.5706	9.5677	9.5717	9.5768	9.5753
5	9.8349	9.8364	9.8374	9.8386	9.8394	9.8339	9.8303	9.8325	9.8347	9.8337
6	9.8302	9.8324	9.8337	9.8356	9.8361	9.8281	9.8249	9.8279	9.8319	9.8311
7	9.4976	9.5033	9.5062	9.5104	9.5108	9.5006	9.4939	9.4974	9.5078	9.5069
8	9.7591	9.7598	9.7598	9.7608	9.7614	9.7590	9.7577	9.7565	9.7593	9.7584
TBM _g	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000
Taken by	N.D	RH	N.D	N.M	N.D	N.D	RH	D.D	N.M	N.M
Serial number	521947	521816	522222	522955	521818	521818	521818	521818	523149	523149

Level Readings

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	15/09/22	11/10/22	07/11/22	20/12/22	23/01/23	08/03/23	06/07/23	03/08/23	13/10/23	
1										
2	9.9634	9.9636	9.9633	9.9649	9.9655	9.9655	9.9643	9.9636	9.9633	
3	9.8197	9.8195	9.8190	9.8212	9.8212	9.8215	9.8203	9.8199	9.8210	
4	9.5784	9.5790	9.5759	9.5785	9.5793	9.5806	9.5788	9.5768	9.5776	
5	9.8284	9.8282	9.8280	9.8295	9.8291	9.8297	9.8278	9.8265	9.8255	
6	9.8057	9.8044	9.8061	9.8094	9.8105	9.8116	9.8082	9.8062	9.8021	
7	9.4735	9.4742	9.4766	9.4784	9.4818	9.4842	9.4779	9.4760	9.4700	
8	9.7520	9.7521	9.7512	9.7532	9.7526	9.7532	9.7514	9.7500	9.7479	
TBM _g	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	
Taken by	O.B	N.M	E.C	O.B	N.M	O.B	B.J	B.J	B.J	
Serial number	523158	523936	529399	524694	15	524694	523149	523158	523158	


Level Movement (Displayed in Millimeters)

[illegible]


Level Movement (Displayed in Millimeters) - Continuation of readings

[illegible]

Level Readings Chart (Points 1 - 5)

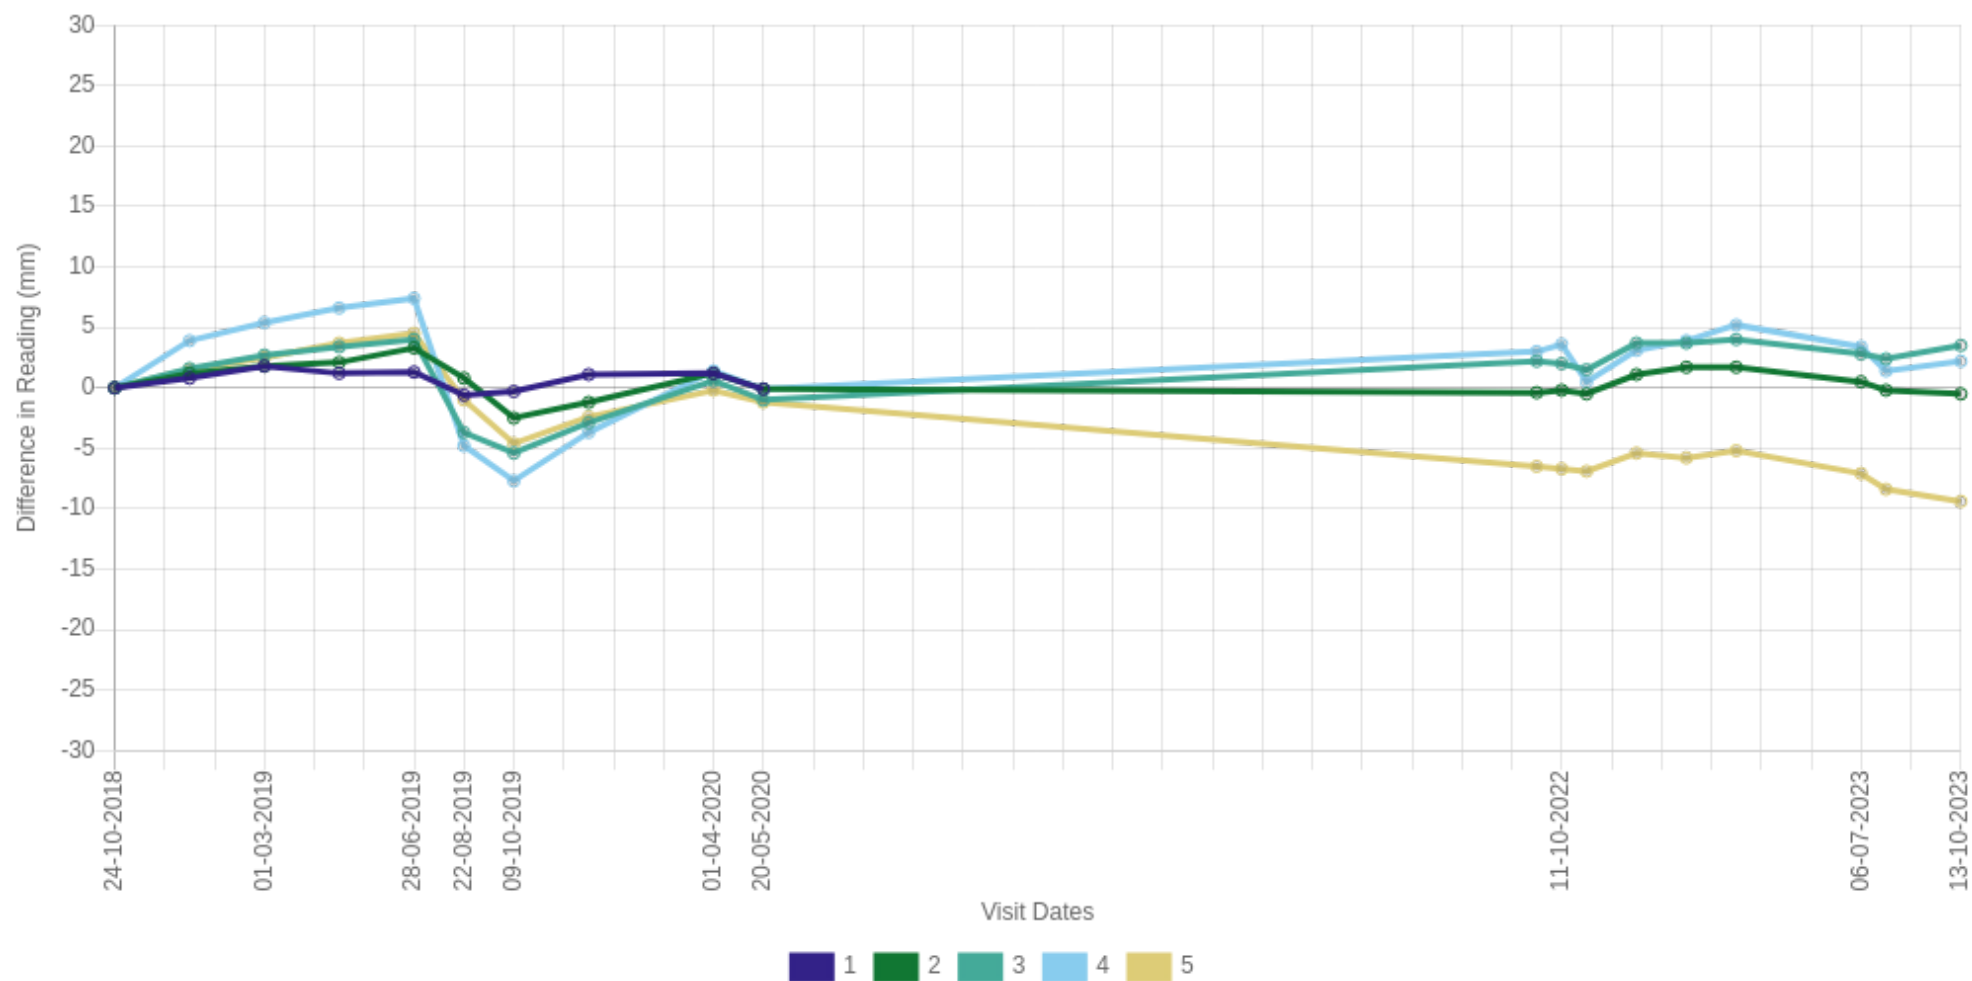

Level Readings Chart (Points 6 - TBM 9)

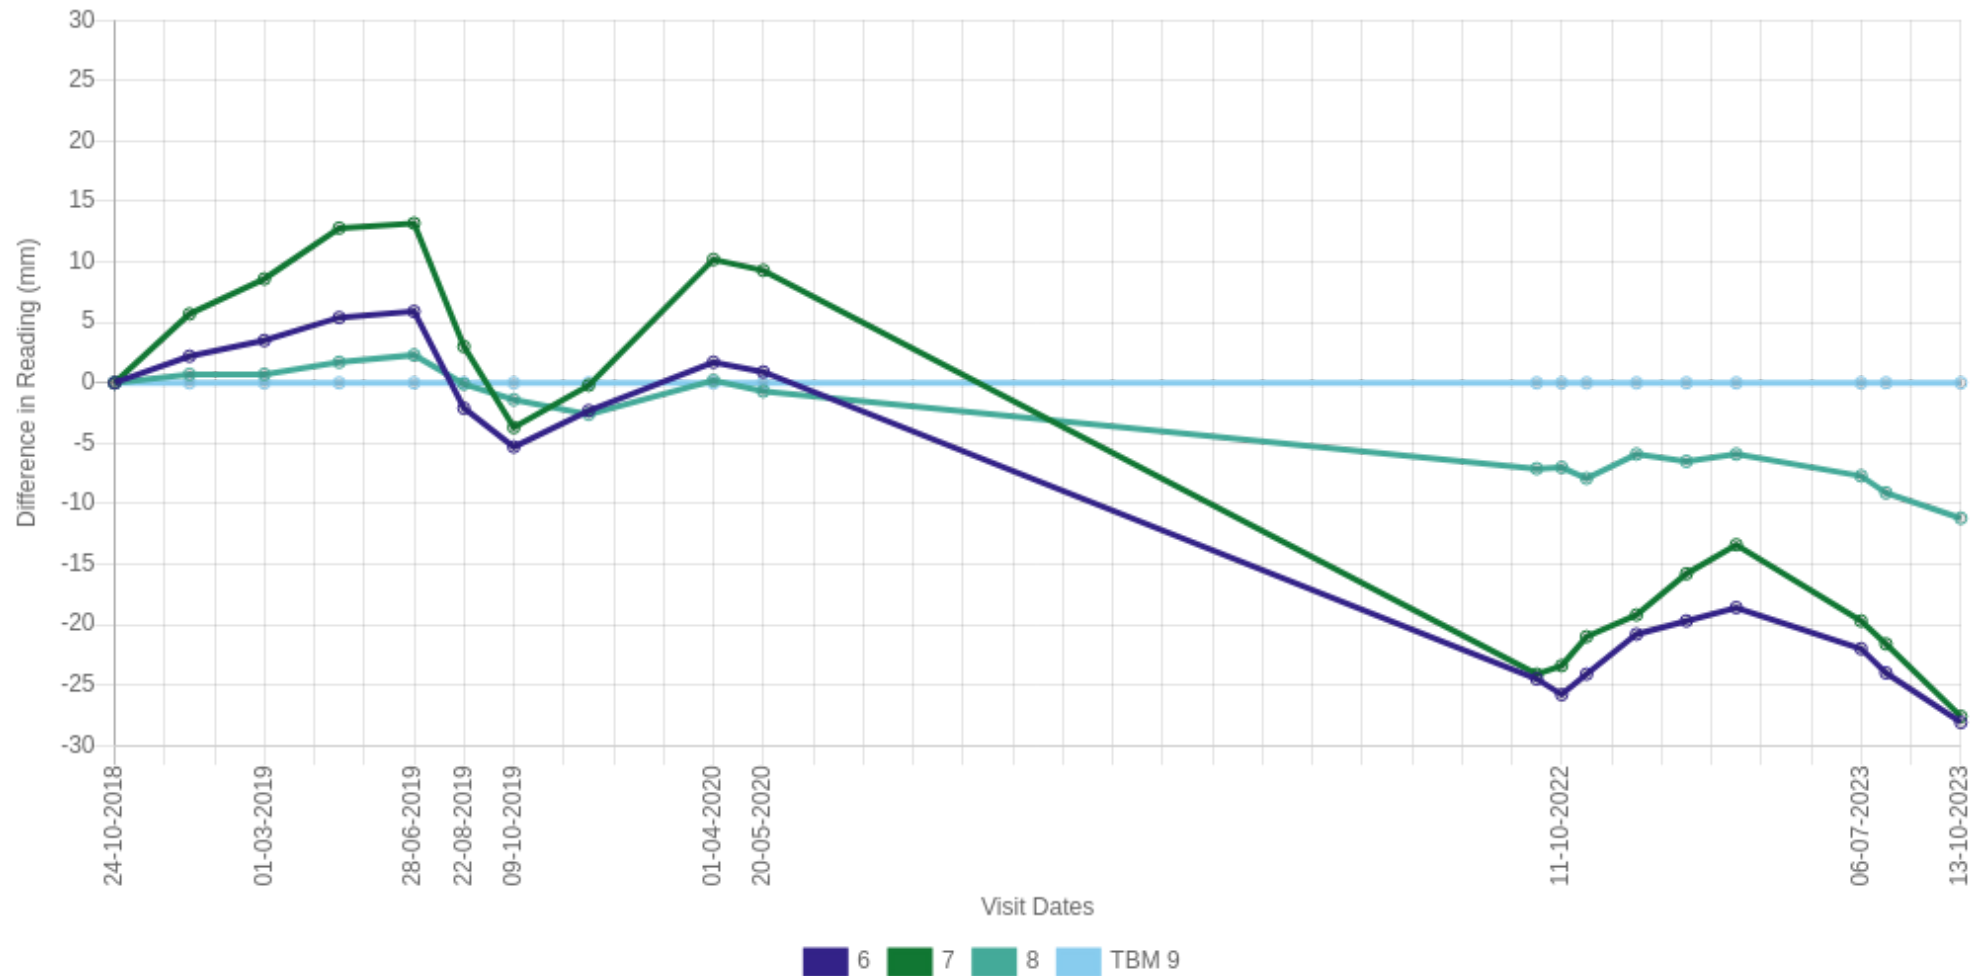


Crack Monitoring

INT above front door refit

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	20/12/18	01/03/19	02/05/19	28/06/19	22/08/19	09/10/19	06/12/19	01/04/20	20/05/20	15/09/22
H										68.54
D										
C										
Taken by	RH	JM	NM	NA	NA	RH	NM	N.M	N.M	O.B
Callipers	4141	4044	2860	4190	570	4141	570	2860	2860	2016

INT above front door refit - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	20/12/18	01/03/19	02/05/19	28/06/19	22/08/19	09/10/19	06/12/19	01/04/20	20/05/20	15/09/22
H										0
D										
C										

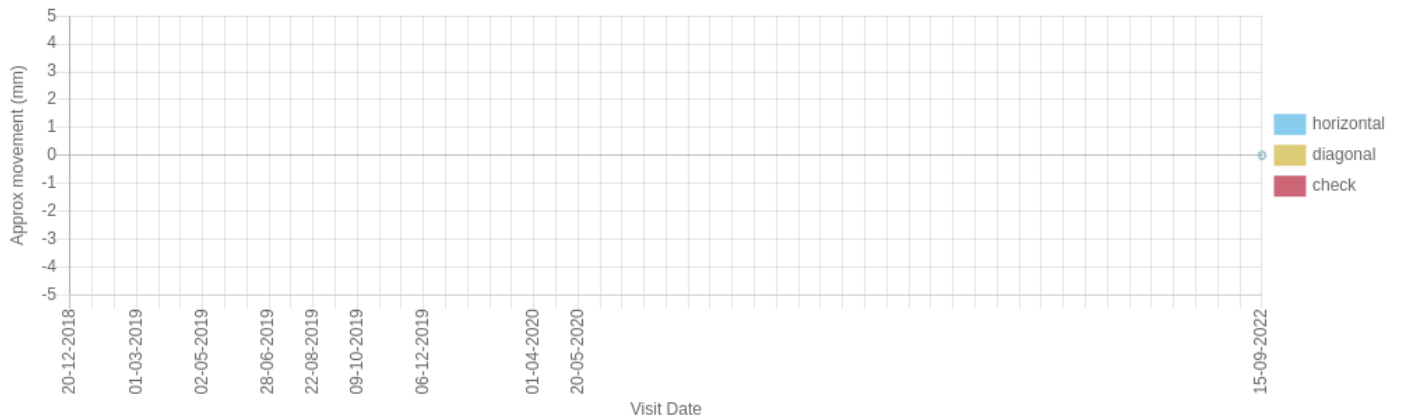

INT above front door refit - Photo




Crack Monitoring

INT above front door refit

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	11/10/22	07/11/22	20/12/22	23/01/23	08/03/23	06/07/23	03/08/23	13/10/23		
H	69.59	68.15	67.12	66.58	66.1	67.54	68.23	70.4		
D										
C										
Taken by	N.M	N.M	O.B	N.M	O.B	BJ	BJ	BJ		
Callipers	o850	o850	2016	850	2016	66878	66878	66878		

INT above front door refit - Crack Readings Differences (Displayed in Millimetres)

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	11/10/22	07/11/22	20/12/22	23/01/23	08/03/23	06/07/23	03/08/23	13/10/23		
H	1.05	-0.39	-1.42	-1.96	-2.44	-1	-0.31	1.86		
D										
C										

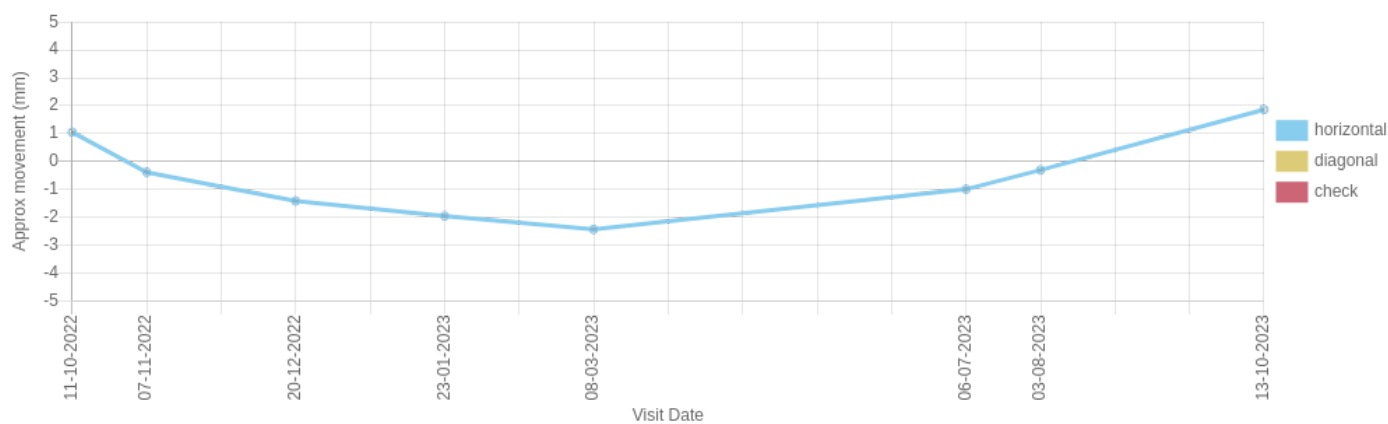

INT above front door refit - Photo




Crack Monitoring

INT under study bay window REFIT

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	20/12/18	01/03/19	02/05/19	28/06/19	22/08/19	09/10/19	06/12/19	01/04/20	20/05/20	15/09/22
H										80.88
D										97.12
C										57.16
Taken by	RH	JM	NM	NA	NA	RH	NM	N.M	N.M	O.B
Callipers	4141	4044	2860	4190	570	4141	570	2860	2860	2016

INT under study bay window REFIT - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	20/12/18	01/03/19	02/05/19	28/06/19	22/08/19	09/10/19	06/12/19	01/04/20	20/05/20	15/09/22
H										0
D										0
C										0

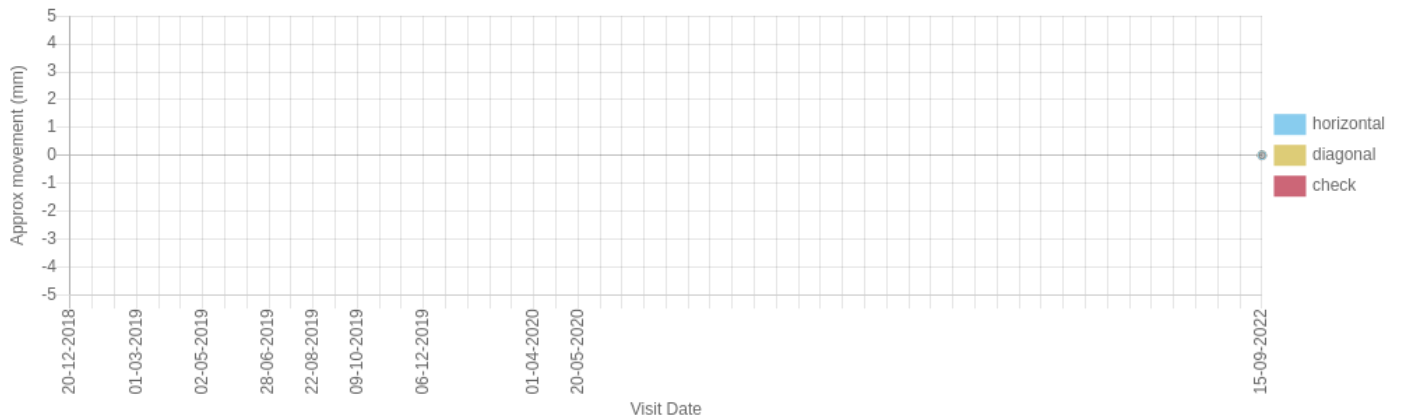

INT under study bay window REFIT - Photo




Crack Monitoring

INT under study bay window REFIT

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	11/10/22	07/11/22	20/12/22	23/01/23	08/03/23	06/07/23	03/08/23	13/10/23		
H	81.24	80.64	79.61	79.1	78.55	79.7	79.75	79.93		
D	97.64	97.2	95.61	95	94.51	95.67	95.82	96.15		
C	57.21	57.22	57.16	57.22	57.15	57.13	57.1	57.1		
Taken by	N.M	N.M	O.B	N.M	O.B	BJ	BJ	BJ		
Callipers	0850	0850	2016	850	2016	66878	66878	66878		

INT under study bay window REFIT - Crack Readings Differences (Displayed in Millimetres)

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	11/10/22	07/11/22	20/12/22	23/01/23	08/03/23	06/07/23	03/08/23	13/10/23		
H	0.36	-0.24	-1.27	-1.78	-2.33	-1.18	-1.13	-0.95		
D	0.52	0.08	-1.51	-2.12	-2.61	-1.45	-1.3	-0.97		
C	0.05	0.06	0	0.06	-0.01	-0.03	-0.06	-0.06		

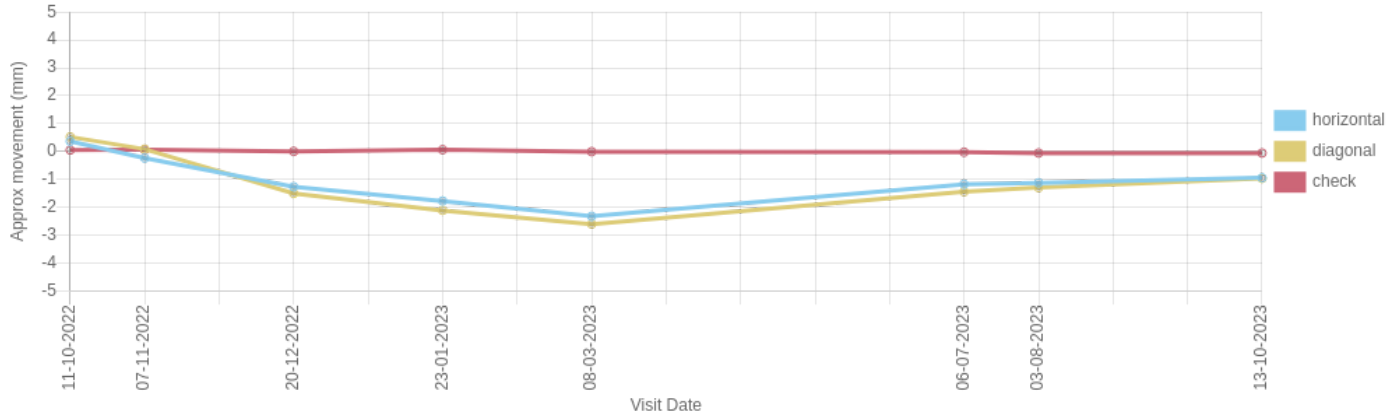

INT under study bay window REFIT - Photo




Crack Monitoring

INT 1st floor landing side wall

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	20/12/18	01/03/19	02/05/19	28/06/19	22/08/19	09/10/19	06/12/19	01/04/20	20/05/20	15/09/22
H										9525
D										
C										
Taken by	RH	JM	NM	NA	NA	RH	NM	N.M	N.M	O.B
Callipers	4141	4044	2860	4190	570	4141	570	2860	2860	2016

INT 1st floor landing side wall - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	20/12/18	01/03/19	02/05/19	28/06/19	22/08/19	09/10/19	06/12/19	01/04/20	20/05/20	15/09/22
H										0
D										
C										

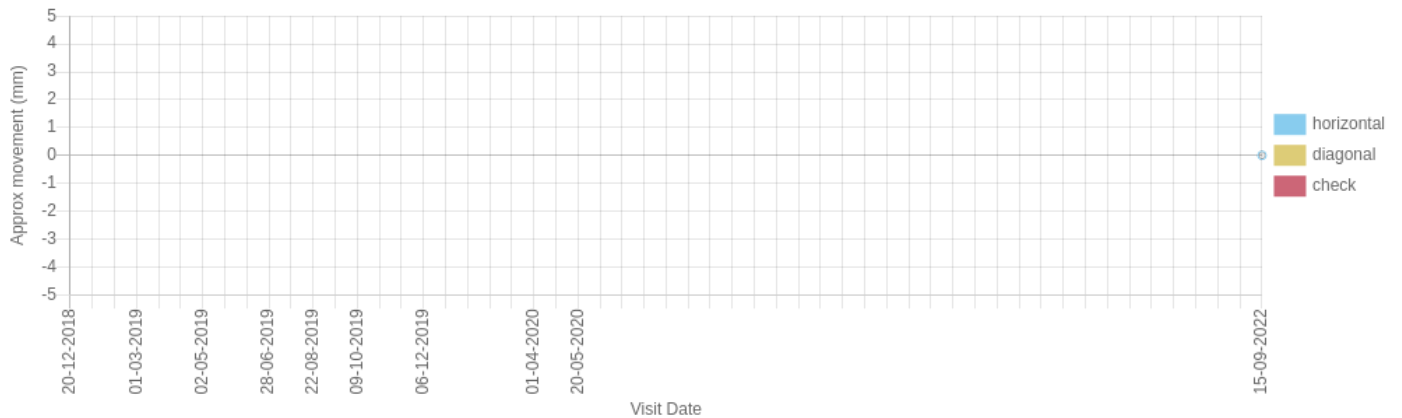

INT 1st floor landing side wall - Photo




Crack Monitoring

INT 1st floor landing side wall

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	11/10/22	07/11/22	20/12/22	23/01/23	08/03/23	06/07/23	03/08/23	13/10/23		
H	9535	9538	9525	9528	9527	9511	9525	9539		
D										
C										
Taken by	N.M	N.M	O.B	N.M	O.B	BJ	BJ	BJ		
Callipers	o850	o850	2016	850	2016	66878	66878	66878		

INT 1st floor landing side wall - Crack Readings Differences (Displayed in Millimetres)

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	11/10/22	07/11/22	20/12/22	23/01/23	08/03/23	06/07/23	03/08/23	13/10/23		
H	0.1	0.13	0	0.03	0.02	-0.14	0	0.14		
D										
C										

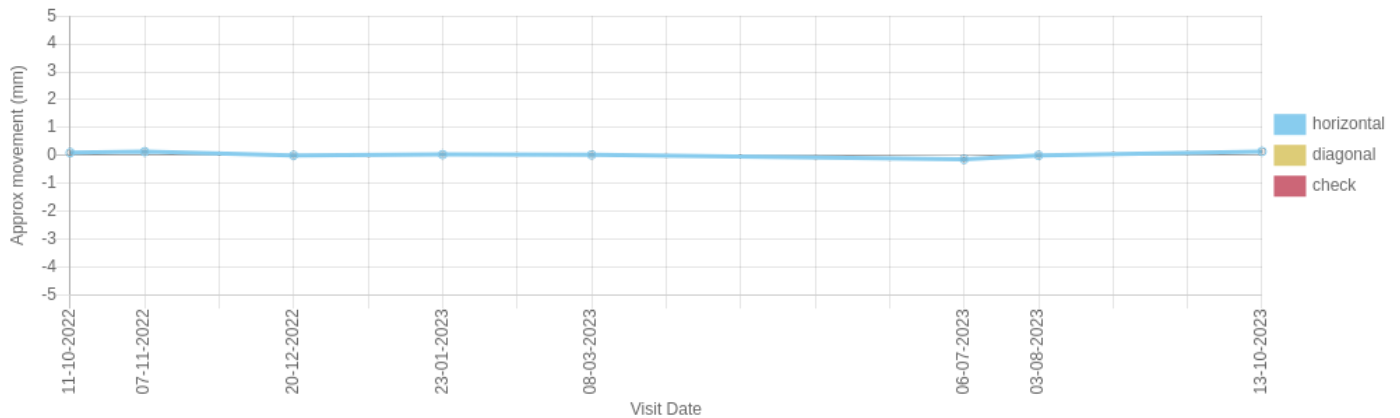

INT 1st floor landing side wall - Photo

