

## Monitoring Details:

## Crack and Level Monitoring

Provider Name: CET

Monitoring Interval: Every 8 weeks

Instruction Date: 19/10/2022

Number of Visits: 7

Reading Date:

Visits Completed: 5

Date of Issue: 22/01/2024

Visits Outstanding: 2

## Client Details:

Client: Sedgwick

Engineer / Handler: Luke Exall

Job Reference: 9649924

## Monitored Address:


Occupier: 

Address: Sweetcroft Residential Care Home, 53 Sweetcroft Lane, Uxbridge, Middlesex, UB10 9LE

Telephone: Email: 

## Front Elevation



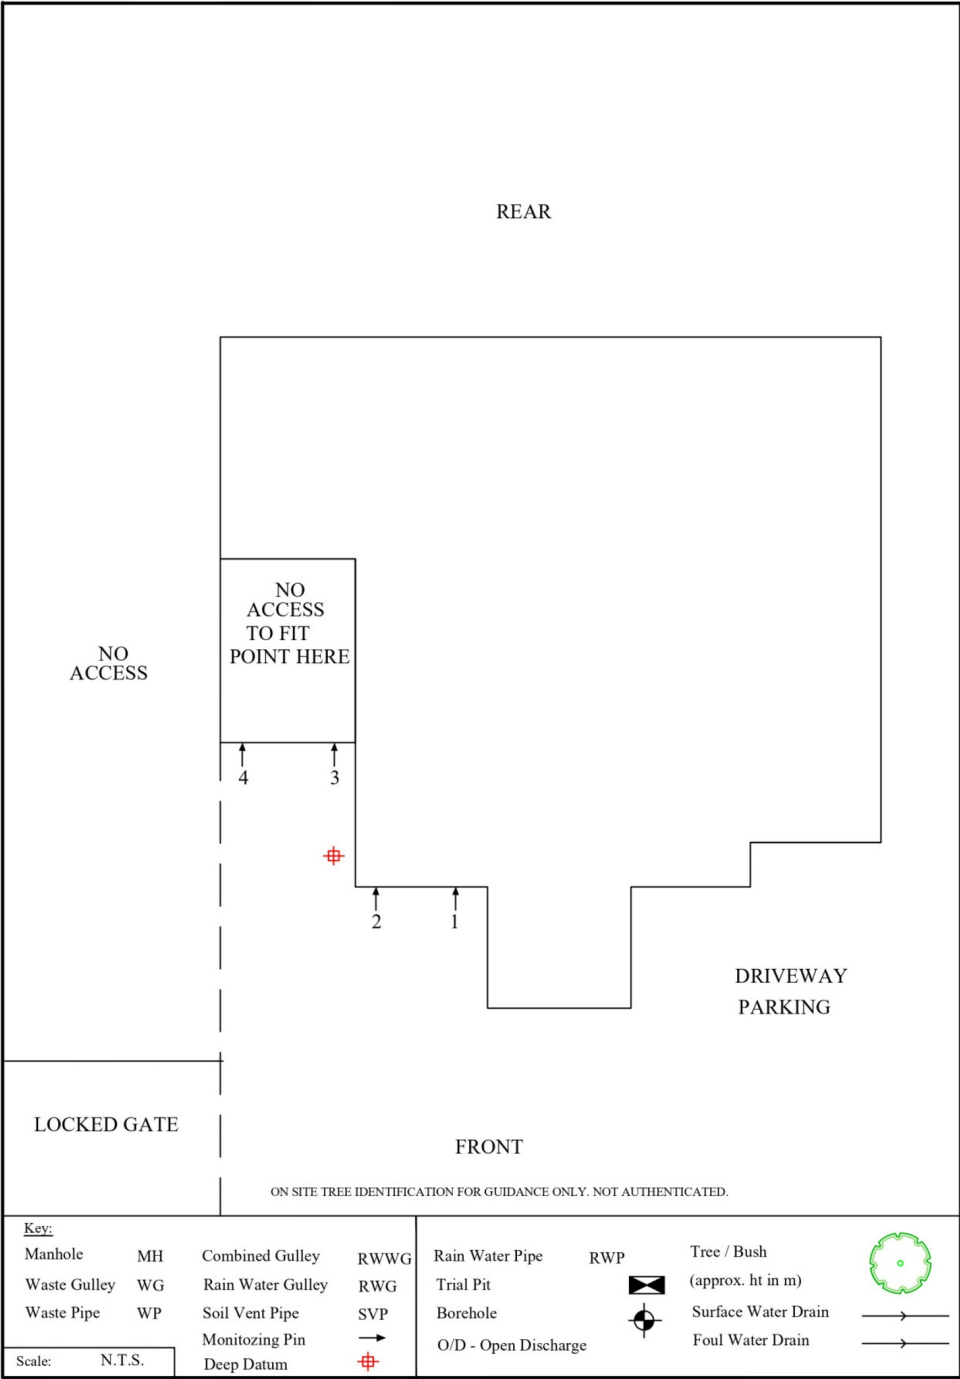


## Level Readings

|               | Visit 1  | Visit 2  | Visit 3  | Visit 4  | Visit 5  | Visit 6  | Visit 7 | Visit 8 |
|---------------|----------|----------|----------|----------|----------|----------|---------|---------|
|               | 21/02/23 | 17/05/23 | 10/07/23 | 29/09/23 | 30/11/23 | 22/01/24 |         |         |
| 1             | 10.2493  | 10.2505  | 10.2490  | 10.2408  | 10.2433  | 10.2452  |         |         |
| 2             | 10.2267  | 10.2285  | 10.2288  | 10.2217  | 10.2258  | 10.2256  |         |         |
| 3             | 10.2224  | 10.2241  | 10.2228  | 10.2155  | 10.2204  | 10.2206  |         |         |
| 4             | 10.9217  | 10.9236  | 10.9216  | 10.9155  | 10.9194  | 10.9195  |         |         |
|               |          |          |          |          |          |          |         |         |
|               |          |          |          |          |          |          |         |         |
|               |          |          |          |          |          |          |         |         |
|               |          |          |          |          |          |          |         |         |
| Taken by      | O.B      | O.B      | BJ       | BJ       | BJ       | BJ       |         |         |
| Serial number | 524694   | 522939   | 523149   | 523158   | 523158   | 523158   |         |         |

## Level Movement (Displayed in Millimeters)

|   | Visit 1  | Visit 2  | Visit 3  | Visit 4  | Visit 5  | Visit 6  | Visit 7 | Visit 8 |
|---|----------|----------|----------|----------|----------|----------|---------|---------|
|   | 21/02/23 | 17/05/23 | 10/07/23 | 29/09/23 | 30/11/23 | 22/01/24 |         |         |
| 1 | +1       | +2.2     | +0.7     | -7.5     | -5       | -3.1     |         |         |
| 2 | +1.7     | +3.5     | +3.8     | -3.3     | +0.8     | +0.6     |         |         |
| 3 | 0        | +1.7     | +0.4     | -6.9     | -2       | -1.8     |         |         |
| 4 | +1.4     | +3.3     | +1.3     | -4.8     | -0.9     | -0.8     |         |         |
|   |          |          |          |          |          |          |         |         |
|   |          |          |          |          |          |          |         |         |
|   |          |          |          |          |          |          |         |         |
|   |          |          |          |          |          |          |         |         |

## Level Readings Chart (Points 1 - 4)

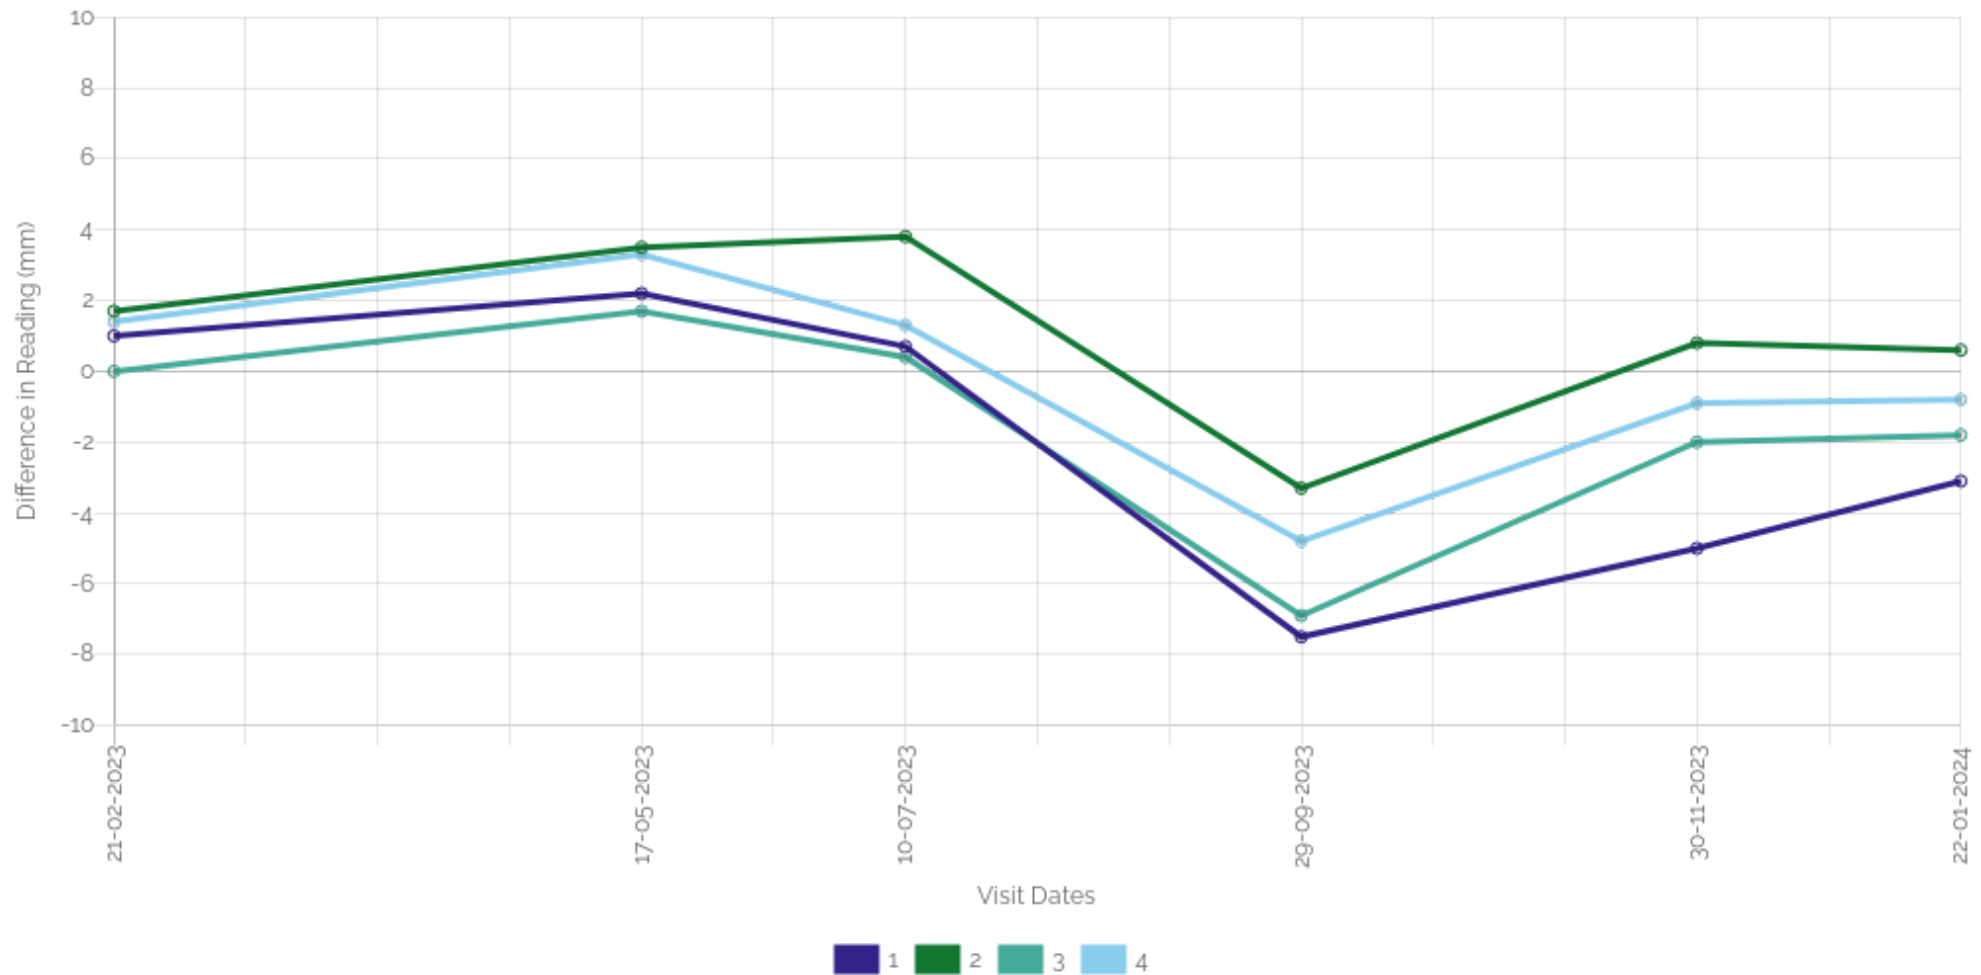


## Crack Monitoring

Int first floor front left bedroom bottom right of window


|           | Visit 1  | Visit 2  | Visit 3  | Visit 4  | Visit 5  | Visit 6  | Visit 7 | Visit 8 |
|-----------|----------|----------|----------|----------|----------|----------|---------|---------|
|           | 21/02/23 | 17/05/23 | 10/07/23 | 29/09/23 | 30/11/23 | 22/01/24 |         |         |
| V         | 71.33    | 71       | 70.91    | 72.82    | 71.58    | 70.77    |         |         |
| D         | 84.37    | 83.72    | 83.75    | 86.75    | 845      | 83.83    |         |         |
| C         | 51.13    | 51.13    | 51.16    | 51.2     | 51.2     | 51.2     |         |         |
| Taken by  | N/A      | N/A      | BJ       | BJ       | BJ       | BJ       |         |         |
| Callipers | 2016     | 2016     | 66878    | 66878    | 66878    | 66878    |         |         |

Int first floor front left bedroom bottom right of window - Crack Readings Differences (Displayed in Millimetres)

|   | Visit 1  | Visit 2  | Visit 3  | Visit 4  | Visit 5  | Visit 6  | Visit 7 | Visit 8 |
|---|----------|----------|----------|----------|----------|----------|---------|---------|
|   | 21/02/23 | 17/05/23 | 10/07/23 | 29/09/23 | 30/11/23 | 22/01/24 |         |         |
| V | -0.21    | -0.54    | -0.63    | 1.28     | 0.04     | -0.77    |         |         |
| D | -0.18    | -0.83    | -0.8     | 2.2      | -0.05    | -0.72    |         |         |
| C | -0.03    | -0.03    | -0       | 0.04     | 0.04     | 0.04     |         |         |

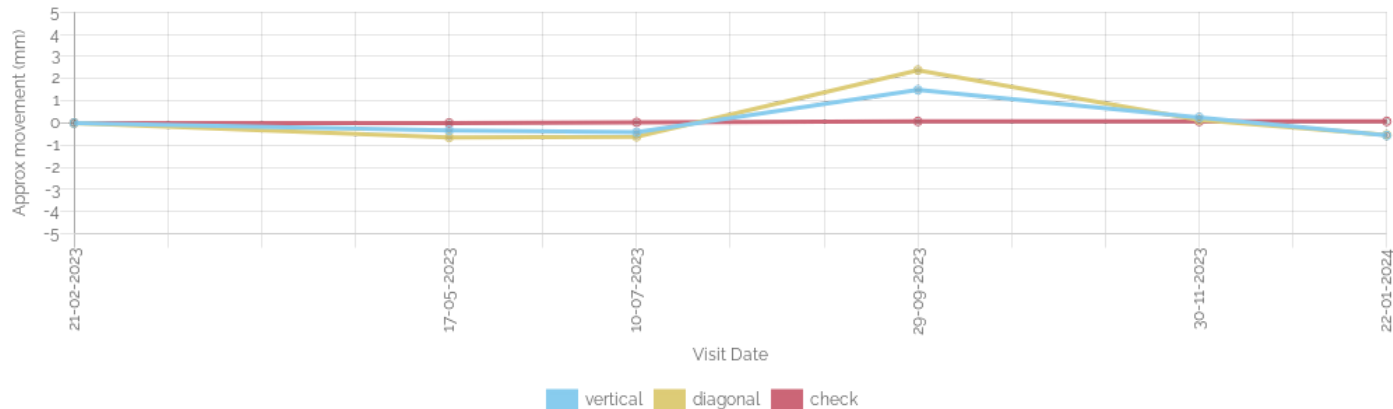

Int first floor front left bedroom bottom right of window - Visit #1

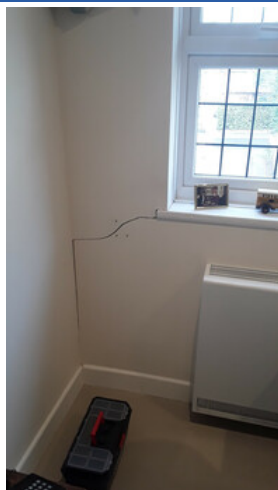

Int first floor front left bedroom bottom right of window - Visit #4




Crack Monitoring

Ext front elevation between windows

|           | Visit 1  | Visit 2  | Visit 3  | Visit 4  | Visit 5  | Visit 6  | Visit 7 | Visit 8 |
|-----------|----------|----------|----------|----------|----------|----------|---------|---------|
|           | 21/02/23 | 17/05/23 | 10/07/23 | 29/09/23 | 30/11/23 | 22/01/24 |         |         |
| V         | 74.87    | 74.3     | 74.64    | 75.75    | 74.72    | 74.3     |         |         |
| Taken by  | N/A      | N/A      | BJ       | BJ       | BJ       | BJ       |         |         |
| Callipers | 2016     | 2016     | 66878    | 66878    | 66878    | 66878    |         |         |

Ext front elevation between windows - Crack Readings Differences (Displayed in Millimetres)

|   | Visit 1  | Visit 2  | Visit 3  | Visit 4  | Visit 5  | Visit 6  | Visit 7 | Visit 8 |
|---|----------|----------|----------|----------|----------|----------|---------|---------|
|   | 21/02/23 | 17/05/23 | 10/07/23 | 29/09/23 | 30/11/23 | 22/01/24 |         |         |
| V | -0.02    | -0.59    | -0.25    | 0.86     | -0.17    | -0.59    |         |         |

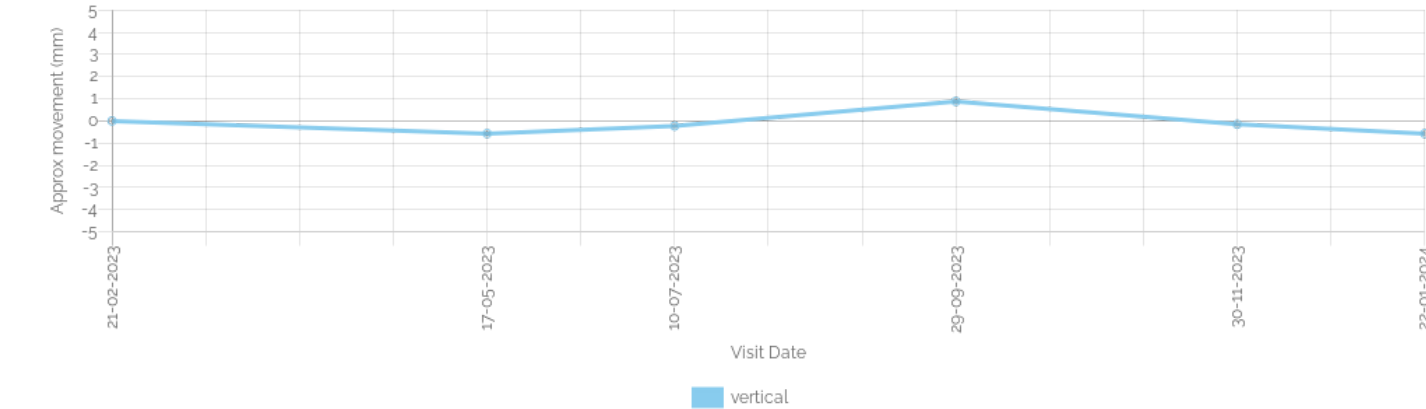

Ext front elevation between windows - Visit #1



Ext front elevation between windows - Visit #4




Crack Monitoring

Front left corner above kitchen door

|           | Visit 1  | Visit 2  | Visit 3  | Visit 4  | Visit 5  | Visit 6  | Visit 7 | Visit 8 |
|-----------|----------|----------|----------|----------|----------|----------|---------|---------|
|           | 21/02/23 | 17/05/23 | 10/07/23 | 29/09/23 | 30/11/23 | 22/01/24 |         |         |
| D         | 4763     | 4749     | 4772     | 485      | 48       | 4772     |         |         |
| Taken by  | N/A      | N/A      | BJ       | BJ       | BJ       | BJ       |         |         |
| Callipers | 2016     | 2016     | 66878    | 66878    | 66878    | 66878    |         |         |

Front left corner above kitchen door - Crack Readings Differences (Displayed in Millimetres)

|   | Visit 1  | Visit 2  | Visit 3  | Visit 4  | Visit 5  | Visit 6  | Visit 7 | Visit 8 |
|---|----------|----------|----------|----------|----------|----------|---------|---------|
|   | 21/02/23 | 17/05/23 | 10/07/23 | 29/09/23 | 30/11/23 | 22/01/24 |         |         |
| D | 0.02     | -0.12    | 0.11     | 0.89     | 0.39     | 0.11     |         |         |

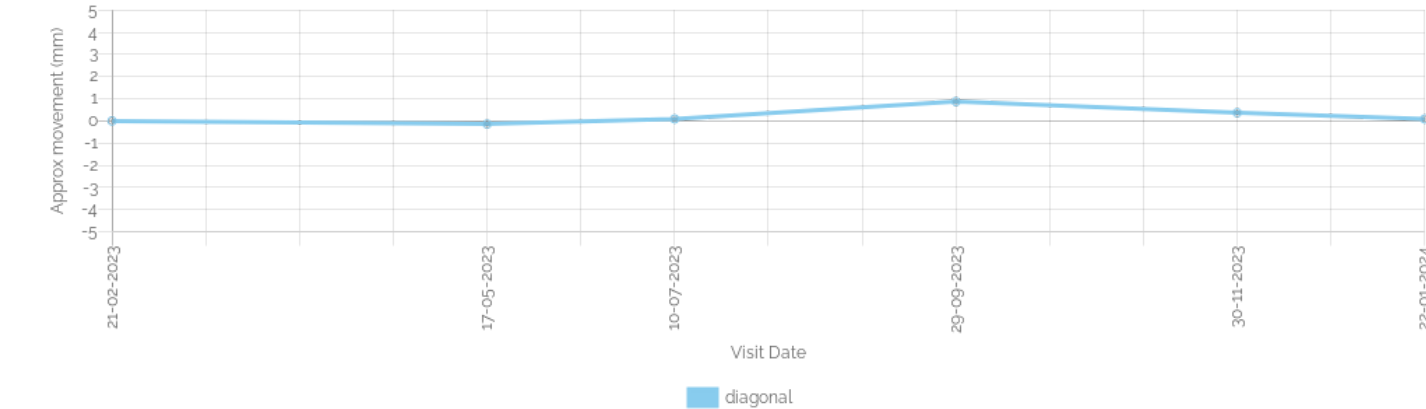

Front left corner above kitchen door - Visit #1



Front left corner above kitchen door - Visit #4

