


LEVEL MONITORING - RELATIVE SURVEY READINGS

Provider Details		Client Details		Risk Address	
Name:	MHN Ltd	Insurance Co.:	Allianz	Occupier:	Uplands Residents Management Co
		Client Name:	Crawford & Co	Address:	Flats 1 & 3 Uplands Court
Date of Issue:	16/6/23	Contact:	N Crawford	Address:	19 Frithwood Avenue
		Email:	monitoring@crawco.co.uk	Town:	Northwood
		Client Ref:	SU1903345	County:	
		Address:	Cartwright House	Post Code:	HA6 3LY
		Town:	Tottle Road	Tel Home:	
		County:	Riverside Business Park	Tel Work:	
		Post Code:	Nottingham	Mobile:	
		Other Email:	NG2 1RT	Other:	
				Other:	

Target Date:															
Reading Date:		8/7/21	19/10/21	21/12/21	10/3/22	7/5/22	6/7/22	21/9/22	10/11/22	12/1/23	8/3/23	27/4/23	16/6/23		
Issue Date:		8/7/21	20/10/21	22/12/21	11/3/22	10/5/22	7/7/22	22/9/22	14/11/22	17/1/23	9/3/23	28/4/23	16/6/23		
Row No.	Point Name	X Co-ordinate	Y Co-ordinate	10	11	12	13	14	15	16	17	18	19	20	21
1		0.00	0.00												
2	1	-5.20	0.00	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000
3		-5.20	3.70												
4		-8.90	3.70												
5	2	-8.90	2.30	10.0058	9.9999	10.0032	10.0038	10.0041	9.9988	9.9922	9.9965	9.9996	10.0006	10.0015	10.0012
6	3	-13.70	2.30	9.9856	9.9843	9.9851	9.9839	9.9841	9.9837	9.9834	9.9838	9.9844	9.9836	9.9844	9.9837
7		-13.70	3.70												
8		-17.20	3.70												
9		-17.20	2.30												
10	4	-21.10	2.30	9.8641	9.8638	9.8639	9.8625	9.8639	9.8638	9.8603	9.8623	9.8625	9.8626	9.8630	9.8624
11		-22.40	2.30												
12		-22.40	2.30												
13		-22.40	5.20												
14	5	-21.10	5.20	9.8855	9.8841	9.8860	9.8860	9.8870	9.8814	9.8695	9.8736	9.8786	9.8811	9.8829	9.8812
15		-15.10	5.20												
16		-15.10	10.70												
17	6	-13.70	10.70	10.0074	10.0079	10.0093	10.0095	10.0089	10.0066	10.0014	10.0038	10.0069	10.0081	10.0077	10.0067
18	7	-9.50	10.70	10.0106	10.0111	10.0118	10.0121	10.0115	10.0093	10.0063	10.0087	10.0103	10.0108	10.0106	10.0095
19		-9.50	13.90												
20		0.00	13.90												
21		0.00													
22															
23															
24															
25															
26															
27															
28															
29															
30															
31															
32															

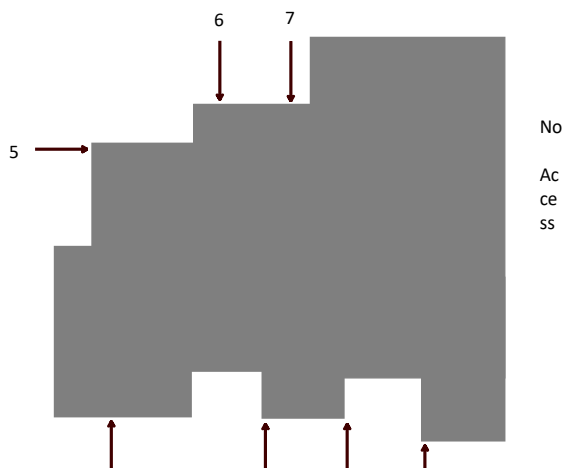

No
Ac
ce
ss

- 09/03/2023
No new concerns raised.
- It was not possible to install all stations within a common brickcourse. Therefore initial readings cannot be interpreted as Distortion Data.
- Readings have been made relative to level station 1. It has an assumed value of 10.0000m. If this is not appropriate, please advise if a deep datum is required?

4

3

2

1

FRONT


•

be taken in Aug 23

LEVEL MONITORING - RELATIVE MOVEMENT SKETCH

Client: Crawford & Co

Client Ref: SU1903345



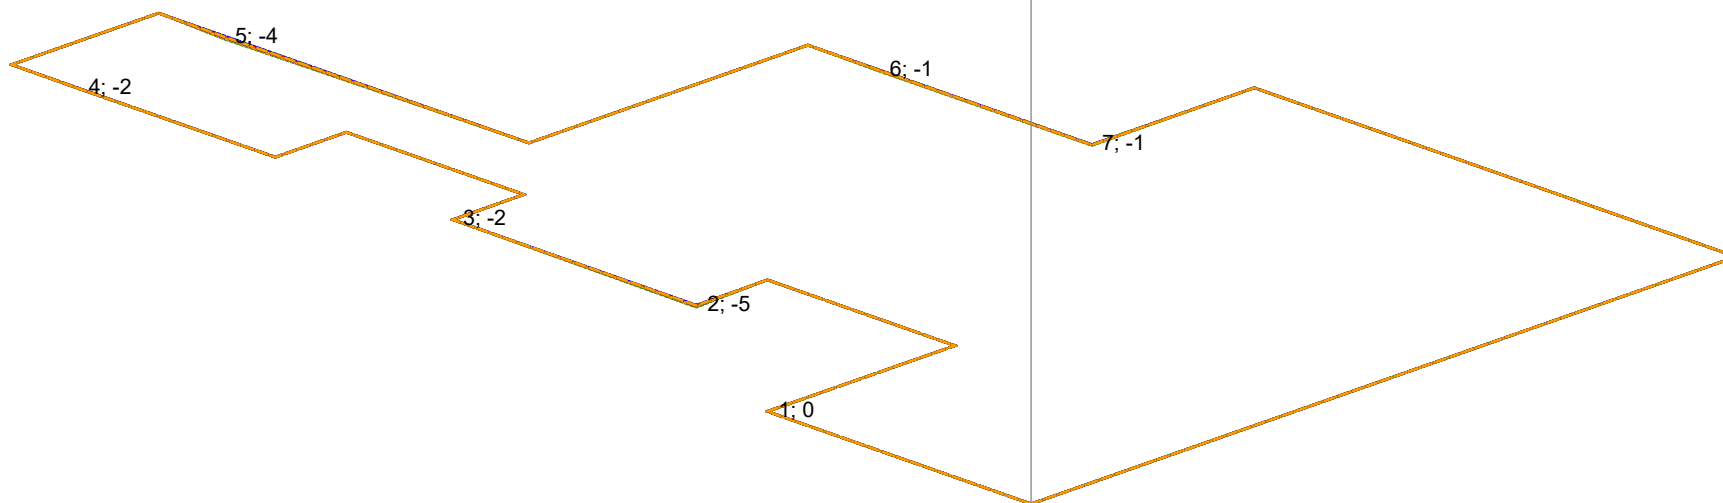


Reading 10 (8/7/21)	Reading 11 (19/10/21)	Reading 12 (21/12/21)	Reading 13 (10/3/22)	Reading 14 (7/5/22)	Reading 15 (6/7/22)
Reading 16 (21/9/22)	Reading 17 (10/11/22)	Reading 18 (12/1/23)	Reading 19 (8/3/23)	Reading 20 (27/4/23)	Reading 21 (16/6/23)

Notes:

Vertical distorted scale 1: 5

Point labels give level difference of last reading from original datum in mm.

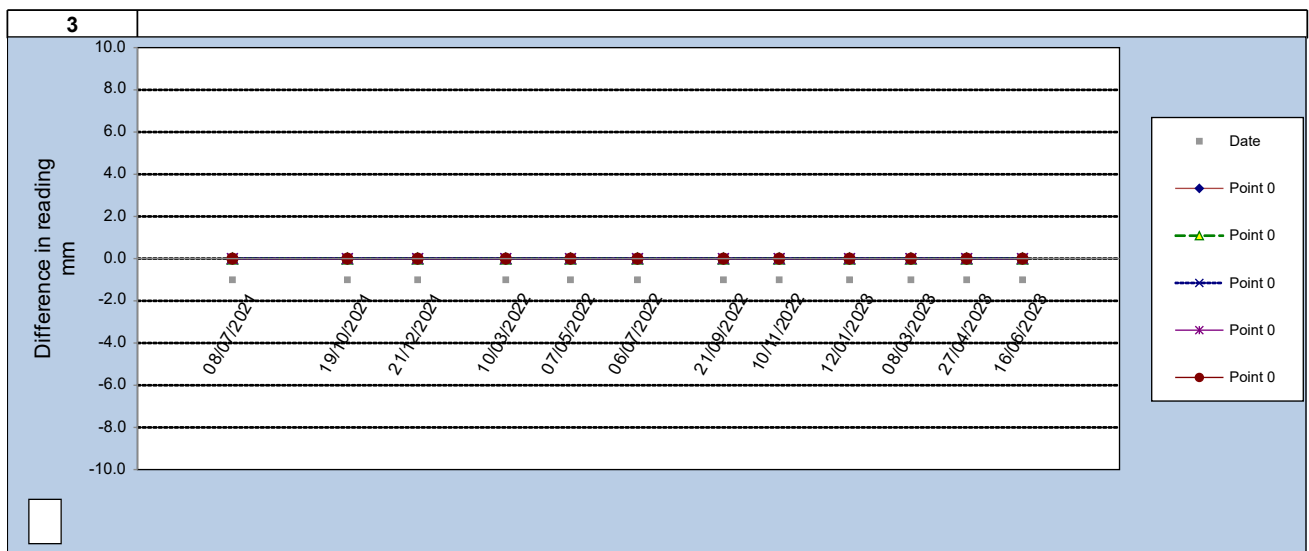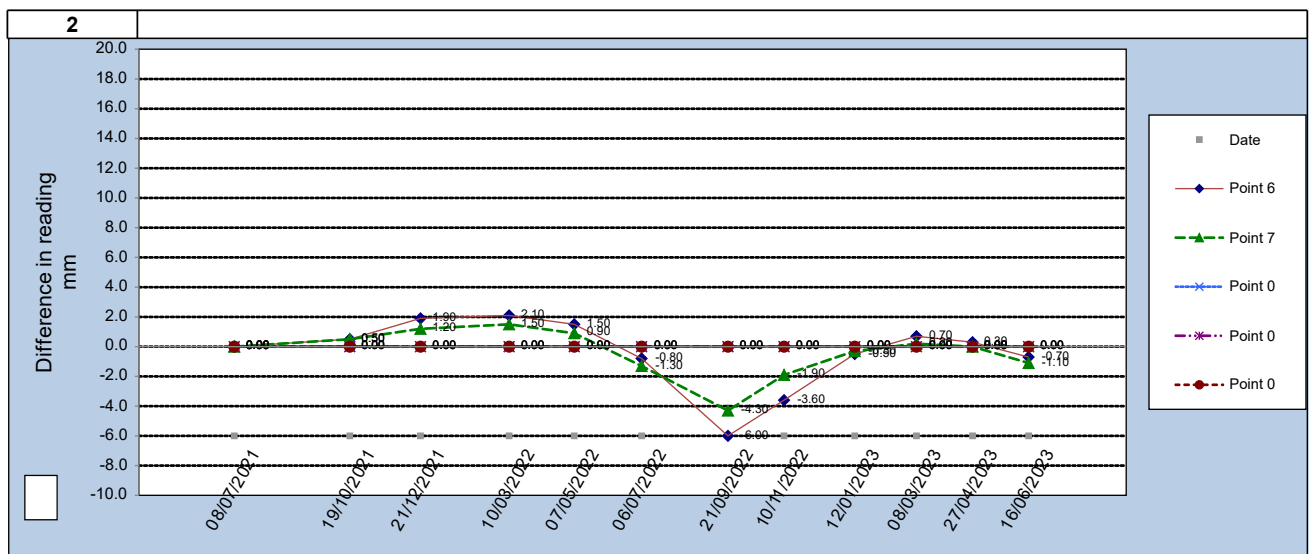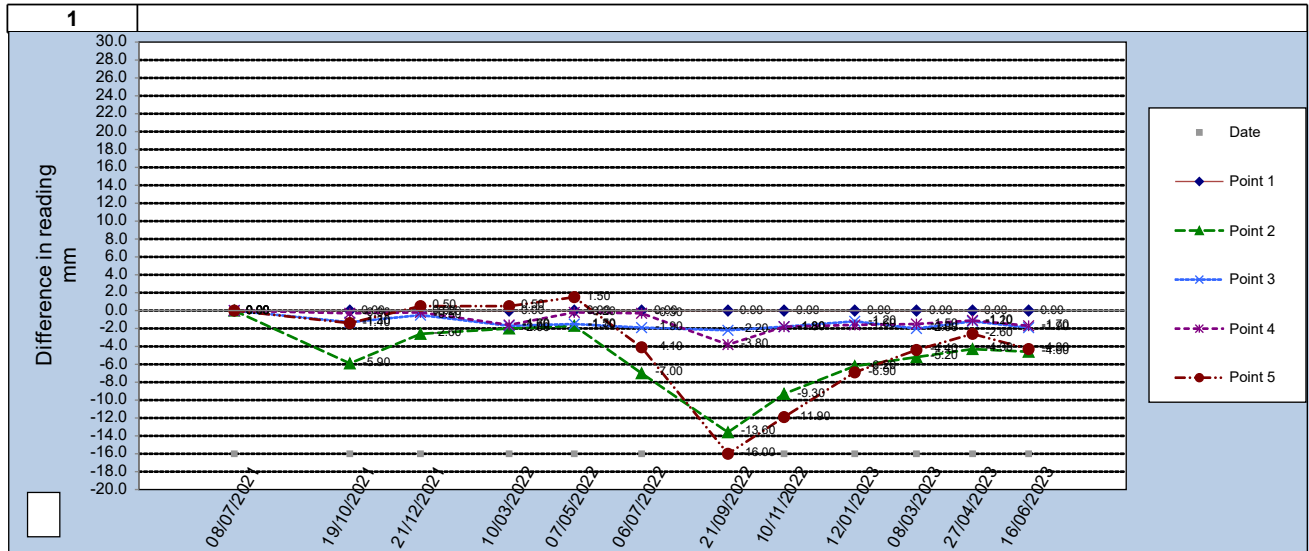

Standard Comments for selection in Readings and Sketch Worksheets
User may edit these as appropriate

Standard Comments	
No Comment	
Standard Comment 1	The Occupier expressed concerns
Standard Comment 2	The Occupier expressed no new concerns
Standard Comment 3	The Occupier expressed no new concerns
Standard Comment 4	The Occupier expressed no new concerns
Standard Comment 5	The Occupier expressed no new concerns

Standard Bullet
●