

Level and Crack Monitoring

Our Ref: 719237

Date of Issue: 26/05/2021

Provider Details

CET Property Services - 0116 2605309

Monitoring Details

Instruction Date:		28/04/2020	
Number of visits	6	Visit Frequency (Wks)	8

Visit Dates (future dates are estimated)

Setup	1	2	3	4	5	6
14/05/20	09/07/20	03/09/20	29/10/20	24/12/20	18/02/21	15/04/21

Client Details

Insurance Co.:	
Client Ref:	8697629
Client Name:	Sedgwick
Technical Mgr:	Gavin Catheline
Customer support	Mark Fairweather
Tel:	01622 301421
Email:	


Risk Address

Occupier:	Removed for data protection purposes
Address:	20 Grove Farm Park
Address:	NORTHWOOD
Town:	
County:	Middlesex
Post Code:	HA6 2BQ
Contact Name	Removed for data protection purposes

Level and Crack Monitoring - Site Sketch

Our Ref: 719237

Date of Issue: 26/05/2021

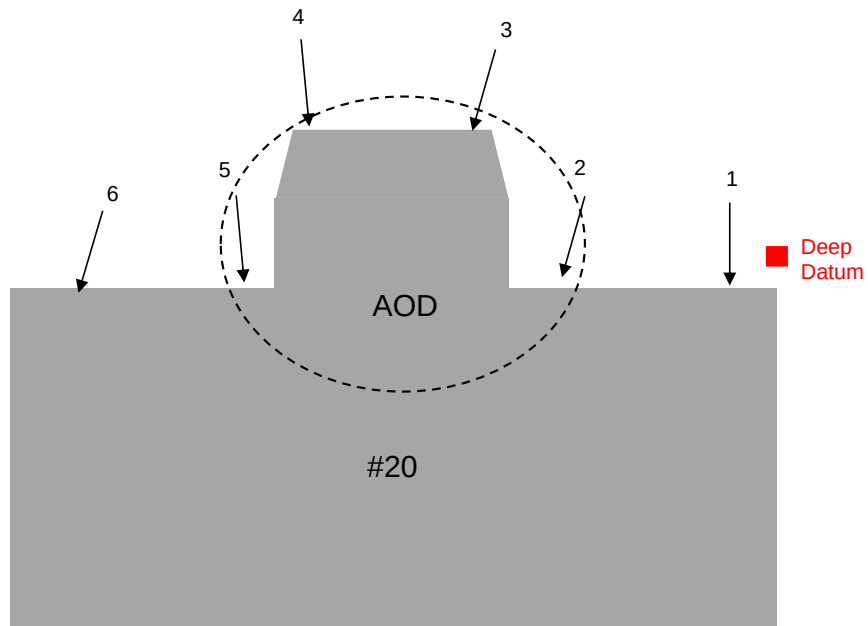

Level Monitoring - Reduced Levels (in metres)

Our Ref:

719237

Date of Issue:

26/05/21

Reading Date	14/5/20	31/7/20	20/10/20	7/12/20	11/2/21	6/4/21	26/5/21					
Point / Reading	1	2	3	4	5	6	7	8	9	10	11	12
1	10.3087	10.3073	10.3078	10.3078	10.3082	10.3089	10.3090					
2	10.8134	10.8128	10.8133	10.8151	10.8143	10.8144	10.8144					
3	10.1326	10.1267	10.1244	10.1262	10.1255	10.1282	10.1281					
4	10.1430	10.1361	10.1348	10.1354	10.1325	10.1383	10.1396					
5	10.7356	10.7341	10.7361	10.7367	10.7362	10.7362	10.7362					
6	10.2984	10.2963	10.2961	10.2966	10.2972	10.2978	10.2988					
not used												
not used												
not used												
not used												
not used												
not used												
not used												
not used												
not used												
Tech Initials	NM	MD	DD	RB	IH	EK	EK					
Level S/N.	523149	520038	521816	522937	523149	523939	523939					

Level Monitoring - Movement (in millimetres)

Our Ref:

719237

Date of Issue

26/05/21

[illegible]



Our ref	Client ref	Client Name	Issue Date
719237	8697629	Sedgwick	26/05/2021

Stud locations

1	EXT rear ele rhs of bay
2	EXT rear ele LHS of bay
3	
4	
5	
6	

Additional instructions / notes

Crack Monitoring - Readings

Studs nos.	Align-ment	Visit Date	14/05/20	Visit Date	31/07/20	Visit Date	20/10/20	Visit Date	07/12/20	Visit Date	11/02/21	Visit Date	06/04/21
		Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w
1	H	106.80		111.62		113.78		112.76		112.08		111.93	filled
1	D												
1	Check												
2	H	101.61		106.22		108.36		107.31		106.64		106.59	filled
2	D	122.91		126.75		128.21		127.47		126.84		126.76	filled
2	Check	72.86		72.24		72.26		72.87		72.83		72.85	
3	H												
3	D												
3	Check												
4	H												
4	D												
4	Check												
5	H												
5	D												
5	Check												
6	H												
6	D												
6	Check												
Calliper nos :		2860		3971		570		1370		6386		8568	
Technician :		NM		MD		DD		RB		IH		EK	

[illegible]

Our ref	Client ref	Client Name	Issue Date
719237	8697629	Sedgwick	26/05/2021

Crack Monitoring - Movement Against Time

