


LEVEL MONITORING - RELATIVE SURVEY READINGS

Provider Details		Client Details		Risk Address	
Name:	MHN Ltd	Insurance Co.:	Allianz	Occupier:	Uplands Residents Management Co
		Client Name:	Crawford & Co	Address:	Flats 1 & 3 Uplands Court
Date of Issue:	8/7/21	Contact:	N Crawford	Address:	19 Frithwood Avenue
		Email:	monitoring@crawco.co.uk	Town:	Northwood
		Client Ref:	SU1903345	County:	
		Address:	Cartwright House	Post Code:	HA6 3LY
		Town:	Tottle Road	Tel Home:	
		County:	Riverside Business Park	Tel Work:	
		Post Code:	Nottingham	Mobile:	
		Other Email:	NG2 1RT	Other:	
				Other:	

Target Date:															
Reading Date:		26/9/19	22/11/19	28/1/20	23/3/20	18/5/20	23/7/20	21/9/20	27/2/21	5/5/21	8/7/21				
Issue Date:		1/10/19	28/11/19	3/2/20	26/3/20	19/5/20	24/7/20	23/9/20	1/3/21	6/5/21	8/7/21				
Row No.	Point Name	X Co-ordinate	Y Co-ordinate	1	2	3	4	5	6	7	8	9	10	11	12
1		0.00	0.00												
2	1	-5.20	0.00	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000		
3		-5.20	3.70												
4		-8.90	3.70												
5	2	-8.90	2.30	10.0006	10.0061	10.0070	10.0067	10.0067	9.9966	9.9929	10.0045	10.0058	10.0058		
6	3	-13.70	2.30	9.9838	9.9847	9.9852	9.9840	9.9837	9.9845	9.9830	9.9843	9.9856	9.9856		
7		-13.70	3.70												
8		-17.20	3.70												
9		-17.20	2.30												
10	4	-21.10	2.30	9.8617	9.8660	9.8680	9.8672	9.8675	9.8615	9.8570	9.8623	9.8632	9.8641		
11		-22.40	2.30												
12		-22.40	2.30												
13		-22.40	5.20												
14	5	-21.10	5.20	9.8665	9.8793	9.8846	9.8857	9.8859	9.8706	9.8660	9.8817	9.8847	9.8855		
15		-15.10	5.20												
16		-15.10	10.70												
17	6	-13.70	10.70	9.9906	10.0023	10.0058	10.0048	10.0070	9.9955	9.9921	10.0057	10.0068	10.0074		
18	7	-9.50	10.70	10.0012	10.0075	10.0093	10.0077	10.0104	10.0024	10.0007	10.0090	10.0098	10.0106		
19		-9.50	13.90												
20		0.00	13.90												
21		0.00													
22															
23															
24															
25															
26															
27															
28															
29															
30															
31															
32															

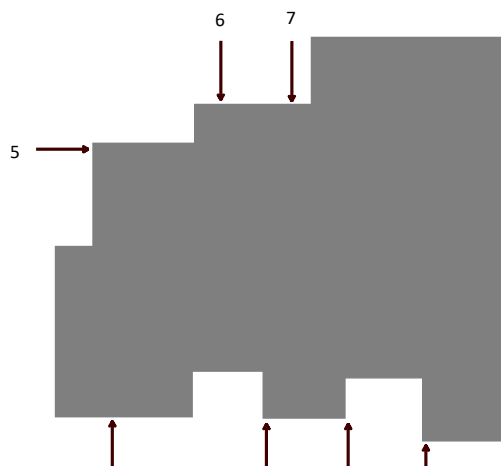

No
Ac
ce
ss


08/07/2021

- It was not possible to install all stations within a common brickcourse. Therefore initial readings cannot be interpreted as Distortion Data.
- Readings have been made relative to level station 1. It has an assumed value of 10.0000m. If this is not appropriate, please advise if a deep datum is required?

LEVEL MONITORING - RELATIVE MOVEMENT SKETCH

Client: Crawford & Co




Client Ref: SU1903345

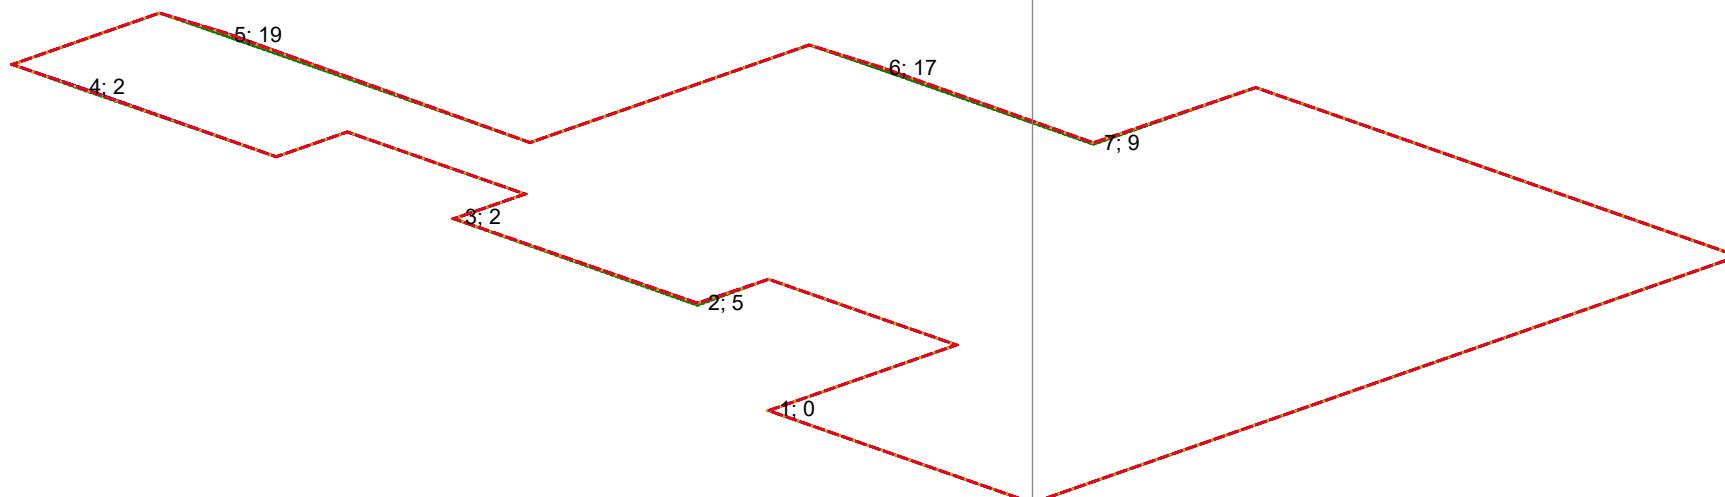

Reading 1 (26/9/19)	Reading 2 (22/11/19)	Reading 3 (28/1/20)	Reading 4 (23/3/20)	Reading 5 (18/5/20)	Reading 6 (23/7/20)
Reading 7 (21/9/20)	Reading 8 (27/2/21)	Reading 9 (5/5/21)	Reading 10 (8/7/21)	Reading 11 (0/1/00)	Reading 12 (0/1/00)

Notes:
Vertical distorted scale 1: 5

Point labels give level difference of last reading from original datum in mm.

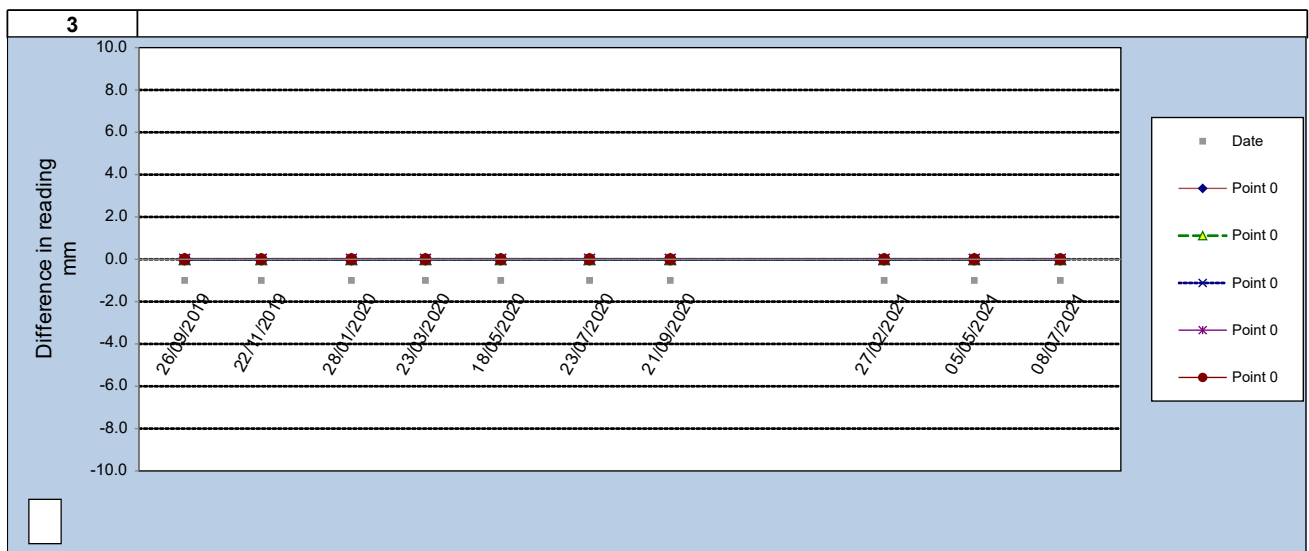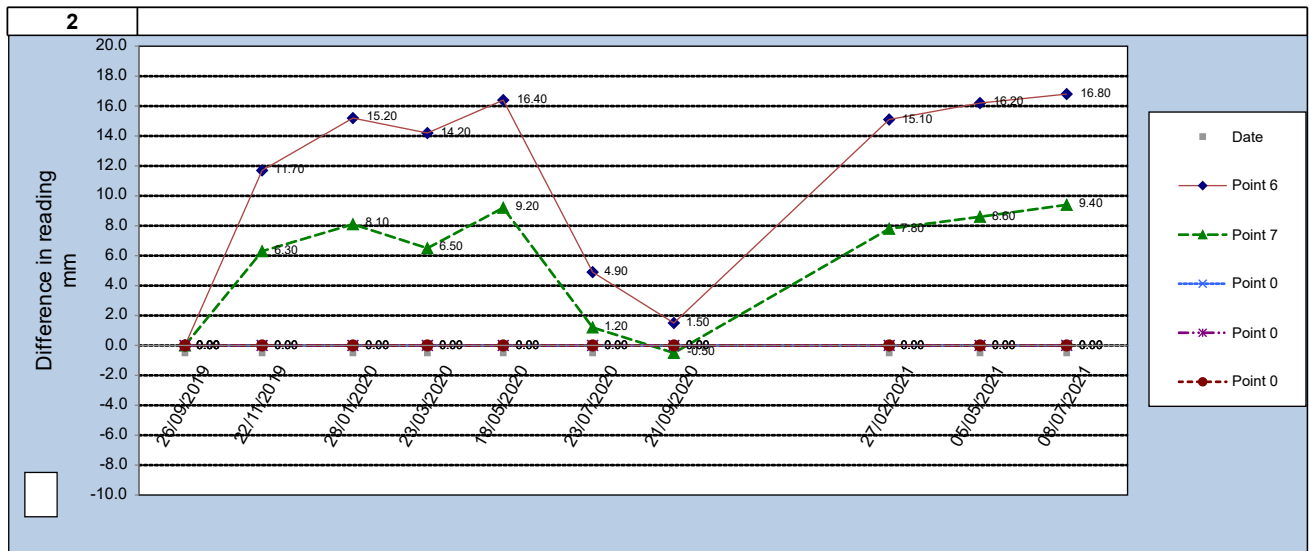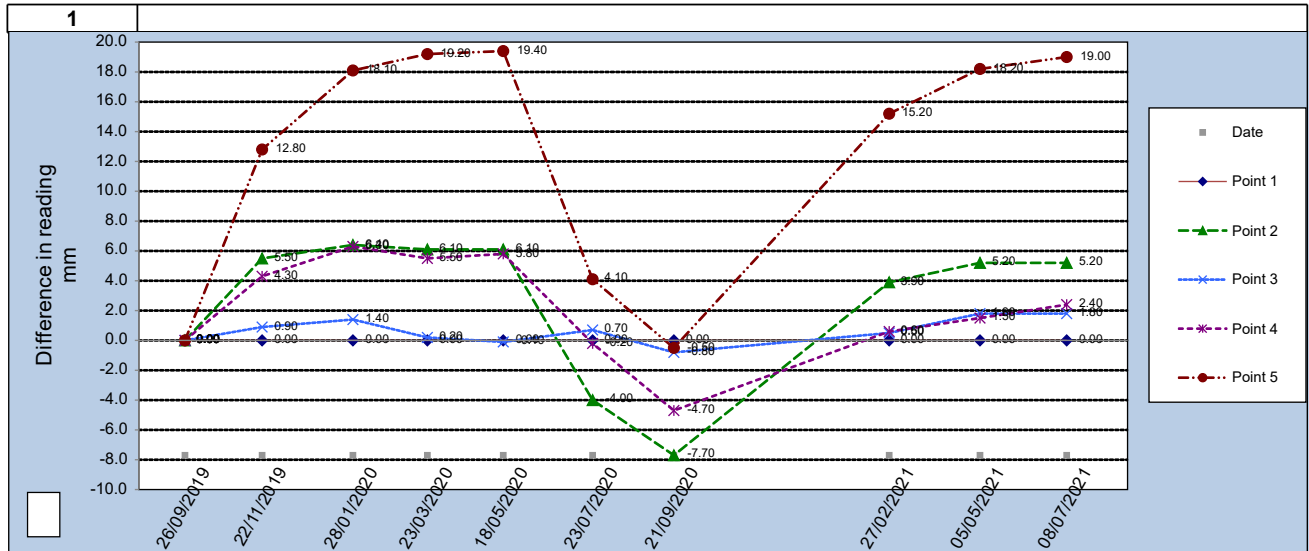

Standard Comments for selection in Readings and Sketch Worksheets
User may edit these as appropriate

Standard Comments	
No Comment	
Standard Comment 1	The Occupier expressed concerns
Standard Comment 2	The Occupier expressed no new concerns
Standard Comment 3	Standard Comment 3
Standard Comment 4	Standard Comment 4
Standard Comment 5	

Standard Bullet
●