

Monitoring Details:

Provider Name: CET

Monitoring Interval: Every 8 weeks

Instruction Date: 09/05/2021

Number of Visits: MUFN

Reading Date:

Visits Completed: 19

Date of Issue: 21/11/2023

Visits Outstanding: MUFN

Client Details:

Client: Sedgwick

Engineer / Handler: -

Job Reference: 8982080

Monitored Address:


Occupier:

Address: 91 Wiltshire Lane, Pinner, Middlesex, HA5 2LY

Telephone:

Email: -

Site Plan

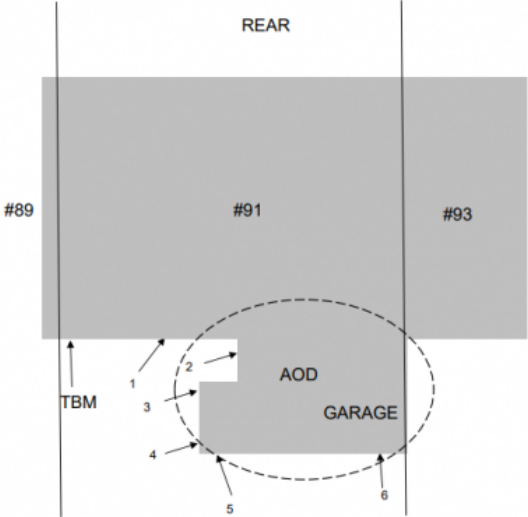

Level Readings

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	29/10/20	18/12/20	10/02/21	06/04/21	24/05/21	20/07/21	14/09/21	09/11/21	21/12/21	01/03/22
1	9.9926	9.9923	9.9927	9.9928	9.9923	9.9924	9.9920	9.9921	9.9922	9.9922
2	9.8957	9.8964	9.8972	9.8976	9.8977	9.8963	9.8944	9.8958	9.8960	9.8970
3	9.8110	9.8122	9.8131	9.8134	9.8134	9.8108	9.8068	9.8105	9.8108	9.8120
4	9.9099	9.9118	9.9125	9.9125	9.9124	9.9109	9.9083	9.9107	9.9111	9.9120
5	9.9096	9.9113	9.9120	9.9125	9.9125	9.9107	9.9075	9.9101	9.9108	9.9118
6	9.8283	9.8306	9.8325	9.8336	9.8338	9.8306	9.8263	9.8292	9.8306	9.8326
Taken by	DD	DD	RB	EK	JM	NM	NM	NM	TH	BA
Serial number	521816	521816	522937	523939	TS16	523936	523936	523936	522939	522888

Level Readings

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	19/04/22	15/06/22	08/08/22	11/10/22	19/12/22	27/02/23	12/05/23	07/07/23	11/09/23	21/11/23
1	9.9922	9.9924	9.9924	9.9917	9.9905	9.9919	9.9930	9.9923	9.9920	9.9927
2	9.8966	9.8959	9.8922	9.8899	9.8917	9.8946	9.8951	9.8928	9.8920	9.8940
3	9.8112	9.8067	9.7986	9.7991	9.8049	9.8078	9.8082	9.8010	9.7992	9.8064
4	9.9112	9.9097	9.9037	9.9036	9.9084	9.9111	9.9113	9.9080	9.9060	9.9106
5	9.9109	9.9087	9.9030	9.9035	9.9071	9.9107	9.9112	9.9079	9.9064	9.9100
6	9.8318	9.8282	9.8177	9.8181	9.8236	9.8286	9.8316	9.8240	9.8202	9.8267
Taken by	N.M	O.B	O.B	N.M	O.B	O.B	F.A	B.J	B.J	B.J
Serial number	523936	523158	523158	523936	524694	524694	521816	523149	523158	523158


Level Movement (Displayed in Millimeters)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	29/10/20	18/12/20	10/02/21	06/04/21	24/05/21	20/07/21	14/09/21	09/11/21	21/12/21	01/03/22
1	0	-0.3	+0.1	+0.2	-0.3	-0.2	-0.6	-0.5	-0.4	-0.4
2	0	+0.7	+1.5	+1.9	+2	+0.6	-1.3	+0.1	+0.3	+1.3
3	0	+1.2	+2.1	+2.4	+2.4	-0.2	-4.2	-0.5	-0.2	+1
4	0	+1.9	+2.6	+2.6	+2.5	+1	-1.6	+0.8	+1.2	+2.1
5	0	+1.7	+2.4	+2.9	+2.9	+1.1	-2.1	+0.5	+1.2	+2.2
6	0	+2.3	+4.2	+5.3	+5.5	+2.3	-2	+0.9	+2.3	+4.3

Level Movement (Displayed in Millimeters) - Continuation of readings

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	19/04/22	15/06/22	08/08/22	11/10/22	19/12/22	27/02/23	12/05/23	07/07/23	11/09/23	21/11/23
1	-0.4	-0.2	-0.2	-0.9	-2.1	-0.7	+0.4	-0.3	-0.6	+0.1
2	+0.9	+0.2	-3.5	-5.8	-4	-1.1	-0.6	-2.9	-3.7	-1.7
3	+0.2	-4.3	-12.4	-11.9	-6.1	-3.2	-2.8	-10	-11.8	-4.6
4	+1.3	-0.2	-6.2	-6.3	-1.5	+1.2	+1.4	-1.9	-3.9	+0.7
5	+1.3	-0.9	-6.6	-6.1	-2.5	+1.1	+1.6	-1.7	-3.2	+0.4
6	+3.5	-0.1	-10.6	-10.2	-4.7	+0.3	+3.3	-4.3	-8.1	-1.6

Level Readings Chart (Points 1 - 6)

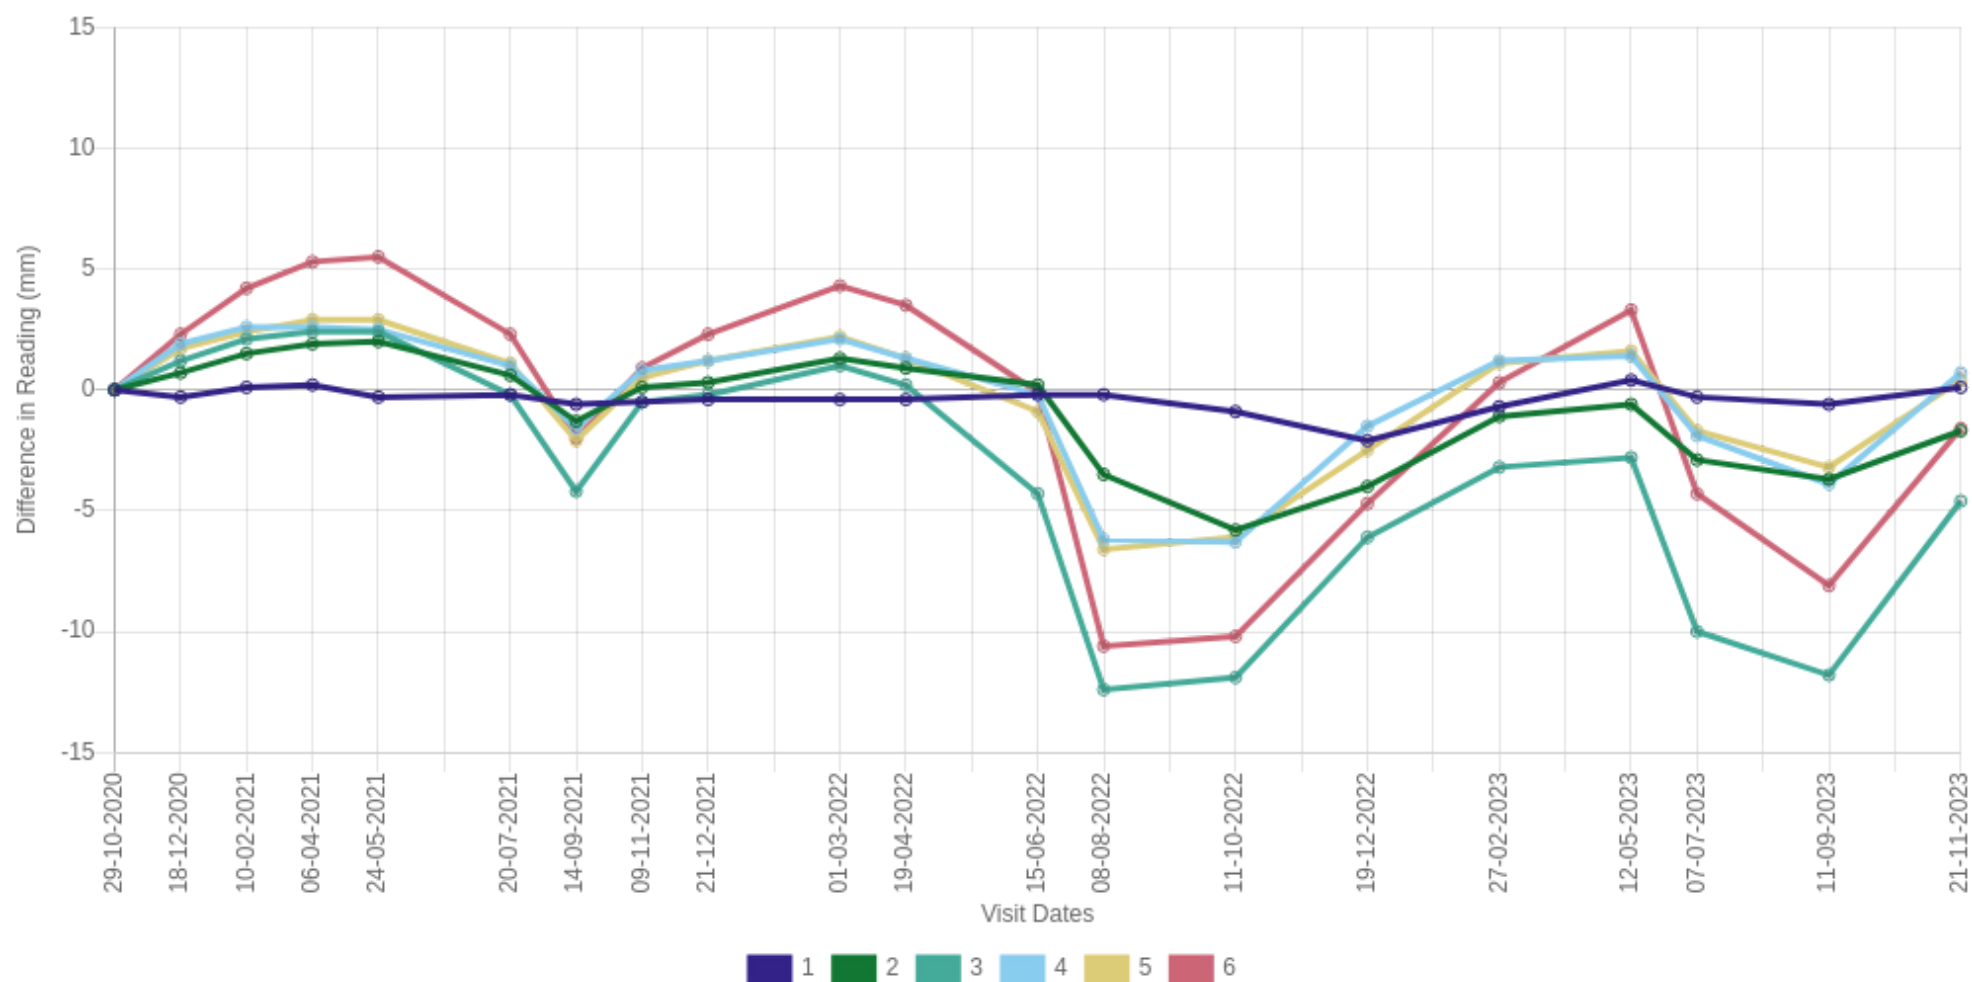


Crack Monitoring

INT garage RHS

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	29/10/20	06/04/21	24/05/21	20/07/21	14/09/21	09/11/21	21/12/21	01/03/22	19/04/22	15/06/22
V	714	7117	7114	7123	7179	7172	7183	7141		7142
D										
C										
Taken by	D.C	E.K	J.M	N.M	N.M	N.M	T.H	B.A	N.M	O.B
Callipers	570	8568	4051	2860	2860	850	7191	9171	850	2016

INT garage RHS - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	29/10/20	06/04/21	24/05/21	20/07/21	14/09/21	09/11/21	21/12/21	01/03/22	19/04/22	15/06/22
V	0	-0.23	-0.26	-0.17	0.39	0.32	0.43	0.01		0.02
D										
C										

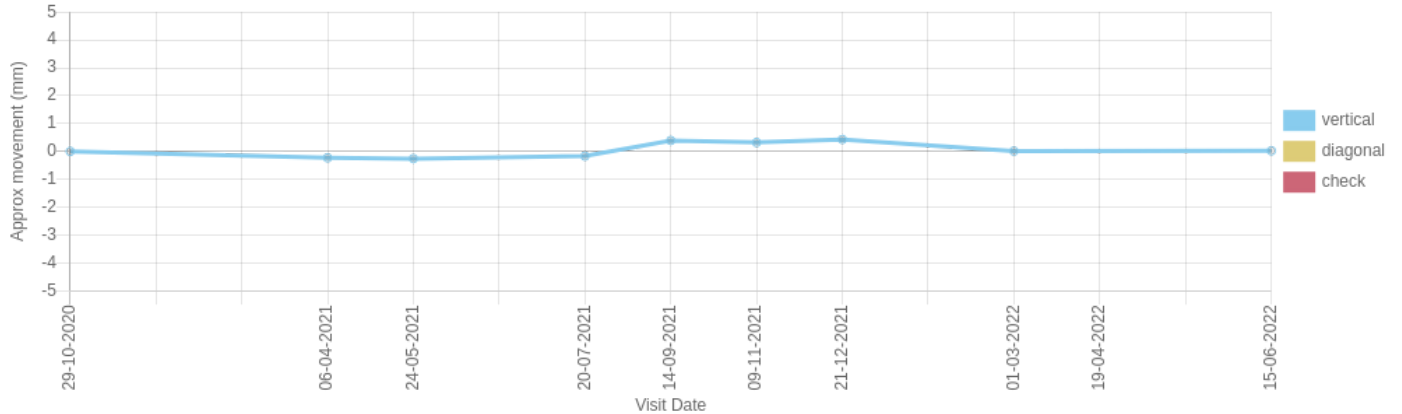


Crack Monitoring

INT garage RHS

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	08/08/22	11/10/22	19/12/22	27/02/23	12/05/23	07/07/23	11/09/23	21/11/23		
V		73.94	73.72	73.32	73.18	73.62	73.63	73.6		
D										
C										
Taken by	O.B	N.M	O.B	O.B	FA	BJ	BJ	BJ		
Callipers	2016	0850	2016	2016	1370	66878	66878	66878		

INT garage RHS - Crack Readings Differences (Displayed in Millimetres)

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	08/08/22	11/10/22	19/12/22	27/02/23	12/05/23	07/07/23	11/09/23	21/11/23		
V		2.54	2.32	1.92	1.78	2.22	2.23	2.2		
D										
C										

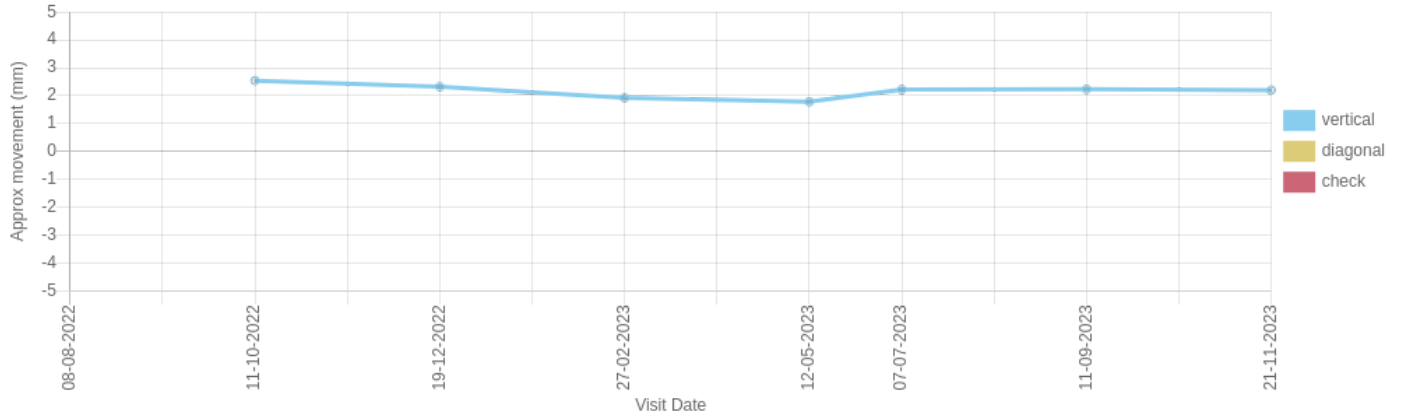


Crack Monitoring

INT hallway junction with ceiling

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	29/10/20	06/04/21	24/05/21	20/07/21	14/09/21	09/11/21	21/12/21	01/03/22	19/04/22	15/06/22
V	9732	97	9713	9723	9744	9727	973	9709		9709
D										
C										
Taken by	DC	EK	JM	NM	NM	NM	T.H	B.A	N.M	O.B
Callipers	570	8568	4051	2860	2860	850	7191	9171	850	2016

INT hallway junction with ceiling - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	29/10/20	06/04/21	24/05/21	20/07/21	14/09/21	09/11/21	21/12/21	01/03/22	19/04/22	15/06/22
V	0	-0.32	-0.19	-0.09	0.12	-0.05	-0.02	-0.23		-0.23
D										
C										

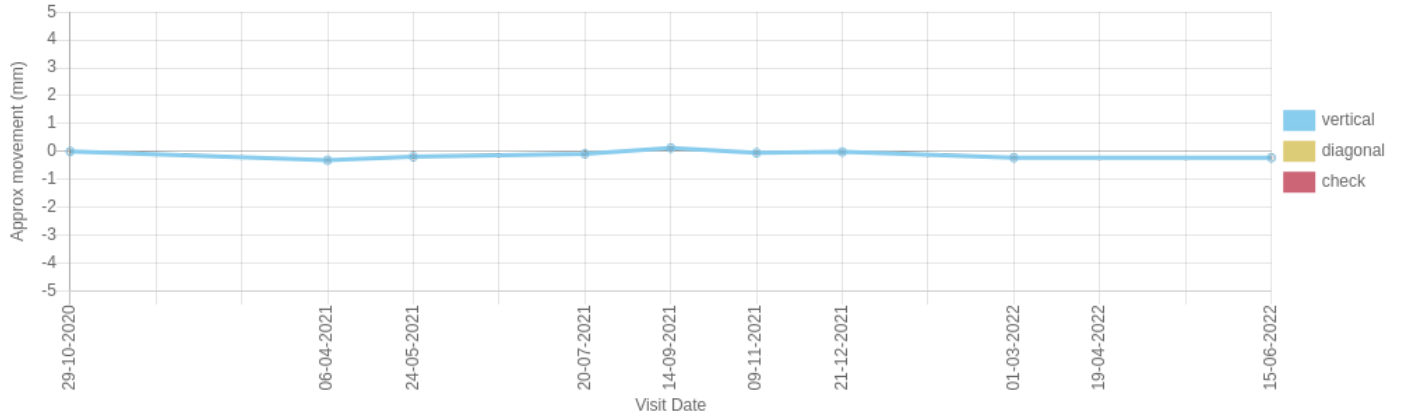


Crack Monitoring

INT hallway junction with ceiling

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	08/08/22	11/10/22	19/12/22	27/02/23	12/05/23	07/07/23	11/09/23	21/11/23		
V		9758	9712	9713	973	971	9725	972		
D										
C										
Taken by	O.B	N.M	O.B	O.B	FA	BJ	BJ	BJ		
Callipers	2016	0850	2016	2016	1370	66878	66878	66878		

INT hallway junction with ceiling - Crack Readings Differences (Displayed in Millimetres)

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	08/08/22	11/10/22	19/12/22	27/02/23	12/05/23	07/07/23	11/09/23	21/11/23		
V		0.26	-0.2	-0.19	-0.02	-0.22	-0.07	-0.12		
D										
C										

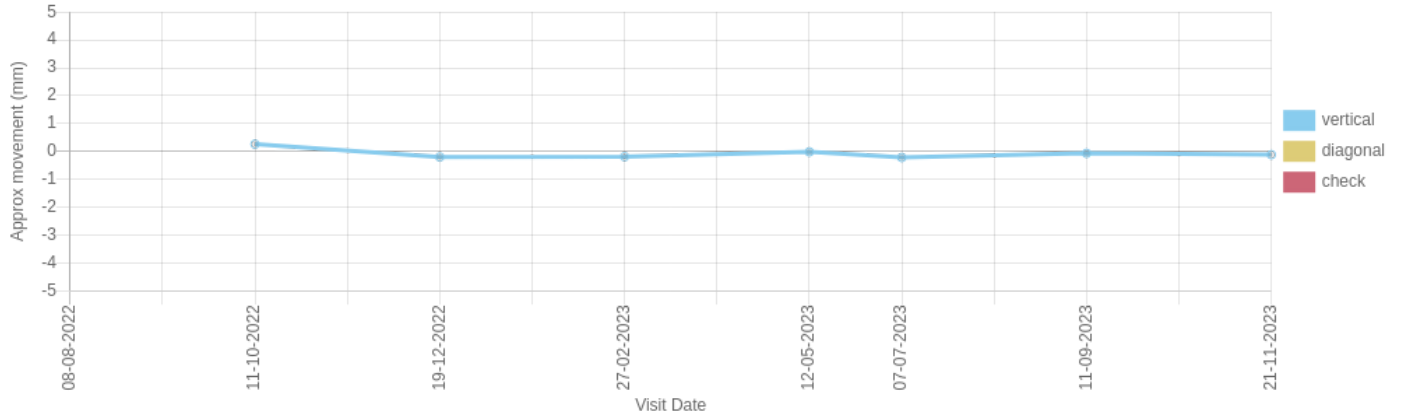

Crack Monitoring

EXT LHS of garage stepped crack

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	29/10/20	06/04/21	24/05/21	20/07/21	14/09/21	09/11/21	21/12/21	01/03/22	19/04/22	15/06/22
H	73.94	72.85	72.91	73.55	75.02	73.83	73.62	73.64	73.45	74.54
V	89.48	88.25	88.5	89.16	90.12	89.22	89.11	88.65	88.82	89.62
C	94.58	94.59	94.63	94.6	94.6	94.54	94.53	94.44	94.54	94.54
Taken by	D.C	E.K	J.M	N.M	N.M	N.M	T.H	B.A	N.M	O.B
Callipers	570	8568	4051	2860	2860	850	7191	9171	850	2016

EXT LHS of garage stepped crack - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	29/10/20	06/04/21	24/05/21	20/07/21	14/09/21	09/11/21	21/12/21	01/03/22	19/04/22	15/06/22
H	0	-1.09	-1.03	-0.39	1.08	-0.11	-0.32	-0.3	-0.49	0.6
V	0	-1.23	-0.98	-0.32	0.64	-0.26	-0.37	-0.83	-0.66	0.14
C	0	0.01	0.05	0.02	0.02	-0.04	-0.05	-0.14	-0.04	-0.04



EXT LHS of garage stepped crack - Photo



Crack Monitoring

EXT LHS of garage stepped crack

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	08/08/22	11/10/22	19/12/22	27/02/23	12/05/23	07/07/23	11/09/23	21/11/23		
H	76.81	77.95	75.07	74.71	74.94	76.7	77.55	75.75		
V	91.57	92.47	90.28	89.85	89.91	91.47	91.81	91		
C	94.54	94.66	94.54	94.55	94.15	94.51	94.45	94.45		
Taken by	O.B	N.M	O.B	O.B	FA	BJ	BJ	BJ		
Callipers	2016	0850	2016	2016	1370	66878	66878	66878		

EXT LHS of garage stepped crack - Crack Readings Differences (Displayed in Millimetres)

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	08/08/22	11/10/22	19/12/22	27/02/23	12/05/23	07/07/23	11/09/23	21/11/23		
H	2.87	4.01	1.13	0.77	1	2.76	3.61	1.81		
V	2.09	2.99	0.8	0.37	0.43	1.99	2.33	1.52		
C	-0.04	0.08	-0.04	-0.03	-0.43	-0.07	-0.13	-0.13		



EXT LHS of garage stepped crack - Photo

