

LEVEL MONITORING

for Subsidence Management Services

29 Nicholas Way, Northwood, Middlesex, HA6 2TR

Client:	Subsidence Management Services
Client Contact:	Ian Davies
Claim Number:	18N602915
Client Reference:	IFS-AVI-SUB-18-0076236
Policy Holder:	Mr Adrian Paterson
Report Date:	19 September 2019
Our Ref:	M13065


Level Monitoring Readings

The following table shows the reading levels of the various Level Monitoring Station points.

Date	1	2	3	4	5	6	7	8	9
02/03/2019	10.0000	9.9884	10.0468	9.9103	9.8582	9.8575	9.9878	9.9546	9.7740
04/05/2019	10.0000	9.9889	10.0470	9.9123	9.8588	9.8570	9.9879	9.9547	9.7737
08/07/2019	10.0000	9.9868	10.0459	9.9112	9.8584	9.8565	9.9872	9.9552	9.7742
12/09/2019	10.0000	9.9889	10.0469	9.9037	9.8527	9.8536	9.9874	9.9554	9.7744



Level Monitoring Difference Graphs

The following graphs display the progressive movement that each Level Monitoring Station recorded at each separate site visit date to give an overall look at how much the property is moving.

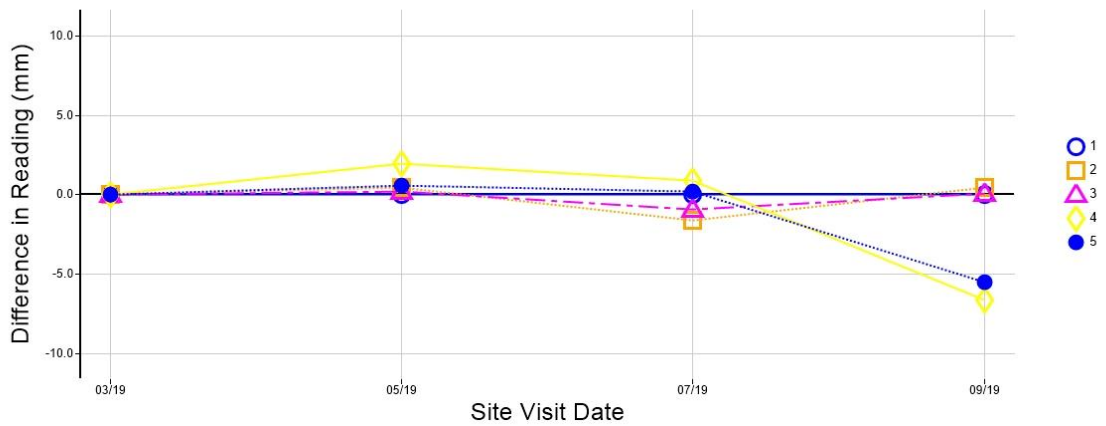

Level Monitoring Displacement Map

The following image shows an isometric representation of the movement of the property, based on the Level Monitoring Stations that were installed.

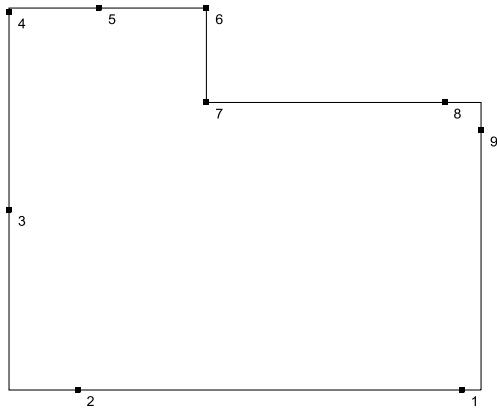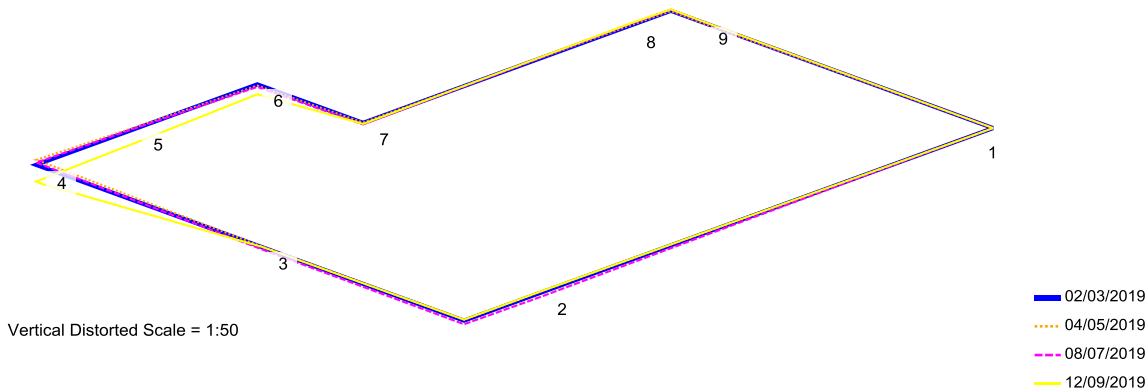

FRONT

Site Visit Notes

Datum is level station 1 as requested, it has an assumed value of 10,0000m. No suitable remote datum, so no secondary TBM available. If this is not suitable, please advise if a deep datum is required.

Site Visit: 2 March 2019

Relative survey.

Site Visit: 4 May 2019

Movement noted.

Site Visit: 12 September 2019

Points 4, 5 & 6 re-checked - Close to tree.