

LEVEL MONITORING

for SMS (LBG)

11 Sylvana Close, Uxbridge, UB10 0BH

Client:	SMS (LBG)
Client Contact:	Ian Domigan
Claim Number:	102430405
Client Reference:	IFS-LBG-SUB-22-0103357
Policy Holder:	Mr Ram Chandar
Report Date:	6 November 2024
Our Ref:	M21288

Level Monitoring Readings


The following table shows the reading levels of the various Level Monitoring Station points.


Date	1	2	3	4	5	6	7	8	9	10
25/05/2023	10.6746	10.7190	10.6326	10.6337	10.7872	10.7702	10.7516	10.7516	10.8536	10.9672
12/07/2023	10.6748	10.7193	10.6323	10.6335	10.7883	10.7714	10.7524	10.7524	10.8514	10.9659
31/08/2023	10.6751	10.7194	10.6324	10.6323	10.7876	10.7713	10.7519	10.7518	10.8491	10.9640
20/10/2023	10.6751	10.7198	10.6330	10.6330	10.7880	10.7712	10.7519	10.7516	10.8494	10.9644
13/12/2023	10.6740	10.7181	10.6319	10.6337	10.7882	10.7710	10.7525	10.7523	10.8517	10.9656
01/02/2024	10.6728	10.7173	10.6307	10.6325	10.7872	10.7696	10.7515	10.7514	10.8514	10.9645
26/03/2024	10.6729	10.7174	10.6307	10.6327	10.7873	10.7697	10.7525	10.7525	10.8536	10.9667
22/05/2024	10.6726	10.7173	10.6307	10.6327	10.7875	10.7698	10.7523	10.7531	10.8532	10.9666
10/07/2024	10.6725	10.7172	10.6303	10.6325	10.7872	10.7699	10.7516	10.7520	10.8513	10.9649
29/08/2024	10.6736	10.7183	10.6307	10.6320	10.7876	10.7701	10.7516	10.7514	10.8475	10.9630
06/11/2024	10.6737	10.7183	10.6313	10.6324	10.7874	10.7700	10.7515	10.7516	10.8482	10.9627

Date	11	12	13	14	12a
25/05/2023	10.9686	10.8021	10.8815	10.8543	
12/07/2023	10.9680		10.8826	10.8551	10.8041
31/08/2023	10.9669		10.8823	10.8546	10.8033
20/10/2023	10.9673		10.8829	10.8552	10.8040
13/12/2023	10.9680		10.8828	10.8553	10.8043
01/02/2024	10.9666		10.8813	10.8540	10.8029
26/03/2024	10.9688		10.8828	10.8555	10.8047
22/05/2024	10.9684		10.8824	10.8550	10.8044
10/07/2024	10.9673		10.8822	10.8547	10.8035
29/08/2024	10.9661		10.8823	10.8545	10.8031
06/11/2024	10.9658		10.8821	10.8544	10.8028

Level Monitoring Difference Graphs



The following graphs display the progressive movement that each Level Monitoring Station recorded at each separate site visit date to give an overall look at how much the property is moving.

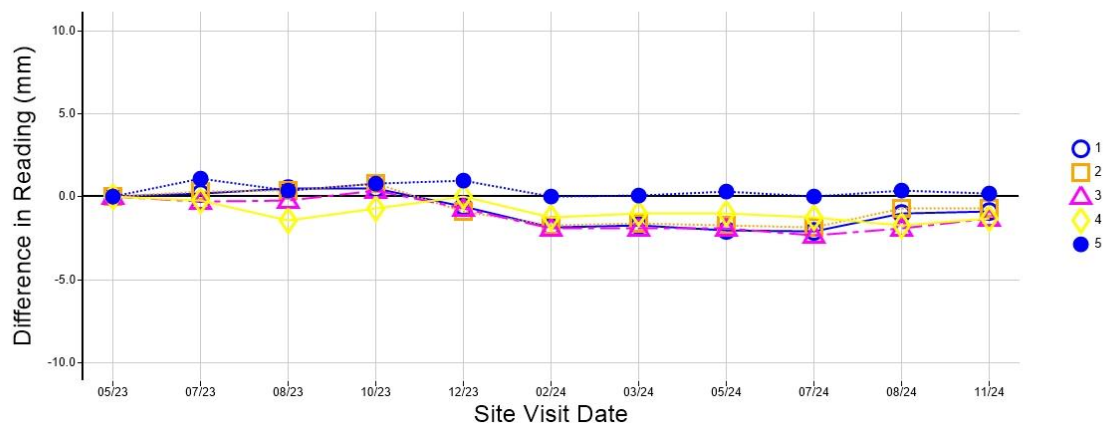

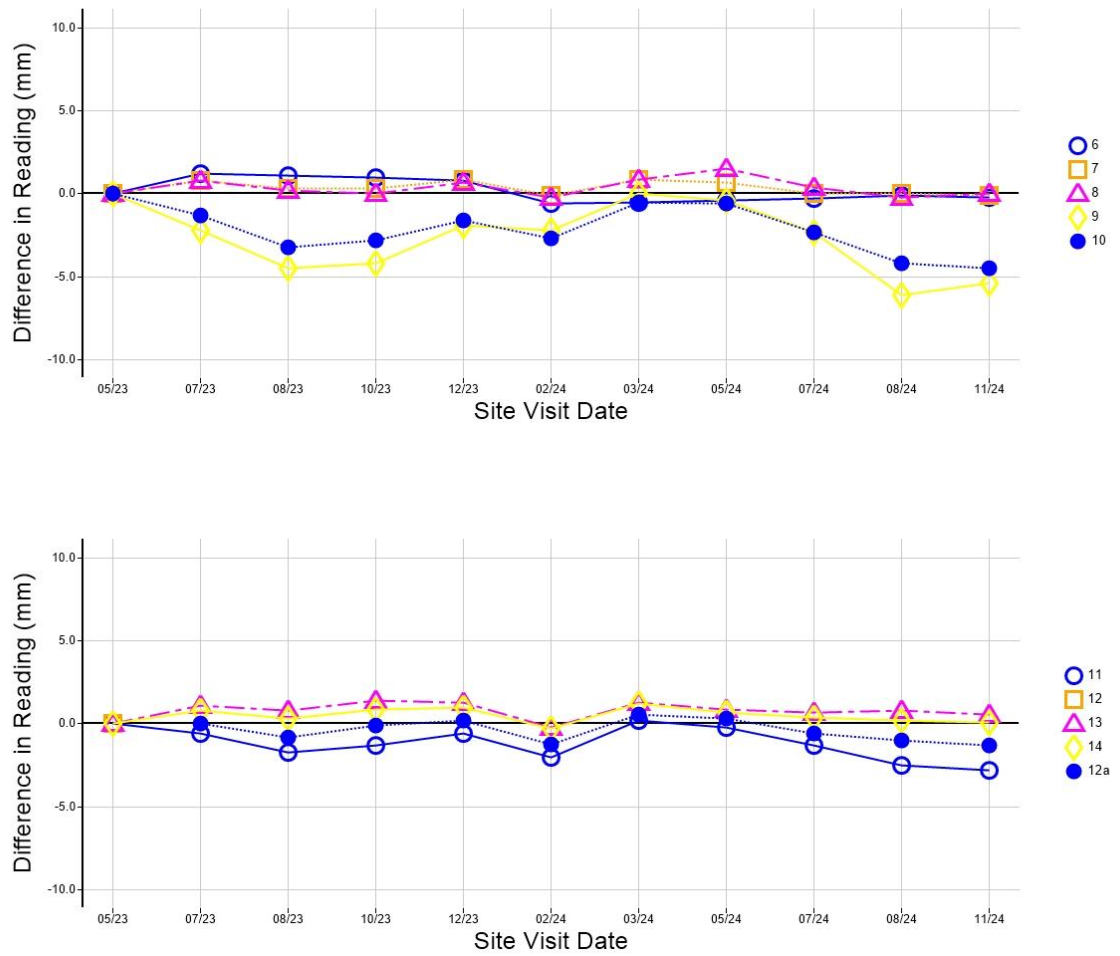

Level Monitoring Displacement Map

The following image shows an isometric representation of the movement of the property, based on the Level Monitoring Stations that were installed.

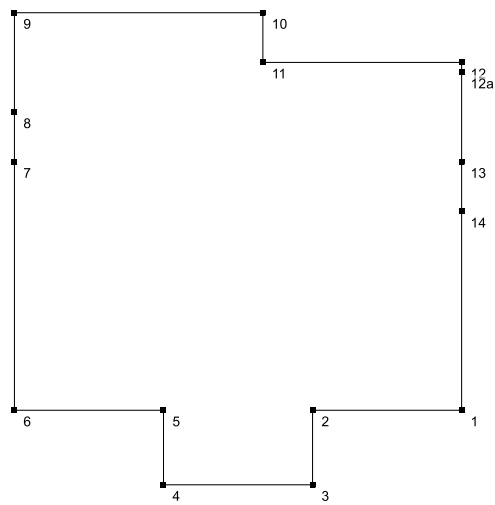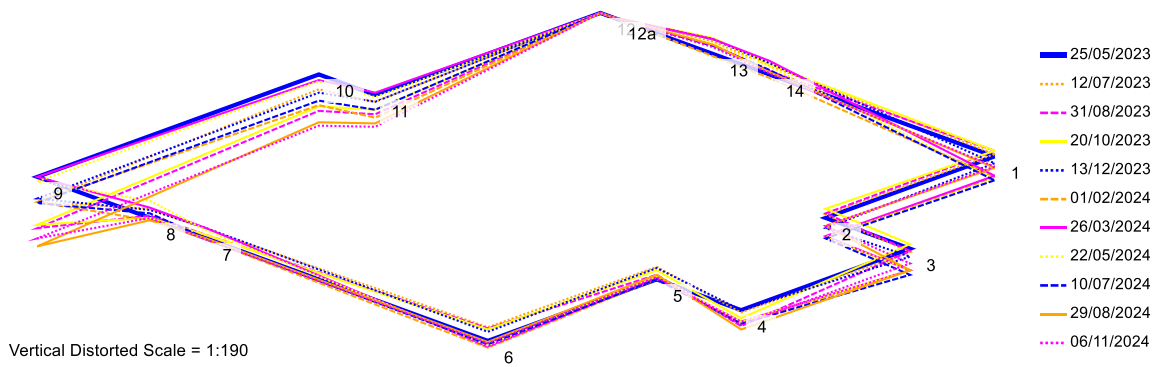

Site Visit Notes

TBM is a manhole in front of the property. No remote datum available, if this is not suitable please advise if a deep datum is required.