



Arboricultural Survey - BS5837:2012

Komorebi Ventures Limited

**25 New Road
Harlington
Hayes
London
UB3 5BD**

25 July 2024

Anthony Jones BSc (Hons) TechArborA

Table of Contents

1	Introduction	3
2	Survey	4
3	BS 5837:2012 - Scope	6
4	Methodology	6
5	Definitions	8
6	Recommendations	9
7	Limitations	9
8	Appendices	10
	Appendix 1: Table 1 Cascade chart for tree quality assessment	11
	Appendix 2: Tree Schedule	13
	Appendix 3: Tree Constraints Plan	18
9	Document Production Record	20

1 Introduction

Arbtech Consulting Limited (Arbtech) received written instruction on 16 July 2024 from Komorebi Ventures Limited to attend 25 New Road, Harlington, Hayes, London, UB3 5BD to undertake an arboricultural survey to BS5837:2012 guidance to assess trees, hedges and major shrub groups growing on and within influencing distance of the site and to produce a Schedule of trees and Tree Constraints Plan.

I am Anthony Jones, an Arboricultural Consultant for Arbtech Consulting Ltd. I have worked within the arboricultural industry for over 8 years, I have qualifications including a BSc Hons in Environmental Resource Management, Level 4 certificate in arboriculture, and a LANTRA professional tree inspection certificate. I am an ISA certified arborist and technician member of the Arboricultural Association.

The advice below and appended is underwritten by our Professional Indemnity insurance for the business practice of Arboricultural Consultancy in the sum of one million Pounds Sterling in each and every claim.

Table 1: Documents referred to.

Document	Reference No.
Survey base drawing	2024-1703-001-Survey Plan
LPA pre-app comments	N/A
British Standard 5837:2012	“BS5837”
Tree Survey Schedule	Arbtech TS 01
Tree Constraints Plan	Arbtech TCP 01

2 Survey

Survey: An arboricultural survey to BS5837 of all trees within impacting distance of the site was undertaken by Anthony Jones on 25 July 2024.

During the survey, I categorised the trees using “Table 1 – Cascade chart for tree quality assessment” of the BS5837:2012 (see Appendix 1).

A total of 12no. individual trees and 3no. groups of trees were surveyed. Details for each are provided in the Schedule of Trees (Appendix 2).

Multiple other small trees and shrubs occupy the site, none of which meet the minimum diameter requirements to be considered for this survey.

Table 2: Documents upon which this tree survey has been based.

Document	Originator	Reference Number	Title
Survey base drawing	The Survey House	2024-1703-001-Survey Plan	Existing Topographical Survey

Limitations: The survey was made at ground level using visual observation only. Detailed examinations, such as climbing inspections and advanced decay detection equipment, were not employed, though may form part of the survey’s management recommendations. Measurements were taken using specialist tapes, lasers, and GPS devices. Where this was not possible, measurements are estimated.

Scope: Pre-development tree surveys make arboricultural management recommendations based exclusively upon the individual tree or group of tree’s condition relative to their present context (*i.e. not in relation to the proposed development*).

Legal Status: No statutory protection check has been performed. BS5837 does not draw any distinction between trees subject to statutory protection, such as a Tree Preservation Order (“TPO”), and those trees without. This is principally because detailed planning consent overrides any TPO protection. Consequently, we do not seek to offer any comparison between or infer any difference in the quality or importance of TPO trees and other trees.

Site Description

The site is in a urban residential area in West London, north of Heathrow Airport. To the east of the site is a private open field.



Figure 1: OS Map showing the site location (Bing Maps).



Figure 2: Location Plan, 25 New Road Harlington.

3 BS 5837:2012 - Scope

This standard recognises that there can be problems for development close to existing trees which are to be retained, and of planting trees close to existing structures. This standard sets out to assist those concerned with trees in relation to construction to form balanced judgements. It does not set out to put arguments for or against development or for the removal or retention of trees. Where development, including demolition, is to occur, the standard provides guidance on how to decide which trees are appropriate for retention, on the means of protecting these trees during development, including demolition and construction work, and on the means of incorporating trees into the developed landscape.

4 Methodology

The methodology used to assess the trees was the British Standard 5837:2012 'Trees in Relation to Construction' tree survey method. The aim of the survey is to establish which trees are moderate and good quality, suitable for retention and justifying protection. And which trees are low or poor quality, either undesirable or unsuitable to retain and protect.

The tree survey includes all trees included in the land survey red line boundary plan, as well as any that may have been missed, and it should categorize trees or groups of trees, including woodlands, for their quality and value within the existing context in a transparent, understandable, and systematic way. Where the arboriculturist has deemed it appropriate, the trees have been tagged with small metal or plastic tags, placed as high as is convenient on the stem of each tree.

Whilst master plan proposals for the development of the site might be available, the trees have been surveyed without taking these into consideration. All detailed design work on site layout should take into consideration the results of the tree survey (and the TCP).

Trees forming groups and areas of woodland (including orchards, wood pasture and historic parkland) are identified and considered as groups where the arboriculturist has determined that this is appropriate, particularly where they contain a variety of species and age classes that could aid long-term management. It is often expedient to assess the quality and value of such groups of trees as a whole rather than as individuals. However, an assessment of individuals within any group has been undertaken if they are open-grown or if there is a need to differentiate between them.

The quality and value of each tree or group of trees have been recorded by allocating it to one of the four categories: **A**, **B**, **C**, or **U** (highest to lowest quality, respectively). The categories are differentiated on the tree survey plan by colour or by suffixing the category adjacent to the tree identification number on the TCP.

The survey schedule lists all the trees or groups of trees. The following information is also provided:

- a) reference number (to be recorded on the tree survey plan);
- b) species (common or scientific names);
- c) height in meters (m);
- d) stem diameter in millimetres (mm) at 1.5m above adjacent ground level or immediately above the root flare for multi-stemmed trees;
- e) branch spread in meters taken at the four cardinal compass points;
- f) height of crown clearance above adjacent ground level in meters (m);
- g) age class (newly planted, young, semi-mature, early mature, mature, over mature);
- h) physiological condition (e.g. good, fair, poor, decline and dead);
- i) structural condition (e.g. good, fair, poor or not visible);
- j) comment about the tree, its location and preliminary management recommendations, including further investigation of suspected defects that require more detailed assessment and potential for wildlife habitat;
- k) The retention category referring to the quality and useful contribution in years; **U** = <10yrs; **A** = >40yrs; **B** = >20yrs; **C** = >10yrs. The retention subcategory referring to the type of amenity; 1 = Arboricultural; 2 = Landscape; 3 = Cultural including conservation (see Appendix 1 Cascade chart for tree quality assessment).

5 Definitions

Arboriculturist

An arboriculturist (or arboricultural consultant) is a person who has, through relevant education, training, and experience, gained recognized qualifications and expertise in the field of trees in relation to construction.

Tree Survey

A tree survey should be undertaken by an arboriculturist and should record information about the trees on a site independently of and prior to any specific design for development. As a subsequent task, and with reference to a design or potential design, the results of the survey should be included in the preparation of a tree constraints plan, which should be used to assist with site layout design.

Tree Constraints Plan

A TCP is plan, typically delivered as an AutoCAD drawing (.DWG file format), prepared by an arboriculturist for the purposes of layout design showing the root protection area and representing the effect that the mature height and spread of retained trees will have on layouts through shade, dominance, etc.

Root Protection Area

An RPA is a layout design tool indicating the area surrounding a tree that contains sufficient rooting volume to ensure the survival of the tree, shown in plan form in m².

Construction Exclusion Zone (also termed Tree Protection Zone)

A construction exclusion or tree protection zone is an area based on the RPA (in m²), identified by an arboriculturist, to be protected during development, including demolition and construction work, by the use of barriers and/or ground protection fit for purpose to ensure the successful long-term retention of a tree.

Arboricultural Impact Assessment (AIA)

This is a study, undertaken by an arboriculturist, to identify, evaluate and possibly mitigate the extent of direct and indirect impacts on existing trees that may arise as a result of the implementation of any site layout proposal.

Tree Protection Plan (TPP)

A TPP is plan, typically delivered as an AutoCAD drawing (.DWG file format), prepared by an arboriculturist showing the finalized layout proposals, tree retention and tree and landscape protection measures detailed within the arboricultural method statement, which can be shown graphically.

Arboricultural Method Statement (AMS)

This is a methodology for the implementation of any aspect of development that has the potential to result in loss of or damage to a tree. The AMS is likely to include details of an on-site tree protection monitoring regime.

6 Recommendations

With the benefit of making an assessment of your planning proposals, we make the following recommendation to ensure that there are no irrevocable issues to the proposed retained trees and so that no conditions relating to arboriculture are attached to any planning consent secured; obtain an arboricultural report to include:

- a) An arboricultural impact assessment (AIA).
- b) An arboricultural method statement (AMS).
- c) A tree protection plan drawing (TPP).

7 Limitations

Trees were inspected from using visual observation from ground level only. Trees were not climbed or inspected below ground level. Inaccessible trees will have best estimates made about the location, physical dimensions, and characteristics. Trees have been grouped where BS5837 guides us that it is expedient to do so. Trees have been excluded from the survey if they are found by us to be sufficiently far away from the proposed developable area or if they are outside of the red line boundary plan showing the expectations of our client for the extent of the survey. BS5837 does not draw any distinction between trees subject to statutory protection, such as a Tree Preservation Order (“TPO”), and those trees without. This is principally because a detailed planning consent overrides any TPO protection. Consequently, we do not seek to offer any comparison between or infer any difference in the quality or importance of TPO trees and other trees.

8 Appendices

The following documents were released to the Client as appendices to this report:

- Survey Schedule (.PDF)
- Tree Constraints Plan drawing (.DWG & .PDF)

If you require clarification of the information contained herein, please do not hesitate to contact us via 01244 661170.

Yours Sincerely,



Anthony Jones BSc (hons), Cert Arb Lv4 (ABC), TechArborA.

Arboricultural Consultant

07821 657075

anthonyjones@arbtech.co.uk

Appendix 1: Table 1 Cascade chart for tree quality assessment

BS5837:2012 Trees in relation to design, demolition and construction – Recommendations

Cascade chart for tree quality assessment - Table 1 - (reproduced with permission of BSI Global)

Category and Definition	Criteria including sub-categories where appropriate			Identification on Plan
Category U (Trees unsuitable for retention - See notes). Those in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years.	<ul style="list-style-type: none"> Trees that have serious, irremediable, structural defect, such that their early loss is expected due to collapse, including those that will become unviable after removal of other category U trees (e.g. where, for whatever reason, the loss of companion shelter cannot be mitigated by pruning). Trees that are dead or are showing signs of significant, immediate, and irreversible overall decline. Trees infected with pathogens of significance to the health and/or safety of other trees nearby, or very low-quality trees suppressing adjacent trees of better quality. <p><i>NOTE Category U trees can have existing or potential conservation value which might be desirable to preserve; see 4.5.7.</i></p>			Dark red
Trees considered for retention	1) Mainly arboricultural qualities	2) Mainly landscape qualities	3) Mainly cultural values (including conservation)	
Category A Trees of high quality with an estimated remaining life expectancy of at least 40 years.	Trees that are particularly good examples of their species, especially if rare or unusual; or those that are essential components of groups or formal or semi-formal arboricultural features (e.g. the dominate and/or principal trees within an avenue).	Trees, groups, or woodlands of particular visual importance as arboricultural and/or landscape features.	Trees, groups or woodlands of significant conservation, historical, commemorative or other value (e.g. veteran trees or wood-pasture).	Light green
Category B Trees of moderate quality with an estimated remaining life expectancy of at least 20 years.	Trees that might be included in category A, but are downgraded because of impaired condition (e.g. presence of significant though remedial defects, including unsympathetic management and storm damage), such that they are unlikely to be suitable for retention of beyond 40 years; or trees lacking the special quality necessary to merit the category 'A' designation.	Trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals; or trees occurring as collectives but situated so as to make little visual contribution to the wider locality.	Trees with material conservation or other cultural value.	Mid blue
Category C Trees of low quality with an estimated remaining expectancy of at least 10 years, or young trees with a stem diameter below 150mm.	Unremarkable trees of very limited merit or such impaired condition that they do not qualify in higher categories.	Trees present in groups or woodlands, but without this conferring on them significantly greater collective landscape value; and/or trees offering low or only temporary/transient landscape value.	Trees with no material conservation or other cultural value.	Grey

Appendix 2: Tree Schedule

Client: Komorebi Ventures Limited
 Project: 25 New Road, Harlington, Hayes, London, UB3 5BD
 Survey Date: 25/07/2024
 Surveyor: Anthony Jones



3 Well House Barns
 Chester Road
 Bretton
 Cheshire
 CH4 0DH
 Phone: 01244661170

Tree and Tag No Species	Hght (m)	Stems		Crown		Age	RP A (m ²) R (m)	Phys Condition	Structural Condition	Preliminary Recommendations		Cat ERC
		No	Ø (mm)	Spread (m)	Clear (m)					Survey Comment		
G01												Estimated Measurements
A Group <i>See comments for details</i>	5	1	150	N 2	2 SM	A: 10.2	Good	C: Good	S: Not visible	B: Not visible		C.2
				E 2	0	R: 1.8						10+ yrs
				S 2	0							
				W 2	0							
G02												Estimated Measurements
A Group <i>See comments for details</i>	7	1	200	N 4	1 EM	A: 18.1	Good	C: Good	S: Not visible	B: Not visible		B.2
				E 4	1	R: 2.4						20+ yrs
				S 4	1							
				W 4	2							
G03												Estimated Measurements
A Group <i>See comments for details</i>	7	1	150	N 2.5	1 EM	A: 10.2	Good	C: Good	S: Not visible	B: Not visible		B.2
				E 2.5	1	R: 1.8						20+ yrs
				S 2.5	1							
				W 2.5	2							
T01												
Common Walnut <i>Juglans regia</i>	4.5	1	150	N 2.5	1.5 SM	A: 10.2	Good	C: Good	S: Good	B: Good		C.1
				E 3.5	2	R: 1.8						10+ yrs
				S 3.5	1.5							
				W 2	2.5							
Age Classifications:	N	Newly planted	EM	Early Mature								
	Y	Young	M	Mature	Condition:	C	Crown	Stems:	Ø	Diameter		
	SM	Semi-mature	OM	Over Mature		S	Stem		(Eq)	Equivalent stem diameter using BS5837:2012 definition		
						B	Basal area	ERC:		Estimated Remaining Contributio		


Tree and Tag No Species	Hght (m)	Stems		Crown		Age	RP A (m ²) R (m)	Phys Condition	Structural Condition	Preliminary Recommendations		Cat ERC
		No	Ø (mm)	Spread (m)	Clear (m)					Survey Comment		
T02 Common Walnut <i>Juglans regia</i>	6.5	1	290	N E S W	3.5 4 3.5 2	0	EM 0 0 2	A: 38.1 R: 3.48	Fair C: Fair S: Not visible B: Not visible	Tree located onsite on western boundary. Ivy covered stem up to 4 m from ground level restricting survey. Historic pruning consistent with topping at 4 m from ground level. Stem diameter recorded over ivy.	C.1 10+ yrs	
T03 Common or Black Elder <i>Sambucus nigra</i>	3	1	100	N E S W	1 1.5 1.5 1	2	SM 0.5 0.5 0.5	A: 4.5 R: 1.19	Good C: Good S: Good B: Not visible	Tree located onsite. Ivy covered basal area restricting survey.	C.1 10+ yrs	
T04 Apple <i>Malus sp.</i>	4.5	7	265 (Eq)	N E S W	2 4 2 2	2	SM 0.5 1 0.5	A: 31.7 R: 3.17	Fair C: Good S: Fair B: Fair	Tree located onsite. No notable features observed.	C.1 10+ yrs	
T05 Wild Cherry <i>Prunus avium</i>	6.5	1	280	N E S W	3 2 2 3	3	EM 3 2.5 3	A: 35.5 R: 3.36	Poor C: Fair S: Poor B: Fair	Tree located onsite. 800 mm longitudinal cavity wound on south west side of stem. Multiple 50-100 mm diameter decay pruning wounds on main stem. Sap oozing on main stem. Multiple canker wounds on main stem. Historic pruning consistent with crown lifting up to 3 m from ground level.	U <10 yrs	
T06 Magnolia <i>Magnolia sp.</i>	4	2	156 (Eq)	N E S W	3.5 2.5 2 2	2	SM 2 2 2	A: 10.9 R: 1.86	Fair C: Fair S: Good B: Good	Tree located onsite next to building. Dieback present in inner crown. Historic pruning consistent with crown lifting up to 2 m from ground level.	C.1 10+ yrs	
Age Classifications:		N	Newly planted	EM	Early Mature	Condition:		C	Crown	Stems:	Ø Diameter	
		Y	Young	M	Mature			S	Stem		(Eq)	Equivalent stem diameter using BS5837:2012 definition
		SM	Semi-mature	OM	Over Mature			B	Basal area	ERC:	Estimated Remaining Contributio	

Tree and Tag No Species	Hght (m)	Stems		Crown		Age	RP A (m ²) R (m)	Phys Condition	Structural Condition	Preliminary Recommendations		Cat ERC
		No	Ø (mm)	Spread (m)	Clear (m)					Survey Comment		
T07												
Norway Spruce <i>Picea abies</i>	7	1	260	N E S W	2.5 3 2 1.5	3	EM R: 3.12	A: 30.6	Fair S: Good B: Good			C.1 10+ yrs
T08												
Magnolia <i>Magnolia sp.</i>	3	2	128 (Eq)	N E S W	2.5 3 2 1	2	SM R: 1.53	A: 7.4	Good S: Good B: Good			C.1 10+ yrs
T09												
Common Holly <i>Ilex aquifolium</i>	5.5	5	266 (Eq)	N E S W	1.5 2.5 2 1.5	2	EM R: 3.19	A: 32.1	Fair S: Good B: Not visible			C.1 10+ yrs
T10												
Common Walnut <i>Juglans regia</i>	8	2	256 (Eq)	N E S W	4.5 4.5 3.5 4	2	EM R: 3.07	A: 29.7	Good S: Fair B: Good			B.1 20+ yrs
T11												
Apple <i>Malus sp.</i>	2.5	1	130	N E S W	0.5 1.5 0.5 1	0	SM R: 1.55	A: 7.6	Good S: Good B: Good			C.1 10+ yrs
Age Classifications:	N	Newly planted	EM	Early Mature								
	Y	Young	M	Mature								
	SM	Semi-mature	OM	Over Mature								
Condition:	C	Crown										
	S	Stem										
	B	Basal area										
Stems:	Ø	Diameter										
	(Eq)	Equivalent stem diameter using BS5837:2012 definition										
ERC:	Estimated Remaining Contribution											

Tree and Tag No Species	Hght (m)	Stems		Crown		Age	RP A (m ²) R (m)	Phys Condition	Structural Condition	Preliminary Recommendations		Cat ERC
		No	Ø (mm)	Spread (m)	Clear (m)					Survey Comment		
T12												Estimated Measurements
Norway Maple <i>Acer platanoides</i>	7	1	300	N E S W	4 3 5 5	2	EM	A: 40.7 R: 3.59	Good	C: Good S: Not visible B: Not visible		B.1.2 20+ yrs
												Tree located off-site on northern boundary. Ivy covered stem up to 5 m from ground level. Restricted access survey measurements estimated.

Age Classifications:	N	Newly planted	EM	Early Mature	Condition:	C	Crown	Stems:	Ø	Diameter	
	Y	Young	M	Mature		S	Stem		(Eq)	Equivalent stem diameter using BS5837:2012 definition	
	SM	Semi-mature	OM	Over Mature		B	Basal area	ERC:		Estimated Remaining Contributio	

Appendix 3: Tree Constraints Plan

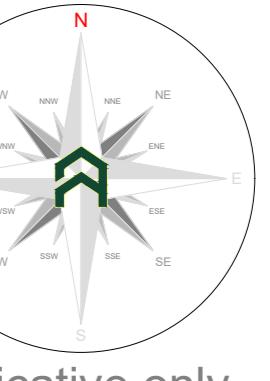

Indicative only

Tree Categories
 Trees are categorised in accordance with the cascade chart in relation to the British Standard 8583/2012 Tree in relation to design, demolition and construction - Recommendations.

Category 'U' - Trees in such condition that they cannot realistically be retained as living trees in context of the current design, demolition and construction - Recommendations.

Category 'A' - Trees with high quality with an estimated remaining life expectancy of at least 40 years.

Category 'B' - Trees with high quality with an estimated remaining life expectancy of at least 20 years.

Category 'C' - Trees of low quality with an estimated remaining life expectancy of at least 20 years.

Category 'D' - Trees of low quality with an estimated remaining life expectancy of less than 10 years.

Category 'E' - Trees of low quality with an estimated remaining life expectancy of less than 10 years.

Category 'F' - Trees in such condition that they cannot realistically be retained as living trees in context of the current design, demolition and construction - Recommendations.

*Trees in relation to design, demolition and construction - Recommendations.

The RPA is calculated using the British Standard BS 8583/2012.

*Trees in relation to design, demolition and construction - Recommendations.

The calculated RPA is capped to 70m*, which is the equivalent of a circle with a radius of 15m. Where there appears to be restrictions to root growth the root protection area is reshaped to more accurately reflect the likely distribution of the roots.

*Trees in relation to design, demolition and construction - Recommendations.

All trees were surveyed and categorised in accordance with the British Standard BS 8583/2012 Tree in relation to design, demolition and construction - Recommendations.

*Trees in relation to design, demolition and construction - Recommendations.

We make the following recommendation to ensure that no damage is caused to the roots or rootling environment of retained trees. The Root Protection Areas (RPAs) are plotted around each of the category A, B and C trees. This is a minimum requirement in which should be left undisturbed around each retained tree.

The RPA is calculated using the British Standard BS 8583/2012.

*Trees in relation to design, demolition and construction - Recommendations.

Please refer to Arbtech Consulting Ltd. Tree Survey Report and Tree Schedule for full details on all surveyed trees, hedges, woodlands and groups of trees/shrubs.

All trees were surveyed and categorised in accordance with the British Standard BS 8583/2012 Tree in relation to design, demolition and construction - Recommendations.

*Trees in relation to design, demolition and construction - Recommendations.

We make the following recommendation to ensure that no damage is caused to the roots or rootling environment of retained trees. The Root Protection Areas (RPAs) are plotted around each of the category A, B and C trees. This is a minimum requirement in which should be left undisturbed around each retained tree.

The RPA is calculated using the British Standard BS 8583/2012.


*Trees in relation to design, demolition and construction - Recommendations.

Obtained and anticipated root to include:

a) An arboricultural inspection statement (AIS).

b) An arboricultural method statement (AMS).

c) A tree protection plan (TPP).

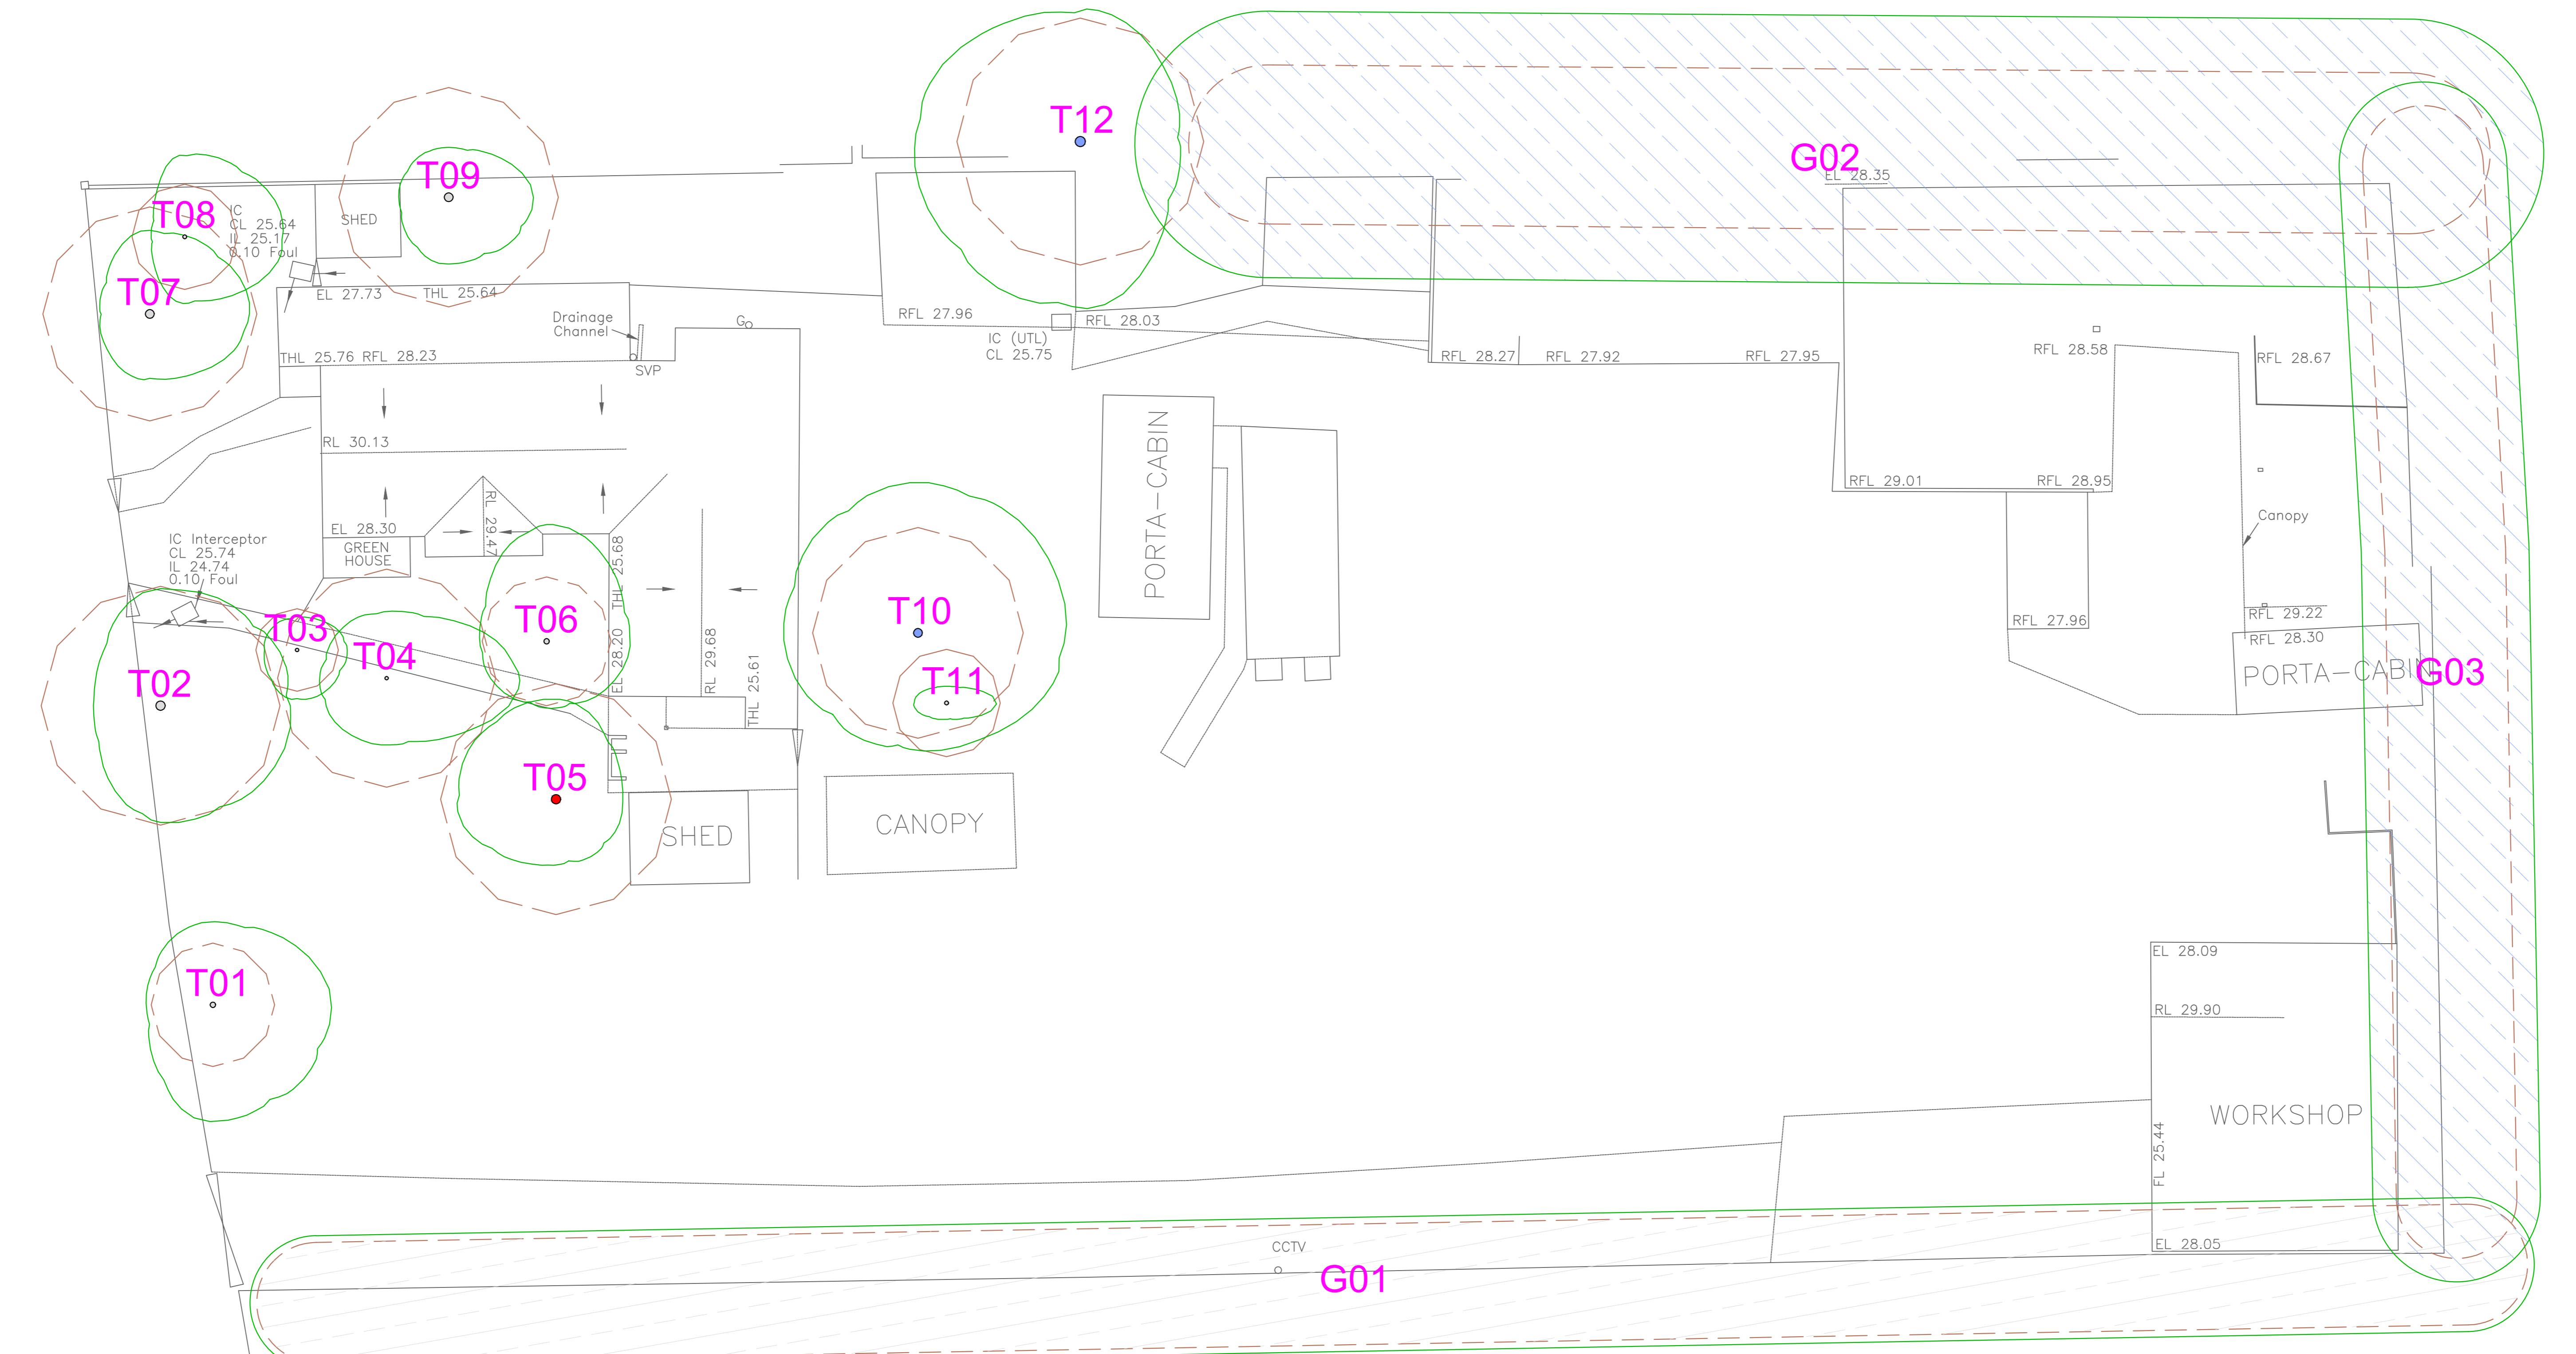

Rev: Date: Notes:
 -- -- --

arbtech
 Unit 3, Well House Barns, Chester, CH4 0DH
<https://arbtech.co.uk>

Project: 25 New Road
 Harlington
 Hayes
 London
 UB3 5BD

Client: Komorebi Ventures Limited

Drawing: Tree Constraints Plan

Based on: 2024-1703-001- Survey Plan

Drawing No: Arbtech TCP 01 Rev: --

Date: July 2024 Scale: 1:100 @ A0 Drawn: AOJ

Key:

Tree Nos. T01 Tree Canopies: Trunks: ○

RPAs: ○ Category 'B' trees: ● Category 'C' trees: ○

Category 'B' groups: ○ Category 'C' groups: ○

0m 1m 3m 5m 10m

All dimensions should be checked on site. No dimensions are to be quoted from this drawing. This drawing is not to be used as a definitive plan of the engineering or construction design or method. This drawing is to be used as a reference point for the engineering or construction design or method. Soil surface to underpinning and foundations should be in accordance with the relevant standards and regulatory requirements relating to proposed structures. Soil surface to underpinning and foundations may be required where a new structure may be required.

© Arbtech Consulting Ltd. 2024

9 Document Production Record

Document number	Editor	Signature	Position	Issue number	Date
Arbtech TSR 01	Anthony Jones		Arboricultural Consultant	01	25/07/24

Limitations

Arbtech Consulting Ltd has prepared this report for the sole use of the above-named Client/Agent in accordance with our terms of business, under which our services were performed. No other warranty, expressed or implied, is made as to the professional advice included in this report or any other services provided by us. This report may not be relied upon by any other party without the prior and express written agreement of Arbtech Consulting Ltd. The assessments made assume that the sites and facilities will continue to be used for their current purpose without significant change. The conclusions and recommendations contained in this report are based upon information provided by others and upon the assumption that all relevant information has been provided by those parties from whom it has been requested. Information obtained from third parties has not been independently verified by Arbtech Consulting Ltd.

Copyright

© This Report is the copyright of Arbtech Consulting Ltd. Any unauthorised reproduction or usage by any person other than the addressee is strictly prohibited.