


LEVEL MONITORING - RELATIVE SURVEY READINGS

Provider Details			Client Details			Risk Address		
Name:	Knight & Associates Ltd		Insurance Co.:	Axa		Occupier:		
Our Ref:	SU2005239		Client Name:	Crawford		Address:		
			Technical Mgr:	M Deller		Address:		
			Email:			Town:		
			Client Ref:			County:		
Monitoring Details			Address:	National Subsidence Unit		Post Code:		
Instruction Date:	1/3/21		Address:	4th Floor 30 St Pauls Square		Tel Home:		
First Reading Date:	12/03/2021		Town:	Birmingham		Tel Work:		
Maximum No Visits:	7		County:			Mobile:		
Anticipated Expiry Date:	March '22		Post Code:	B3 1QZ		Other:		
Monitoring Int (Wks):	8		Other Email:	subsidence.monitoring@crawco.co.uk		Other:		

		Target Date:													
		Reading Date:		12/3/21		6/5/21		14/7/21		7/9/21		2/11/21		24/1/22	
		Issue Date:		15/3/21		7/5/21		15/7/21		8/9/21		3/11/21		25/1/22	
Row No.	Point Name	X Co-ordinate	Y Co-ordinate	1	2	3	4	5	6	7	8	9	10	11	12
1	1	0.00	0.00	10.2270	10.2270	10.2270	10.2270	10.2270	10.2270	10.2270					
2	2	-6.00	0.00	10.2180	10.2180	10.2180	10.2180	10.2180	10.2180	10.2180					
3		-8.00	0.00												
4	3	-8.00	-2.00	10.2810	10.2810	10.2810	10.2820	10.2810	10.2810	10.2820					
5	4	-13.00	-2.00	10.2870	10.2860	10.2870	10.2880	10.2870	10.2870	10.2870					
6	5	-13.00	2.70	10.1240	10.1230	10.1240	10.1270	10.1270	10.1260	10.1270					
7	6	-13.00	7.40	10.1950	10.1950	10.1960	10.1970	10.1960	10.1960	10.1960					
8	7	-6.50	7.40	10.1940	10.1930	10.1940	10.1970	10.1960	10.1960	10.1960					
9	8	0.00	7.40	10.2190	10.2190	10.2190	10.2230	10.2230	10.2210	10.2210					
10		0.00	0.00												
11															
12															
13															
14															
15															
16															
17															
18															
19															
20															
21															
22															
23															
24															
25															
26															
27															
28															
29															
30															
31															
32															

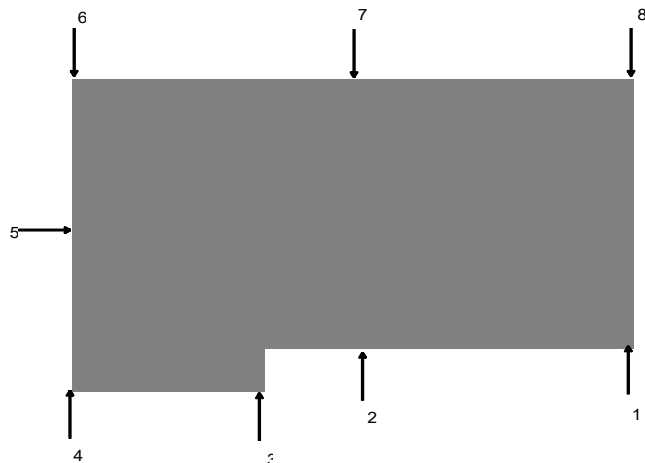

FRONT.


Remote datum

- 24/01/22 Readings taken.
- A common brickcourse could not be followed, subsequently relative data only.
- No further visits are planned

LEVEL MONITORING - RELATIVE MOVEMENT SKETCH

Client: Crawford

Client Ref: 0

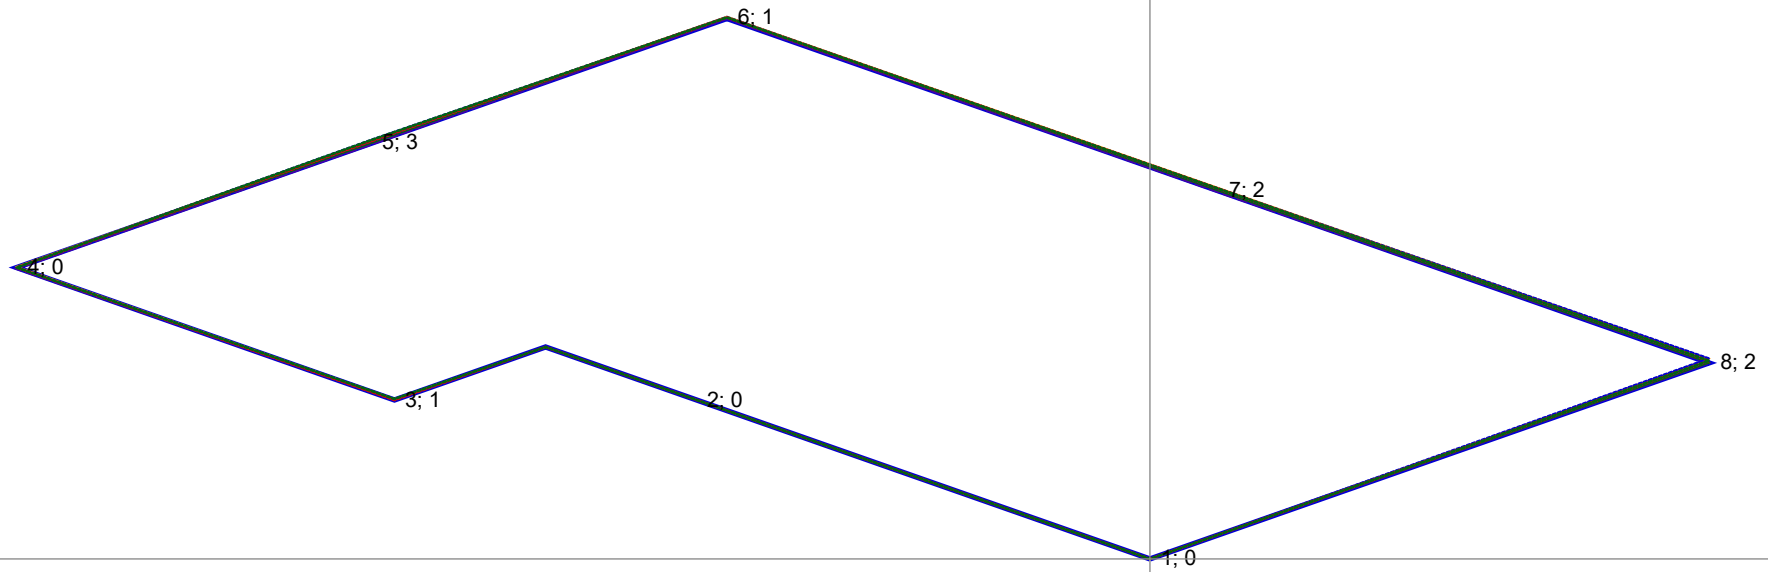

Datum Reading Reading 1 (12/3/21) Reading 2 (6/5/21) Reading 3 (14/7/21) Reading 4 (7/9/21) Reading 5 (2/11/21) Reading 6 (24/1/22)
 Reading 7 (14/3/22) Reading 8 (0/1/00) Reading 9 (0/1/00) Reading 10 (0/1/00) Reading 11 (0/1/00) Reading 12 (0/1/00)

Notes:
Vertical distorted scale 1: 20

Point labels give level difference of last reading from original datum in mm.

LEVEL MONITORING - RELATIVE SURVEY READINGS


Client: Crawford

Client Ref:


0

Chart Scale 1:1000


1

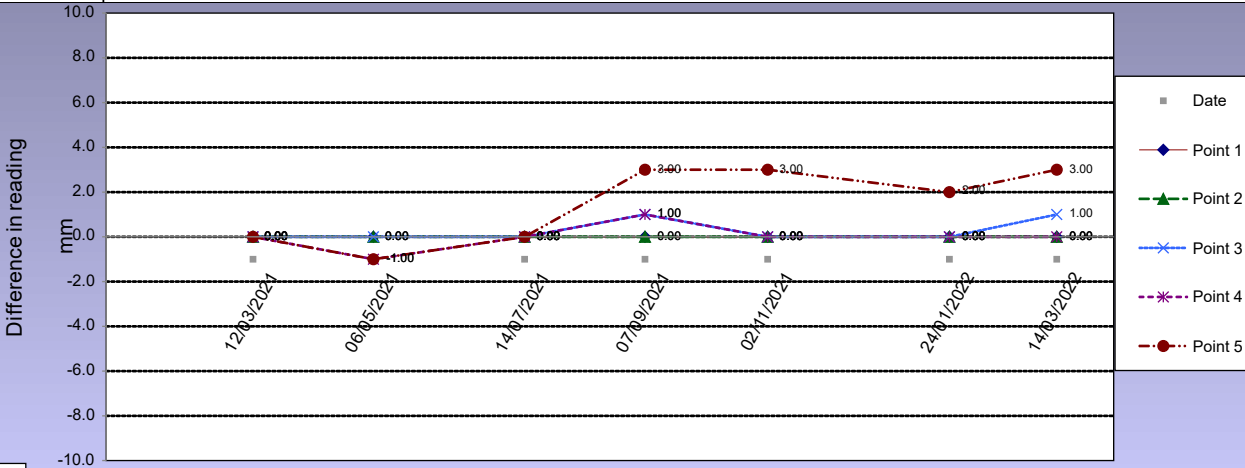

2

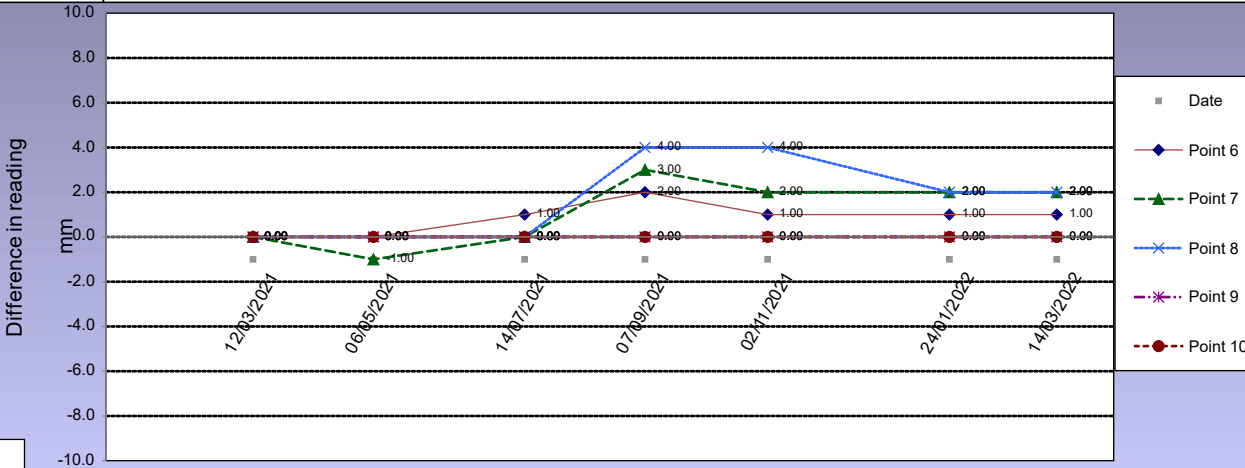

3

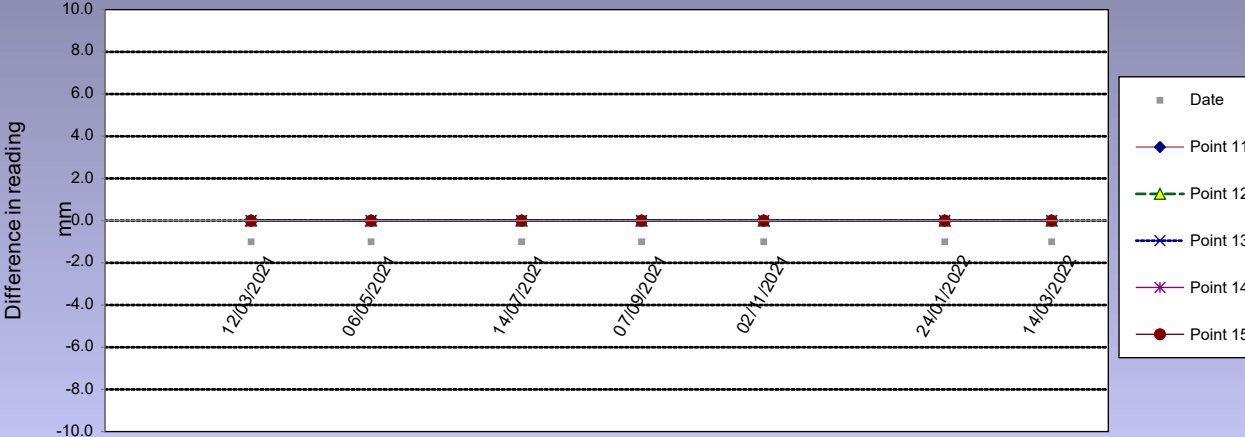

Standard Comments for selection in Readings and Sketch Worksheets
User may edit these as appropriate

Standard Comments	
No Comment	
Standard Comment 1	A further visit is due in
Standard Comment 2	No further readings are planned
Standard Comment 3	The Insured requested an update.
Standard Comment 4	Points fitted and readings taken.
Standard Comment 5	

Standard Bullet
●