

4.0 Desk Top Review and Survey Planning:



4.1 Details of information requested from the Duty Holder by Amiantus in order to carry out a desk top review and plan the survey in accordance with HSG 264 were recorded on our pre-survey questionnaire, along with details of all the information that were provided by Helena I. Kolsaker on behalf of the client.

The Information provided was assessed during the desktop review and a survey plan, and risk assessment was produced for the survey of:

Unit 504
Stone Close
Horton Road
West Drayton
UB7 8JU

The survey was carried out to all areas to ground, 1st & mezzanine floors, including voids and external elevations.

Where information was provided regarding the presence of known or presumed asbestos materials then this has been validated during the course of the survey, and recorded within this report.

Detailed drawings were not provided by the client at the time of the survey.

5.0 Survey Method



5.1 This survey has been undertaken in accordance with HSG264 and Amiantus in house procedures.

5.2 Clients of Amiantus that have signed our terms and conditions are deemed to have agreed, and accepted, our surveying approach, our sampling strategy, and our standard planning, surveying and reporting format unless they have made specific requests to the contrary.

5.3 The information provided by the client or their representative are recorded in the planning document and has been used to define the scope of the survey.

5.4 Photographs of suspected ACM's will be taken at the time of the survey unless the client expressly requests otherwise. Sampling points and suspected ACM's will not be identified with labels unless the client expressly requests otherwise.

5.5 All fibrous materials and item will be included in the survey unless, in the surveyors professional opinion, these items can be excluded (eg. Wood, wallpaper, man-made mineral fibre). Samples of all thermoplastic floor coverings will be taken unless, in the surveyors professional opinion, such items can be excluded. All textured coatings and novel bituminous will be sampled.

5.6 Areas that could not be accessed were presumed to have ACM's present until proven otherwise. Each area requiring further inspection is documented within the Executive summary (Inaccessible areas). Inaccessible areas are also shown on the plan drawings (Appendix 5)

5.7 Materials that could not be accessed and in the surveyors opinion can be dismissed will be presumed to be ACM unless proven otherwise. Materials that are not sampled but, in the surveyors opinion, have a similar appearance, location and function as a previously sampled material will be strongly presumed to be similar to the sampled material.

5.8 The quantity of samples taken may have been minimised by using 'strongly presumed' as defined above. Materials that are 'strongly presumed' to be similar to a material that has already been sampled will be recorded in the comments section of the survey and referenced against the original sampled material.

5.9 Our surveyor has made every attempt to avoid causing damage during the management surveys whilst attempting to identify possible ACM's. Minor repairs will be made and any areas accessed will be left in a safe condition.

5.10 Intrusive damage that is required to gain access to an area/location that is within the scope of the survey has been agreed with the client or the clients representative. Any remedial action will be put in place before such action is attempted. If remedial action cannot be arranged, no attempt to access the area will be made and the reasons recorded. The area/location will be presumed to have ACM's present until proven otherwise.

5.11 Non fibrous materials and item known not to contain asbestos (eg Breeze block, plaster, plasterboard plastics and non textured paints) will be excluded from the survey unless the surveyor suspects that these materials have been contaminated with asbestos from other sources or specifically requested by the client.

5.12 Older electrical equipment, which cannot be shown to contain ACM's, has been presumed to have ACM's present unless, in the surveyors professional opinion, such items can be excluded.

6.0 Exclusions and Caveats:



6.1 Where a survey is carried out under the guidance of the owner of the property or his representative then the survey will be as per his instructions and guidance at that time.

6.2 Every effort has been made to identify all asbestos materials so far as was reasonably practical to do so within the scope of the survey and the attached report. Methods used to carry out the survey were agreed with the client prior to any works being commenced.

6.3 Survey techniques used involved trained and experienced surveyors using the combined approach with regard to visual examination and necessary bulk sampling. It is always possible after a survey that asbestos based materials of one sort or another may remain in the property or area covered by that survey, this could be due to various reasons.

6.4 Materials may be hidden or obscured by other items or cover finishes i.e. paint over boarding disguising etc. Where this is the case then its detection will be impaired. Asbestos may well be hidden as part of the structure to a building and not visible until the structure is dismantled at a later date.

6.5 Debris from previous asbestos removal projects may well be present in some areas: general asbestos debris does not form part of this survey, however all good intentions are made for its discovery. Where an area has been previously stripped of asbestos i.e. plant rooms, ducts etc. and new coverings added, it must be pointed out that asbestos removal techniques have improved steadily over the years since its introduction, most notably would be the control of asbestos at work regulation (1987) laying down certain enforceable guidelines. Asbestos removal prior to this regulation would not be of today's standard and therefore debris may be present below new coverings.

6.6 This survey will detail all areas accessed and all samples taken, where an area is not covered by this survey it will be due to No Access for one reason or other i.e. working operatives, sensitive location or just simply no access. It may have been necessary for the limits of the surveyor's authority to be confirmed prior to the survey.

6.7 Access for the survey may be restricted for many reasons beyond our control such as height, inconvenience to others, immovable obstacles or confined space. Where electrical equipment is present and presumed in the way of the survey no access will be attempted until proof of its safe state is given. Our operatives have a duty of care under the Health and Safety at Work act (1974) for both themselves and others.

6.8 In a building where asbestos has been located and it is clear that not all areas have been investigated, any material that is found to be suspicious and not detailed as part of this survey should be treated with caution and sampled accordingly. Asbestos materials existing within areas not specifically covered by this report are therefore outside the scope of the survey.

6.9 Where areas have been designated as 'no access' or 'restricted access', unless further inspection/sampling proves otherwise, the presumption has been made that these structures/areas contain asbestos materials.

6.10 It is recommended that further intrusive inspection and sampling be carried out where site refurbishment, maintenance, or similar may disturb Asbestos Containing Materials that have remained inaccessible during this survey, this should be a refurbishment/demolition survey as described in HSG 264.

6.11 This report does not include investigations into land contamination associated with asbestos or any other contaminant.

6.0 Exclusions and Caveats (Cont):



6.12 Textured Coatings such as “Artex” may contain a trace quantity of Chrysotile asbestos. Due to this low asbestos content, applications of this product may be non-homogenous and may elicit both positive and negative samples. Where both positive and negative samples are obtained the client should presume that the textured coating contains Chrysotile throughout even though a non-detected result has been obtained.

6.13 Due to the inconsistency of the fibre content in vinyl floor material and its low percentage (generally less than 2% by volume) random sampling only, was carried out to establish the possible presence of asbestos in vinyl flooring. A more comprehensive sampling strategy would have to be implemented to establish the exact extent of asbestos based vinyl flooring. However, unless the material is subjected to vigorous abrasive action or fire, the possibility of fibre release will be minimal due to the matrix of the material.

6.14 Amiantus Environmental Consultants cannot accept any liability for loss, injury, damage or penalty issues due to errors or omissions within this report. Amiantus Environmental Consultants cannot be held responsible for any damage caused as part of this survey carried out on your behalf. Due to the nature and necessity of sampling for asbestos some damage is unavoidable and will be limited to just that necessary for the taking of the sample.

7.0 Sampling and Analysis:



7.1 The object of bulk sampling is to identify the nature and extent of any visible ACM.

7.2 Bulk sampling is undertaken inline with the recognised safe procedures in order to cause minimal possible nuisance and potential risk to health of the building occupants and visitors. Bulk samples are taken in accordance with documented in house procedures, following guidelines detailed in HSG264 'The Survey Guide' and HSG248 'The Analyst Guide'. The quantity of samples taken will be minimised by using 'strongly presumed'. Materials that are 'strongly presumed' to be similar to a material that has already been sampled will be recorded in the comments section of the survey record and referenced against the original sampled material.

7.3 Bulk samples are returned to the appointed bulk analysis laboratory with the appropriate sample / report reference number. Where appropriate; a label will be left on site adjacent to the sample location.

7.4 The label will indicate the sample number and the date taken. This label can be used along with the report for cross reference purposes.

7.5 Bulk sample analysis is carried out in accordance with HSE document HSG 248 'The Analysts Guide' and Amiantus documented in-house methods. Samples are examined under a low magnification stereomicroscope and the fibres teased apart. The fibres are then mounted in liquids of known refractive indices and examined under high magnification using polarised light and dispersion staining in accordance with HSG 248 'The Analysts Guide'.

7.6 The bulk sample description and analysis results can be found in Appendix 4 of this report – The analysis certificate.

Key to Analysis Results:

Chrysotile - White Asbestos

Amosite - Brown Asbestos

Crocidolite - Blue Asbestos

Tremolite - Rare Asbestos

Actinolite - Rare Asbestos

Anthophyllite - Rare Asbestos

8.0 Survey Results - Interpretation:



Survey Results

The results of the survey inspections and sampling undertaken are recorded on the enclosed Survey Data Sheets (appendix 2), Asbestos Register (appendix 1) and Non-Asbestos Material Register (appendix 3). Where asbestos containing material have been identified or presumed to be present then a Material Assessment Algorithm has been calculated as detailed in HSG 264 and reproduced in the table below:

Within the survey data sheets the individual scores in brackets, for each sample variable, are added together to form the final material risk assessment algorithm score.

8.0 Survey Results - Interpretation (cont):

Material Risk Assessment Algorithm

Product type [or debris from product]	
Score	Examples of scores
1	Asbestos reinforced composites [plastics, resins, mastics, roofing felts, vinyl floor tiles, semi-rigid paint, decorative finishes and asbestos cement etc]
2	Asbestos insulating board, mill boards, other low-density boards, textiles, gaskets, ropes and woven materials and asbestos paper.
3	Thermal insulation [e.g. pipe and boiler lagging], sprayed asbestos, loose asbestos, asbestos mattresses and packing.
Extent of damage/deterioration	
Score	Examples of scores
0	Good condition: no visible damage
1	Low damage: a few scratches or surface marks, broken edges on boards or tiles, etc.
2	Moderate damage: significant breakage of materials or several small areas where material has been damaged exposing fibrous edges.
3	High damage or deterioration of materials, sprays and thermal insulation. Visible asbestos contamination by debris or residues.
Surface treatment	
Score	Examples of scores
0	Composite materials containing asbestos, reinforced plastics, resins, vinyl tiles
1	Enclosed sprays or insulation, AIB [with exposed face encapsulated], cement sheets, etc.
2	Unsealed AIB, encapsulated insulation and sprays.
3	Unsealed insulation and sprays.
Asbestos Type	
Score	Examples of scores
1	Chrysotile
2	Amphibole asbestos (excluding Crocidolite)
3	Crocidolite

Material Risk Assessment Score

Risk Category	Risk	Score Range	Fibre release potential
A	HIGH	10 and above	High risk with a high potential to release fibres if disturbed
B	MEDIUM	Between 7 and 9	Medium risk with a medium potential to release fibres if disturbed
C	LOW	Between 5 and 6	Low risk with and having low potential to release fibres if disturbed
D	VERY LOW	4 and below	Very low risk with and having very low potential to release fibres if disturbed

Appendix 1 - Asbestos Register



Building	Floor	Location /Room	S,P,SP,AS Sample No	Product Type	Condition	Surface Treatment	Asbestos Type	Quantity	Accessibility	Material Score	Recommendation	Additional Comments
Unit 504, Stone Close, West Drayton, UB7 8JU	1st	Stairwell and Landing 104, Grey Floor Tiles to steps	S AE002576	Thermoplastic	Low Damage	Completely Sealed	Chrysotile	12m ²	Occasionally likely to be disturbed	3	B - Remove	Asbestos grey floor tiles to steps (under carpet) to stairwell
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground	Toilet G01, Cistern to wall	S AE002577	Reinforced Composite	Low Damage	Completely Sealed	Amosite	1no.	Easily disturbed	4	B - Remove	Asbestos toilet cistern
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground	Office G02, Grey Floor Tiles and Bitumen Adhesive. under carpet	S AE002578	Thermoplastic	Low Damage	Completely Sealed	Chrysotile	40m ²	Easily disturbed	3	B - Remove	The grey floor tiles & bitumen adhesive contain asbestos fibres
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground	Stair Lobby G04, Grey Floor Tiles and Bitumen Adhesive under carpet	SP As AE002578	Thermoplastic	Low Damage	Completely Sealed	Chrysotile	1.5m ²	Easily disturbed	3	B - Remove	The grey floor tiles & bitumen adhesive contain asbestos fibres
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground	Warehouse G06, Flashguards to electrical boxes	S AE002579	Paper / Textiles	Low Damage	Surface Sealed	Chrysotile	Typical	Occasionally likely to be disturbed	5	B - Remove	Asbestos Flashguards - assume all fuse boxes to site have asbestos flashguards unless good reason is given to believe otherwise.
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground	Warehouse G06, Corrugated Cement Sheets to gable wall	S AE002580	Cement	Low Damage	Surface Sealed	Chrysotile	60m ²	Occasionally likely to be disturbed	4	B - Remove	Asbestos cement sheets to upper gable wall.
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground	Warehouse G06, Corrugated Cement Sheets to gable wall	SP As AE002580	Cement	Low Damage	Surface Sealed	Chrysotile	60m ²	Occasionally likely to be disturbed	4	B - Remove	Asbestos cement sheets to upper gable wall.
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground	Warehouse G06, Boarding to wall	S AE002581	Insulation board	Medium Damage	Unsealed	Chrysotile + Amosite	12m ²	Easily disturbed	8	B - Remove	Asbestos Insulation Board (AIB) to rear wall of warehouse (former roller shutter door)
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground	Plant Room G09, Flashguards	SP	Paper /	Low	Surface Sealed	Chrysotile	Typical	Occasionally likely to	5	B - Remove	Asbestos Flashguards -

Stone Close, West Drayton, UB7 8JU	to electrical boxes	As AE002579	Textiles	Damage							assume all fuse boxes to site have asbestos flashguards unless good reason is given to believe otherwise.
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground Parts Store G12, Cement Raingear to drain pipe	S AE002583	Cement	Low Damage	Surface Sealed	Chrysotile	Typical	Easily disturbed	4	B - Remove	N/A

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Appendix 1 - Asbestos Register (cont)



Building	Floor	Location /Room	S,P,SP,AS Sample No	Product Type	Condition	Surface Treatment	Asbestos Type	Quantity	Accessibility	Material Score	Recommendation	Additional Comments
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground	Parts Store G12, Boarding to columns	S AE002584	Insulation board	Low Damage	Surface Sealed	Chrysotile + Amosite	Typical	Easily disturbed	6	B - Remove	Asbestos Insulation Board clad to sides of two columns
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground	Store Room G15, Boarding to ceiling	SP As AE002581	Insulation board	Medium Damage	Unsealed	Chrysotile + Amosite	6m ²	Easily disturbed	8	B - Remove	Asbestos Insulation Board (AIB) to ceiling of store room
Unit 504, Stone Close, West Drayton, UB7 8JU	External	External Elevations E01, Corrugated Cement Sheets to gable wall	SP As AE002580	Cement	Low Damage	Surface Sealed	Chrysotile	60m ²	Occasionally likely to be disturbed	4	B - Remove	Asbestos cement sheets to upper gable wall.
Unit 504, Stone Close, West Drayton, UB7 8JU	External	External Elevations E01, Corrugated Cement Sheets to side walls	SP As AE002580	Cement	Low Damage	Surface Sealed	Chrysotile	Throughout	Occasionally likely to be disturbed	4	B - Remove	Asbestos cement sheets to upper side walls.
Unit 504, Stone Close, West Drayton, UB7 8JU	External	External Elevations E01, Cement Raingear to guttering	S AE002582	Cement	Low Damage	Surface Sealed	Chrysotile	Typical	Occasionally likely to be disturbed	4	B - Remove	Asbstos cement guttering
Unit 504, Stone Close, West Drayton, UB7 8JU	External	External Elevations E01, Corrugated Cement Sheets to office wall	SP As AE002580	Cement	Low Damage	Surface Sealed	Chrysotile	Typical	Occasionally likely to be disturbed	4	B - Remove	Asbestos cement sheets to upper office wall.
Unit 504, Stone Close, West Drayton, UB7 8JU	External	External Elevations E01, Corrugated Cement Sheets to gable wall	SP As AE002580	Cement	Low Damage	Surface Sealed	Chrysotile	60m ²	Occasionally likely to be disturbed	4	B - Remove	Asbestos cement sheets to upper gable wall.
Unit 504, Stone Close, West Drayton, UB7 8JU	External	External Elevations E01, Cement Raingear to guttering	SP As AE002582	Cement	Low Damage	Surface Sealed	Chrysotile	Typical	Occasionally likely to be disturbed	4	B - Remove	Asbstos cement guttering
Unit 504, Stone Close, West Drayton, UB7 8JU	External	External Elevations E01, Corrugated Cement Sheets to	SP As AE002582	Cement	Low Damage	Surface Sealed	Chrysotile	Throughout	Occasionally likely to be disturbed	4	B - Remove	Asbestos cement sheets to upper side walls

West Drayton, UB7 8JU	side wall	As AE002580	Cement	Low Damage	Surface Sealed	Chrysotile	Throughout	Occasionally likely to be disturbed	4	B - Remove	Asbestos cement sheets to former rollervshutter door access.
Unit 504, Stone Close, West Drayton, UB7 8JU	External External Elevations E01, Corrugated Cement Sheets to gable wall	SP As AE002580									

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Appendix 2 – Survey Data Sheets



Service Type	Refurbishment & Demolition survey		
Report Revision Number	1	Surveyors	Roy Pearce
TEAMS Job Number	J001057	Survey Date	11 Apr 2017
Site Address:	Unit 504 Stone Close Horton Road West Drayton UB7 8JU	Bulk Analysis Laboratory	Asbestos Laboratory Services
		Sample Analysis Date	12 Apr 2017

Survey Data Sheets



	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	Mezzanine	No Asbestos Detected (0)
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	Tea Point MZ01	Acoustic Pad to underside of sink unit	Typical	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	AE002585 (S)	Bituminous (1)	Completely Sealed (0)	Low Damage (1)	Easily disturbed
	Material Risk Score				
	N/A				
Recommended action	No further action required				
Surveyor comments	NON Asbestos acoustic pads to underside of sink unit				

	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	Mezzanine	N/A
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	Storage Area MZ02	No materials to the walls, flooring and ceiling of the storage area were suspected of containing asbestos.	N/A	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	Visual (P)	N/A	N/A	N/A	N/A
	Material Risk Score				
	N/A				
Recommended action	No further action required				
Surveyor comments	No Suspected Materials				

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Survey Data Sheets (cont)



	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	Mezzanine	N/A
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	Storage Area MZ02	Fibreboard Insulation Panels to ceiling	N/A	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	Visual (P)	N/A	N/A	N/A	N/A
	Material Risk Score				
N/A					
Recommended action	No further action required				
Surveyor comments	NON Asbestos fibreboard panels to ceiling of mezzanine floor.				

	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	1st Floor	No Asbestos Detected (0)
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	Toilet 101	Beige Vinyl Flooring under modern vinyl	6m²	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	AE002573 (S)	Vinyl floor tiles (1)	Completely Sealed (0)	Low Damage (1)	Easily disturbed
	Material Risk Score				
N/A					
No further action required					
Recommended action	NON Asbestos beige vinyl flooring				
Surveyor comments					


KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Survey Data Sheets (cont)



	Survey Date:	11 Apr 2017	Lead Surveyor	Roy Pearce	Survey Type	Refurbishment & Demolition survey	Floor	1st Floor	Analysis	No Asbestos Detected (0)
	Building		Room		Item		Quantity			
	Unit 504, Stone Close, West Drayton, UB7 8JU		Office 102		Beige Vinyl Flooring under carpet		12m²			
	Sample No (S,SP,P,As)		Product Type		Surface Treatment		Condition		Accessibility	
	As AE002573 (SP)		Vinyl floor tiles (1)		Completely Sealed (0)		Low Damage (1)		Easily disturbed	
	Material Risk Score									
	N/A									
Recommended action	No further action required									
Surveyor comments	NON Asbestos beige vinyl flooring									

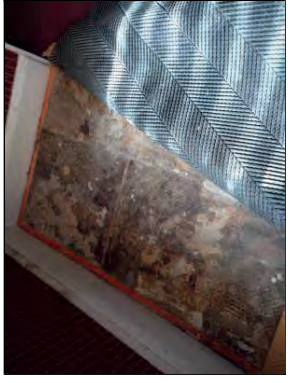	Survey Date:	11 Apr 2017	Lead Surveyor	Roy Pearce	Survey Type	Refurbishment & Demolition survey	Floor	1st Floor	Analysis	No Asbestos Detected (0)
	Building		Room		Item		Quantity			
	Unit 504, Stone Close, West Drayton, UB7 8JU		Office 103		Bitumen Adhesive under carpet		40m²			
	Sample No (S,SP,P,As)		Product Type		Surface Treatment		Condition		Accessibility	
	AE002574 (S)		Bituminous (1)		Completely Sealed (0)		Low Damage (1)		Easily disturbed	
	Material Risk Score									
	N/A									
Recommended action	No further action required									
Surveyor comments	NON Asbestos bitumen adhesive									

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Survey Data Sheets (cont)



	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	1st Floor	No Asbestos Detected (0)
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	Office 103	Acoustic Pad to underside of sink unit	Typical	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	AE002575 (S)	Bituminous (1)	Completely Sealed (0)	Low Damage (1)	Occasionally likely to be disturbed
	Material Risk Score				
N/A					
No further action required					
NON Asbestos acoustic pads to underside of sink unit					
Recommended action					
Surveyor comments					

	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	1st Floor	No Asbestos Detected (0)
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	Stairwell and Landing 104	Bitumen adhesive under carpet	2m ²	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	As AE002574 (SP)	Bituminous (1)	Completely Sealed (0)	Low Damage (1)	Easily disturbed
	Material Risk Score				
N/A					
No further action required					
NON Asbestos bitumen adhesive					
Recommended action					
Surveyor comments					

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Survey Data Sheets (cont)



	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	1st Floor	Chrysotile (1)
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	Stairwell and Landing 104	Grey Floor Tiles to steps	12m ²	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	AE002576 (S)	Thermoplastic (1)	Completely Sealed (0)	Low Damage (1)	Occasionally likely to be disturbed
	Material Risk Score				
3					
B - Remove					
Asbestos grey floor tiles to steps (under carpet) to stairwell					
Recommended action					
Surveyor comments					

	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	Ground Floor	Amosite (2)
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	Toilet G01	Cistern to wall	1no.	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	AE002577 (S)	Reinforced Composite (1)	Completely Sealed (0)	Low Damage (1)	Easily disturbed
	Material Risk Score				
4					
B - Remove					
Asbestos toilet cistern					
Recommended action					
Surveyor comments					

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Survey Data Sheets (cont)



	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	Ground Floor	Chrysotile (1)
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	Office G02	Grey Floor Tiles and Bitumen Adhesive. under carpet	40m²	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	AE002578 (S)	Thermoplastic (1)	Completely Sealed (0)	Low Damage (1)	Easily disturbed
	Material Risk Score				
	3				
Recommended action	B - Remove				
Surveyor comments	The grey floor tiles & bitumen adhesive contain asbestos fibres				



	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	Ground Floor	N/A
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	Understair Cupboard G03	No materials to the understair cupboard were suspected of containing asbestos	N/A	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	Visual (P)	N/A	N/A	N/A	N/A
	Material Risk Score				
N/A					
Recommended action	No further action required				
Surveyor comments	No Suspected Materials				


KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Survey Data Sheets (cont)



	Survey Date:	11 Apr 2017	Lead Surveyor	Roy Pearce	Survey Type	Refurbishment & Demolition survey	Floor	Ground Floor	Analysis
	Building	Unit 504, Stone Close, West Drayton, UB7 8JU	Room	Stair Lobby G04	Item	Grey Floor Tiles and Bitumen Adhesive under carpet	Quantity	1.5m ²	Chrysotile (1)
	Sample No (S,SP,P,As)		Product Type		Surface Treatment		Condition		Accessibility
	As AE002578 (SP)		Thermoplastic (1)		Completely Sealed (0)		Low Damage (1)		Easily disturbed
	Material Risk Score								
		3							
	Recommended action	B - Remove							
Surveyor comments		The grey floor tiles & bitumen adhesive contain asbestos fibres							

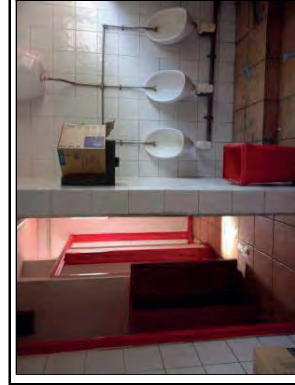

	Survey Date:	11 Apr 2017	Lead Surveyor	Roy Pearce	Survey Type	Refurbishment & Demolition survey	Floor	Ground Floor	Analysis
	Building	Unit 504, Stone Close, West Drayton, UB7 8JU	Room	Toilets G05	Item	No materials to the walls, flooring and ceiling of the toilets were suspected of containing asbestos	Quantity	N/A	N/A
	Sample No (S,SP,P,As)		Product Type		Surface Treatment		Condition		Accessibility
	Visual (P)		N/A		N/A		N/A		N/A
	Material Risk Score								
		N/A							
	Recommended action	No further action required							
Surveyor comments		No Suspected Materials							

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Survey Data Sheets (cont)



	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	Ground Floor	Chrysotile (1)
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	Warehouse G06	Flashguards to electrical boxes	Typical	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	AE002579 (S)	Paper / Textiles (2)	Surface Sealed (1)	Low Damage (1)	Occasionally likely to be disturbed
	Material Risk Score				
5					
B - Remove					
Asbestos Flashguards - assume all fuse boxes to site have asbestos flashguards unless good reason is given to believe otherwise.					
Recommended action					
Surveyor comments					

	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	Ground Floor	Chrysotile (1)
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	Warehouse G06	Corrugated Cement Sheets to gable wall	60m²	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	As AE002580 (SP)	Cement (1)	Surface Sealed (1)	Low Damage (1)	Occasionally likely to be disturbed
	Material Risk Score				
4					
B - Remove					
Asbestos cement sheets to upper gable wall.					
Recommended action					
Surveyor comments					

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Survey Data Sheets (cont)



	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	Ground Floor	Chrysotile + Amosite (2)
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	Warehouse G06	Boarding to wall	12m ²	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	AE002581 (S)	Insulation board (2)	Unsealed (2)	Medium Damage (2)	Easily disturbed
	Material Risk Score				
	8				
Recommended action	B - Remove				
Surveyor comments	Asbestos Insulation Board (AIB) to rear wall of warehouse (former roller shutter door)				

	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	Ground Floor	Chrysotile (1)
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	Warehouse G06	Corrugated Cement Sheets to gable wall	60m ²	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	AE002580 (S)	Cement (1)	Surface Sealed (1)	Low Damage (1)	Occasionally likely to be disturbed
	Material Risk Score				
	4				
Recommended action	B - Remove				
Surveyor comments	Asbestos cement sheets to upper gable wall.				

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Survey Data Sheets (cont)



	Survey Date:	11 Apr 2017	Lead Surveyor	Roy Pearce	Survey Type	Refurbishment & Demolition survey	Floor	Ground Floor	Analysis	N/A
	Building	Unit 504, Stone Close, West Drayton, UB7 8JU	Room	Warehouse G06	Item	Fibreboard Panels to ceiling	Quantity	N/A		
	Sample No (S,SP,P,As)		Product Type		Surface Treatment		Condition		Accessibility	
	Visual (P)		N/A		N/A		N/A		N/A	
	Material Risk Score									
	N/A									
	Recommended action	No further action required								
Surveyor comments		NON Asbestos fibreboard andvstrammit board panels to ceiling of warehouse.								

	Survey Date:	11 Apr 2017	Lead Surveyor	Roy Pearce	Survey Type	Refurbishment & Demolition survey	Floor	Ground Floor	Analysis	No Asbestos Detected (0)
	Building	Unit 504, Stone Close, West Drayton, UB7 8JU	Room	Warehouse G06	Item	Gaskets to industrial heater unit	Quantity	Typical		
	Sample No (S,SP,P,As)		Product Type		Surface Treatment		Condition		Accessibility	
	AE002587 (S)		Gasket (2)		Surface Sealed (1)		Low Damage (1)		Occasionally likely to be disturbed	
	Material Risk Score									
	N/A									
	Recommended action	No further action required								
Surveyor comments		NON Asbestos gaskets to heater unit								


KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Survey Data Sheets (cont)



	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	Ground Floor	N/A
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	Spray Booth G07	No materials to the ventilation duct work for the spray booths were suspected of containing asbestos	N/A	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	Visual (P)	N/A	N/A	N/A	N/A
	Material Risk Score				
	N/A				
Recommended action	No further action required				
Surveyor comments	No Suspected Materials				

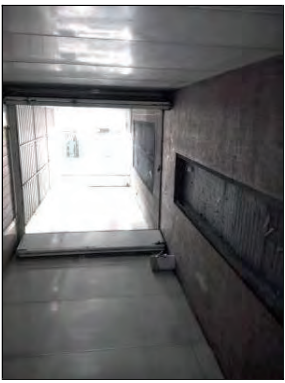
	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	Ground Floor	N/A
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	Spray Booth G07	No materials to the walls, flooring and ceiling of the spray booth were suspected of containing asbestos	N/A	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	Visual (P)	N/A	N/A	N/A	N/A
	Material Risk Score				
	N/A				
Recommended action	No further action required				
Surveyor comments	No Suspected Materials				

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Survey Data Sheets (cont)

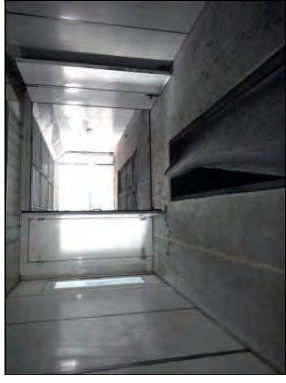

	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	Ground Floor	N/A
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	Spray Booth G08	No materials to the walls, flooring and ceiling of the spray booth were suspected of containing asbestos	N/A	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	Visual (P)	N/A	N/A	N/A	N/A
	Material Risk Score				
	N/A				
Recommended action	No further action required				
Surveyor comments	No Suspected Materials				

	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	Ground Floor	Chrysotile (1)
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	Plant Room G09	Flashguards to electrical boxes	Typical	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	As AE002579 (SP)	Paper / Textiles (2)	Surface Sealed (1)	Low Damage (1)	Occasionally likely to be disturbed
	Material Risk Score				
	5				
Recommended action	B - Remove				
Surveyor comments	Asbestos Flashguards - assume all fuse boxes to site have asbestos flashguards unless good reason is given to believe otherwise.				

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Survey Data Sheets (cont)



	Survey Date:	11 Apr 2017	Lead Surveyor	Roy Pearce	Survey Type	Refurbishment & Demolition survey	Floor	Ground Floor	Analysis
	Building	Unit 504, Stone Close, West Drayton, UB7 8JU	Room	Wash Bay G10	Item	No materials to the wash bay were suspected of containing asbestos	Quantity	N/A	N/A
	Sample No (S,SP,P,As)		Product Type		Surface Treatment		Condition		Accessibility
	Visual (P)		N/A		N/A		N/A		N/A
	Material Risk Score								
	N/A								
	Recommended action	No further action required							
Surveyor comments		No Suspected Materials							

	Survey Date:	11 Apr 2017	Lead Surveyor	Roy Pearce	Survey Type	Refurbishment & Demolition survey	Floor	Ground Floor	Analysis
	Building	Unit 504, Stone Close, West Drayton, UB7 8JU	Room	Spray Booth G11	Item	No materials to the walls, flooring and ceiling of the spray booth were suspected of containing asbestos	Quantity	N/A	N/A
	Sample No (S,SP,P,As)		Product Type		Surface Treatment		Condition		Accessibility
	Visual (P)		N/A		N/A		N/A		N/A
	Material Risk Score								
	N/A								
	Recommended action	No further action required							
Surveyor comments		No Suspected Materials							

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Survey Data Sheets (cont)



	Survey Date:	11 Apr 2017	Lead Surveyor	Roy Pearce	Survey Type	Refurbishment & Demolition survey	Floor	Ground Floor	Analysis	Chrysotile (1)
	Building		Room		Item		Quantity			
	Unit 504, Stone Close, West Drayton, UB7 8JU		Parts Store G12		Cement Raingear to drain pipe		Typical			
	Sample No (S,SP,P,As)		Product Type		Surface Treatment		Condition		Accessibility	
	AE002583 (S)		Cement (1)		Surface Sealed (1)		Low Damage (1)		Easily disturbed	
	Material Risk Score									
	4									
Recommended action	B - Remove									
Surveyor comments	N/A									


	Survey Date:	11 Apr 2017	Lead Surveyor	Roy Pearce	Survey Type	Refurbishment & Demolition survey	Floor	Ground Floor	Analysis	Chrysotile + Amosite (2)
	Building		Room		Item		Quantity			
	Unit 504, Stone Close, West Drayton, UB7 8JU		Parts Store G12		Boarding to columns		Typical			
	Sample No (S,SP,P,As)		Product Type		Surface Treatment		Condition		Accessibility	
	AE002584 (S)		Insulation board (2)		Surface Sealed (1)		Low Damage (1)		Easily disturbed	
	Material Risk Score									
	6									
Recommended action	B - Remove									
Surveyor comments	Asbestos Insulation Board clad to sides of two columns									

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Survey Data Sheets (cont)

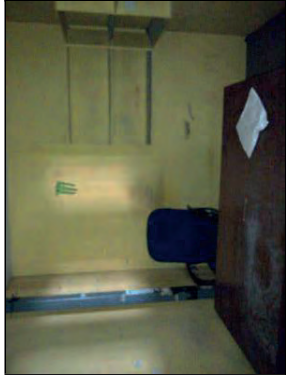

	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	Ground Floor	N/A
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	Office G13	No materials to the walls, flooring and ceiling of the parts store office were suspected of containing asbestos	N/A	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	Visual (P)	N/A	N/A	N/A	N/A
	Material Risk Score				
	N/A				
Recommended action	No further action required				
Surveyor comments	No Suspected Materials				

	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	Ground Floor	N/A
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	Paint Store G14	No materials to the walls, flooring and ceiling of the paint store were suspected of containing asbestos	N/A	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	Visual (P)	N/A	N/A	N/A	N/A
	Material Risk Score				
	N/A				
Recommended action	No further action required				
Surveyor comments	No Suspected Materials				


KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Survey Data Sheets (cont)



	Survey Date:	11 Apr 2017	Lead Surveyor	Roy Pearce	Survey Type	Refurbishment & Demolition survey	Floor	Ground Floor	Analysis	Chrysotile + Amosite (2)
	Building	Unit 504, Stone Close, West Drayton, UB7 8JU	Room	Store Room G15	Item	Boarding to ceiling	Quantity	6m ²		
	Sample No (S,SP,P,As)		Product Type		Surface Treatment		Condition		Accessibility	
	As AE002581 (SP)		Insulation board (2)		Unsealed (2)		Medium Damage (2)		Easily disturbed	
	Material Risk Score									
	8									
	B - Remove									
Recommended action										
Surveyor comments	Asbestos Insulation Board (AIB) to ceiling of store room									

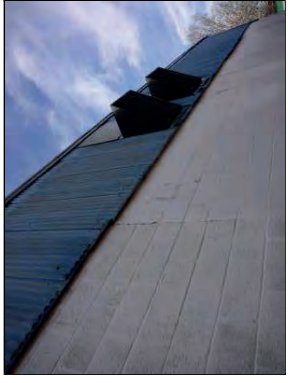	Survey Date:	11 Apr 2017	Lead Surveyor	Roy Pearce	Survey Type	Refurbishment & Demolition survey	Floor	External	Analysis	Chrysotile (1)
	Building	Unit 504, Stone Close, West Drayton, UB7 8JU	Room	External Elevations E01	Item	Corrugated Cement Sheets to gable wall	Quantity	60m ²		
	Sample No (S,SP,P,As)		Product Type		Surface Treatment		Condition		Accessibility	
	As AE002580 (SP)		Cement (1)		Surface Sealed (1)		Low Damage (1)		Occasionally likely to be disturbed	
	Material Risk Score									
	4									
	B - Remove									
Recommended action										
Surveyor comments	Asbestos cement sheets to upper gable wall.									


KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Survey Data Sheets (cont)



	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	External	Chrysotile (1)
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	External Elevations E01	Corrugated Cement Sheets to side walls	Throughout	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	As AE002580 (SP)	Cement (1)	Surface Sealed (1)	Low Damage (1)	Occasionally likely to be disturbed
	Material Risk Score				
4					
B - Remove					
Asbestos cement sheets to upper side walls.					
Recommended action					
Surveyor comments					

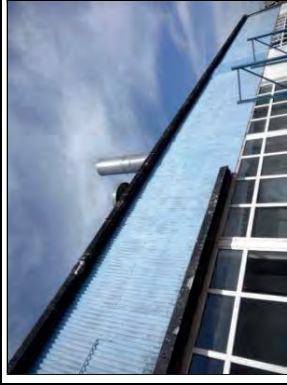	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	External	Chrysotile (1)
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	External Elevations E01	Cement Raingear to guttering	Typical	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	AE002582 (S)	Cement (1)	Surface Sealed (1)	Low Damage (1)	Occasionally likely to be disturbed
	Material Risk Score				
4					
B - Remove					
Asbestos cement guttering					
Recommended action					
Surveyor comments					

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Survey Data Sheets (cont)



	Survey Date:	11 Apr 2017	Lead Surveyor	Roy Pearce	Survey Type	Refurbishment & Demolition survey	Floor	External	Analysis	Chrysotile (1)
	Building		Room		Item		Quantity			
	Unit 504, Stone Close, West Drayton, UB7 8JU		External Elevations E01		Corrugated Cement Sheets to office wall		Typical			
	Sample No (S,SP,P,As)		Product Type		Surface Treatment		Condition		Accessibility	
	As AE002580 (SP)		Cement (1)		Surface Sealed (1)		Low Damage (1)		Occasionally likely to be disturbed	
	Material Risk Score									
	4									
Recommended action	B - Remove									
Surveyor comments	Asbestos cement sheets to upper office wall.									


	Survey Date:	11 Apr 2017	Lead Surveyor	Roy Pearce	Survey Type	Refurbishment & Demolition survey	Floor	External	Analysis	Chrysotile (1)
	Building		Room		Item		Quantity			
	Unit 504, Stone Close, West Drayton, UB7 8JU		External Elevations E01		Corrugated Cement Sheets to gable wall		60m²			
	Sample No (S,SP,P,As)		Product Type		Surface Treatment		Condition		Accessibility	
	As AE002580 (SP)		Cement (1)		Surface Sealed (1)		Low Damage (1)		Occasionally likely to be disturbed	
	Material Risk Score									
	4									
Recommended action	B - Remove									
Surveyor comments	Asbestos cement sheets to upper gable wall.									


KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Survey Data Sheets (cont)

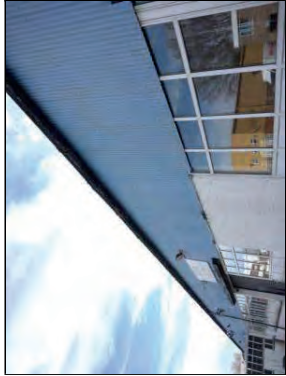

	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	External	Chrysotile (1)
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	External Elevations E01	Cement Raingear to guttering	Typical	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	As AE002582 (SP)	Cement (1)	Surface Sealed (1)	Low Damage (1)	Occasionally likely to be disturbed
	Material Risk Score				
4					
B - Remove					
Asbestos cement guttering					
Recommended action					
Surveyor comments					

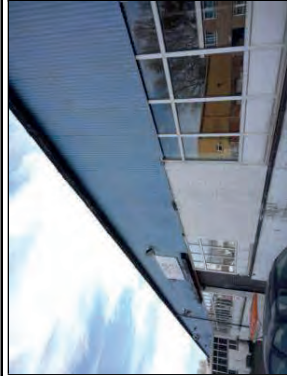	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	External	Chrysotile (1)
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	External Elevations E01	Corrugated Cement Sheets to side wall	Throughout	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	As AE002580 (SP)	Cement (1)	Surface Sealed (1)	Low Damage (1)	Occasionally likely to be disturbed
	Material Risk Score				
4					
B - Remove					
Asbestos cement sheets to upper side walls					
Recommended action					
Surveyor comments					

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Survey Data Sheets (cont)



	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	External	Chrysotile (1)
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	External Elevations E01	Corrugated Cement Sheets to gable wall	Throughout	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	As AE002580 (SP)	Cement (1)	Surface Sealed (1)	Low Damage (1)	Occasionally likely to be disturbed
	Material Risk Score				
	4				
Recommended action	B - Remove				
Surveyor comments	Asbestos cement sheets to former rollervshutter door access.				

	Survey Date:	Lead Surveyor	Survey Type	Floor	Analysis
	11 Apr 2017	Roy Pearce	Refurbishment & Demolition survey	External	No Asbestos Detected (0)
	Building	Room	Item	Quantity	
	Unit 504, Stone Close, West Drayton, UB7 8JU	Flat Roofed Areas E02	Bitumen Felt. to flat roof	Throughout	
	Sample No (S,SP,P,As)	Product Type	Surface Treatment	Condition	Accessibility
	AE002586 (S)	Bituminous (1)	Completely Sealed (0)	Low Damage (1)	Usually inaccessible or unlikely to be disturbed
	Material Risk Score				
	N/A				
Recommended action	No further action required				
Surveyor comments	NON Asbestos bitumen roof felt				

KEY:

S – Sampled, P – Presumed, SP – Strongly Presumed, AS – Cross reference to former sample

Appendix 3 - Areas Surveyed



Building	Floor	Room No:	Room Type	Item
Unit 504, Stone Close, West Drayton, UB7 8JU	Mezzanine	MZ01	Tea Point	Sample taken
Unit 504, Stone Close, West Drayton, UB7 8JU	Mezzanine	MZ02	Storage Area	No Suspected Materials
Unit 504, Stone Close, West Drayton, UB7 8JU	1st Floor	101	Toilet	Sample taken
Unit 504, Stone Close, West Drayton, UB7 8JU	1st Floor	102	Office	Sample taken
Unit 504, Stone Close, West Drayton, UB7 8JU	1st Floor	103	Office	Sample taken
Unit 504, Stone Close, West Drayton, UB7 8JU	1st Floor	104	Stairwell and Landing	Samples Taken
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground Floor	G01	Toilet	Sample taken
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground Floor	G02	Office	Sample taken
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground Floor	G03	Understair Cupboard	No Suspected Materials
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground Floor	G04	Stair Lobby	Sample taken

Close, West Drayton, UB7 8JU						
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground Floor	G05	Toilets	No Suspected Materials		
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground Floor	G06	Warehouse	Samples Taken		
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground Floor	G07	Spray Booth	No Suspected Materials		
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground Floor	G08	Spray Booth	No Suspected Materials		
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground Floor	G09	Plant Room	Sample taken		

Appendix 3 - Areas Surveyed (cont)



Building	Floor	Room No:	Room Type	Item
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground Floor	G10	Wash Bay	No Suspected Materials
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground Floor	G11	Spray Booth	No Suspected Materials
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground Floor	G12	Parts Store	Sample taken
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground Floor	G13	Office	No Suspected Materials
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground Floor	G14	Paint Store	No Suspected Materials
Unit 504, Stone Close, West Drayton, UB7 8JU	Ground Floor	G15	Store Room	Sample taken
Unit 504, Stone Close, West Drayton, UB7 8JU	External	E01	External Elevations	Samples Taken
Unit 504, Stone Close, West Drayton, UB7 8JU	External	E02	Flat Roofed Areas	Sample Taken

Appendix 4 – Sample Certificates



Unit C7
New Yatt Business Centre
New Yatt
Nr Witney
Oxfordshire, OX29 6TJ

Tel: 01993 868636
Fax: 01993 869080
www.asbestoslabs.co.uk



CERTIFICATE OF ANALYSIS FOR ASBESTOS FIBRES

Report Number: ALS/J018052

Client	Amiantus (Oxford)	Attention	Roy Pearce
Client Address	Unit C7, New Yatt Business Centre, New Yatt, Nr Witney, Oxfordshire, OX29 6TJ		
Site Address	Unit 504, Stone Close, Horton Road, West Drayton, UB7 8JU		
Site Ref	J001057	No. of Samples	15

Date Received	12/04/2017	Date of Analysis	12/04/2017	Report Issue Date	12/04/2017
----------------------	------------	-------------------------	------------	--------------------------	------------

Samples of material(s) [detailed below] have been examined to determine the presence of asbestos fibres, using Polarised Light Microscopy together with dispersion staining based on the HSE's guidance document HSG248 and Asbestos Laboratory Services documented method. If samples have been delivered to the laboratory, the site address and sample location is reported as provided by the client. Asbestos Laboratory Services are not responsible for the accuracy or competence of the sampling by third parties. Under these circumstances Asbestos Laboratory Services cannot be held responsible for the interpretation of the results shown. Opinions and interpretations are outside the scope of the UKAS accreditation. All entries under 'Fibre Type Detected' that contain (*) indicate that the sample was found to be deviating from policies defined in document TPS63 (UKAS Policy on Deviating Samples).

As a result, the test result(s) may be invalid.
The Determination of Asbestos Content Report shall not be reproduced except in full, without written approval of the laboratory'.
(V2), or subsequent "V" numbers, after the report number signifies that the original certificate (or previous amended certificate) has been replaced.

Lab Ref.	Client Sample Number	Sample Location	Sample Description	Fibre Type Detected
BS083384	AE002573	1st Floor, Toilet, under modern vinyl	Beige Vinyl Flooring	N.A.D.I.S
BS083385	AE002574	1st Floor, Office, under carpet	Bitumen Adhesive	N.A.D.I.S
BS083386	AE002575	1st Floor, Office, to underside of sink unit	Acoustic Pad	N.A.D.I.S
BS083387	AE002576	1st Floor, Stairwell and Landing, to steps	Grey Floor Tiles	Chrysotile
BS083388	AE002577	Ground Floor, Toilet, to wall	Cistern	Amosite
BS083389	AE002578	Ground Floor, Office, under carpet	Grey Floor Tiles and Bitumen Adhesive.	Chrysotile

KEY

NADIS - No Asbestos Detected in Sample

Note: All samples will be retained for a minimum of six months.

Analysed By	Jack Wood
Analyst Signatory	

Approved By	Wai-fung Kuet
Approver Signatory	

ALS14A

Page 1 of 3

Issue Date: 21/11/2014

Issued by: Quality Manager

Issue No. 3

Unit C7
New Yatt Business Centre
New Yatt
Nr Witney
Oxfordshire, OX29 6TJ

Tel: 01993 868636
Fax: 01993 869080
www.asbestoslabs.co.uk



CERTIFICATE OF ANALYSIS FOR ASBESTOS FIBRES

Report Number: ALS/J018052

Client	Amiantus (Oxford)	Attention	Roy Pearce
Client Address	Unit C7, New Yatt Business Centre, New Yatt, Nr Witney, Oxfordshire, OX29 6TJ		
Site Address	Unit 504, Stone Close, Horton Road, West Drayton, UB7 8JU		
Site Ref	J001057	No. of Samples	15

Date Received	12/04/2017	Date of Analysis	12/04/2017	Report Issue Date	12/04/2017
----------------------	------------	-------------------------	------------	--------------------------	------------

Samples of material(s) [detailed below] have been examined to determine the presence of asbestos fibres, using Polarised Light Microscopy together with dispersion staining based on the HSE's guidance document HSG248 and Asbestos Laboratory Services documented method. If samples have been delivered to the laboratory, the site address and sample location is reported as provided by the client. Asbestos Laboratory Services are not responsible for the accuracy or competence of the sampling by third parties. Under these circumstances Asbestos Laboratory Services cannot be held responsible for the interpretation of the results shown. Opinions and interpretations are outside the scope of the UKAS accreditation. All entries under 'Fibre Type Detected' that contain (*) indicate that the sample was found to be deviating from policies defined in document TPS63 (UKAS Policy on Deviating Samples).

As a result, the test result(s) may be invalid.
The Determination of Asbestos Content Report shall not be reproduced except in full, without written approval of the laboratory.
(V2), or subsequent "V" numbers, after the report number signifies that the original certificate (or previous amended certificate) has been replaced.

Lab Ref.	Client Sample Number	Sample Location	Sample Description	Fibre Type Detected
BS083390	AE002579	Ground Floor, Warehouse, to electrical boxes	Flashguards	Chrysotile
BS083391	AE002580	Ground Floor, Warehouse, to gable wall	Corrugated Cement Sheets	Chrysotile
BS083392	AE002581	Ground Floor, Warehouse, to wall	Boarding	Chrysotile + Amosite
BS083393	AE002582	External, External Elevations, to guttering	Cement Raingear	Chrysotile
BS083394	AE002583	Ground Floor, Parts Store, to drain pipe	Cement Raingear	Chrysotile
BS083395	AE002584	Ground Floor, Parts Store, to columns	Boarding	Chrysotile + Amosite

KEY

NADIS - No Asbestos Detected in Sample

Note: All samples will be retained for a minimum of six months.

Analysed By	Jack Wood
Analyst Signatory	

Approved By	Wai-fung Kuet
Approver Signatory	

ALS14A

Page 2 of 3

Issue Date: 21/11/2014

Issued by: Quality Manager

Issue No. 3

Unit C7
New Yatt Business Centre
New Yatt
Nr Witney
Oxfordshire, OX29 6TJ

Tel: 01993 868636
Fax: 01993 869080
www.asbestoslabs.co.uk



CERTIFICATE OF ANALYSIS FOR ASBESTOS FIBRES

Report Number: ALS/J018052

Client	Amiantus (Oxford)	Attention	Roy Pearce
Client Address	Unit C7, New Yatt Business Centre, New Yatt, Nr Witney, Oxfordshire, OX29 6TJ		
Site Address	Unit 504, Stone Close, Horton Road, West Drayton, UB7 8JU		
Site Ref	J001057	No. of Samples	15

Date Received	12/04/2017	Date of Analysis	12/04/2017	Report Issue Date	12/04/2017
----------------------	------------	-------------------------	------------	--------------------------	------------

Samples of material(s) [detailed below] have been examined to determine the presence of asbestos fibres, using Polarised Light Microscopy together with dispersion staining based on the HSE's guidance document HSG248 and Asbestos Laboratory Services documented method. If samples have been delivered to the laboratory, the site address and sample location is reported as provided by the client. Asbestos Laboratory Services are not responsible for the accuracy or competence of the sampling by third parties. Under these circumstances Asbestos Laboratory Services cannot be held responsible for the interpretation of the results shown. Opinions and interpretations are outside the scope of the UKAS accreditation. All entries under 'Fibre Type Detected' that contain (*) indicate that the sample was found to be deviating from policies defined in document TPS63 (UKAS Policy on Deviating Samples).

As a result, the test result(s) may be invalid.

The Determination of Asbestos Content Report shall not be reproduced except in full, without written approval of the laboratory'.
(V2), or subsequent "V" numbers, after the report number signifies that the original certificate (or previous amended certificate) has been replaced.

Lab Ref.	Client Sample Number	Sample Location	Sample Description	Fibre Type Detected
BS083396	AE002585	Mezzanine, Tea Point, to underside of sink unit	Acoustic Pad	N.A.D.I.S
BS083397	AE002586	External, Flat Roofed Areas, to flat roof	Bitumen Felt.	N.A.D.I.S
BS083398	AE002587	Ground Floor, Warehouse, to industrial heater unit	Gaskets	N.A.D.I.S

KEY

NADIS - No Asbestos Detected in Sample

Note: All samples will be retained for a minimum of six months.

Analysed By	Jack Wood
Analyst Signatory	

Approved By	Wai-fung Kuet
Approver Signatory	

ALS14A

Page 3 of 3


Issue Date: 21/11/2014

Issued by: Quality Manager


Issue No. 3


Appendix 5 – Plans



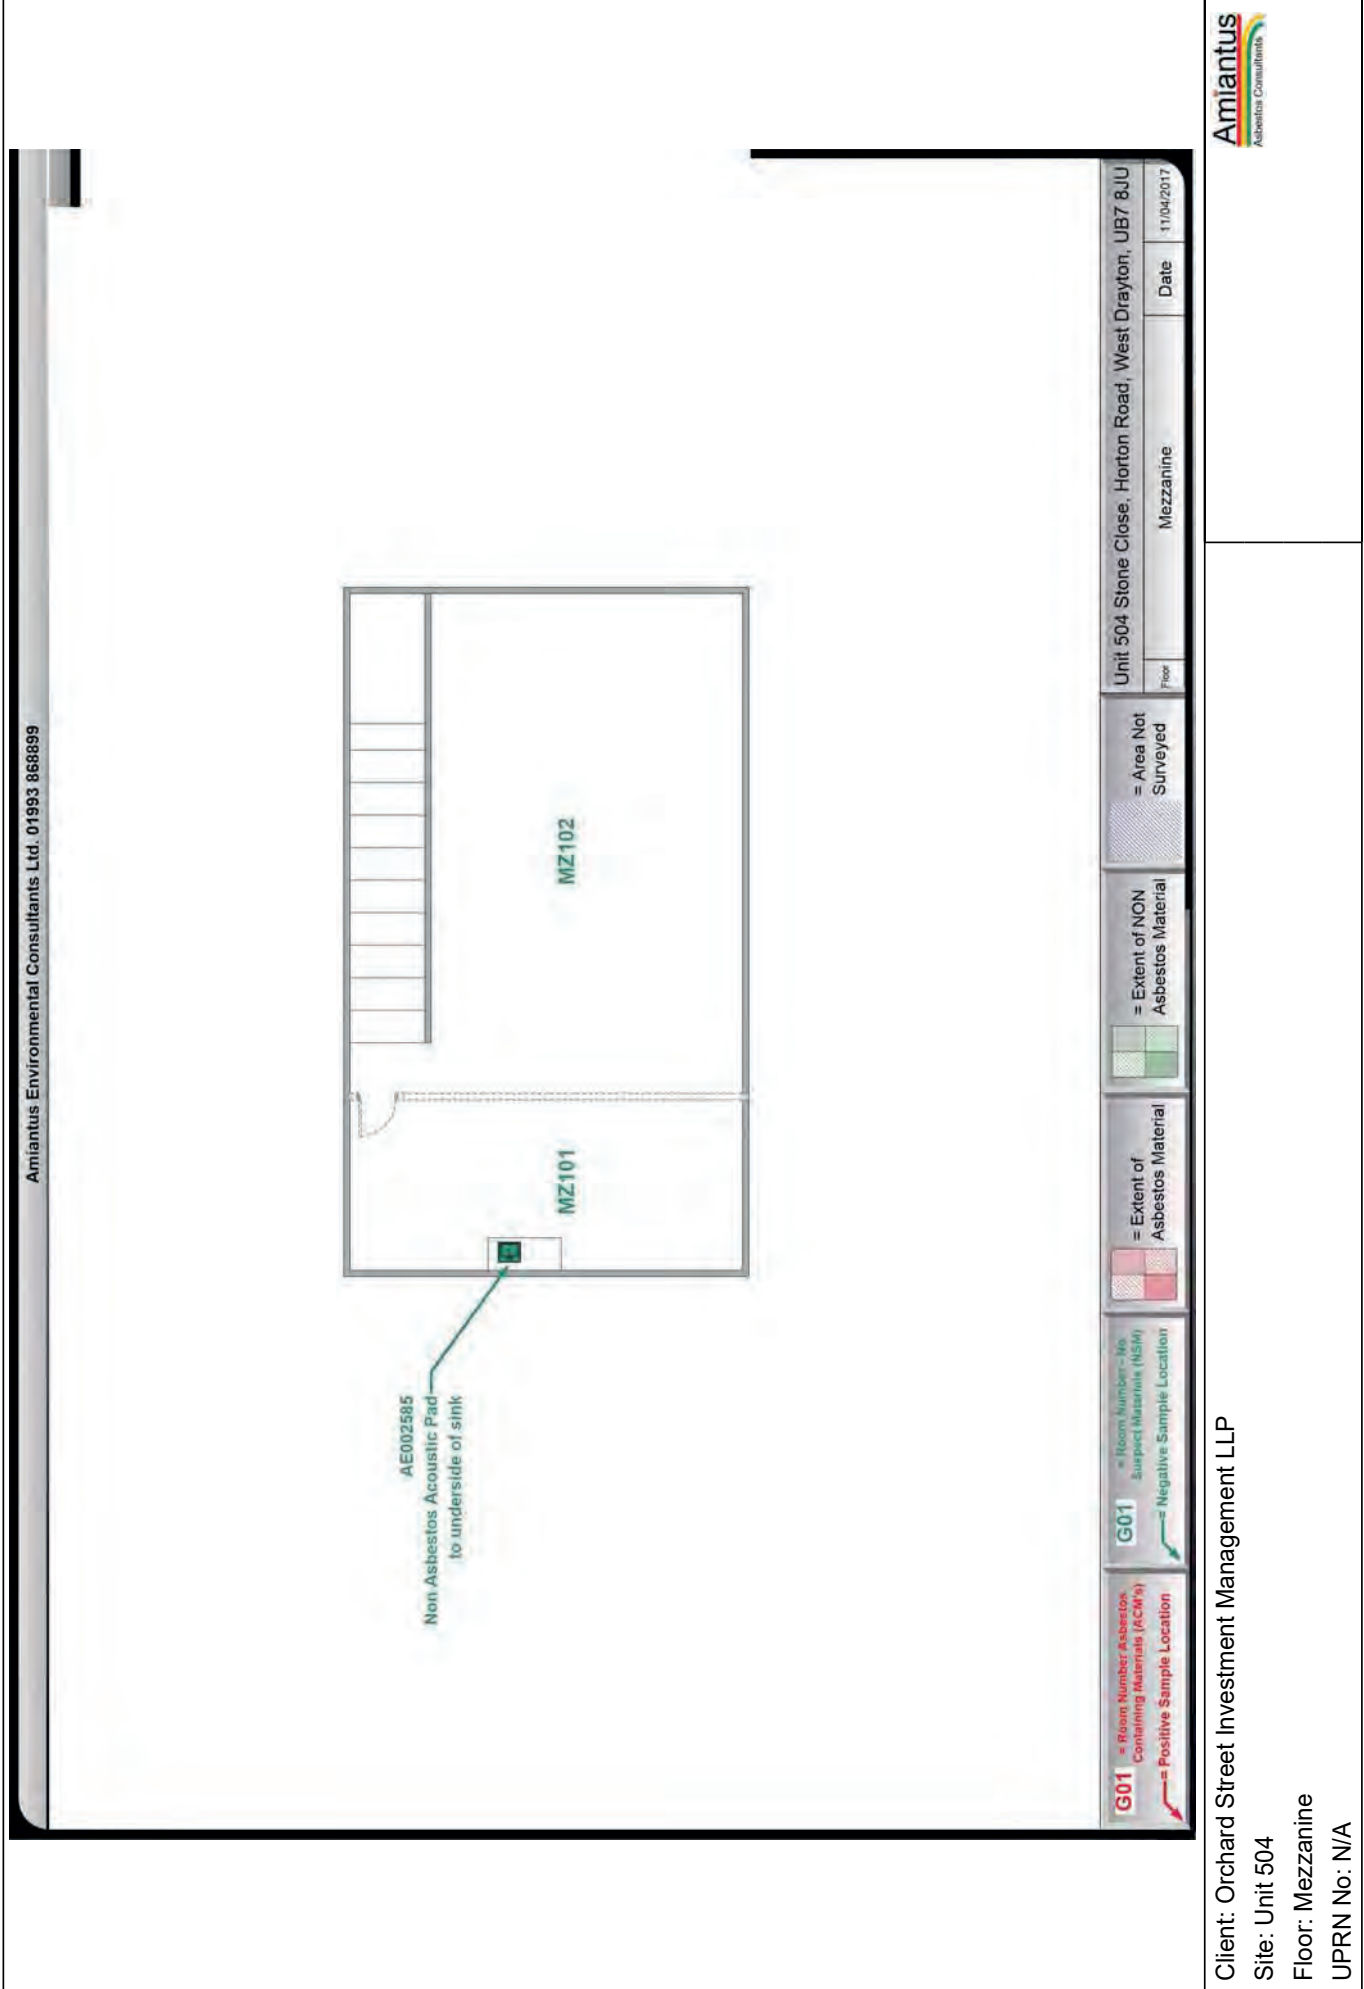



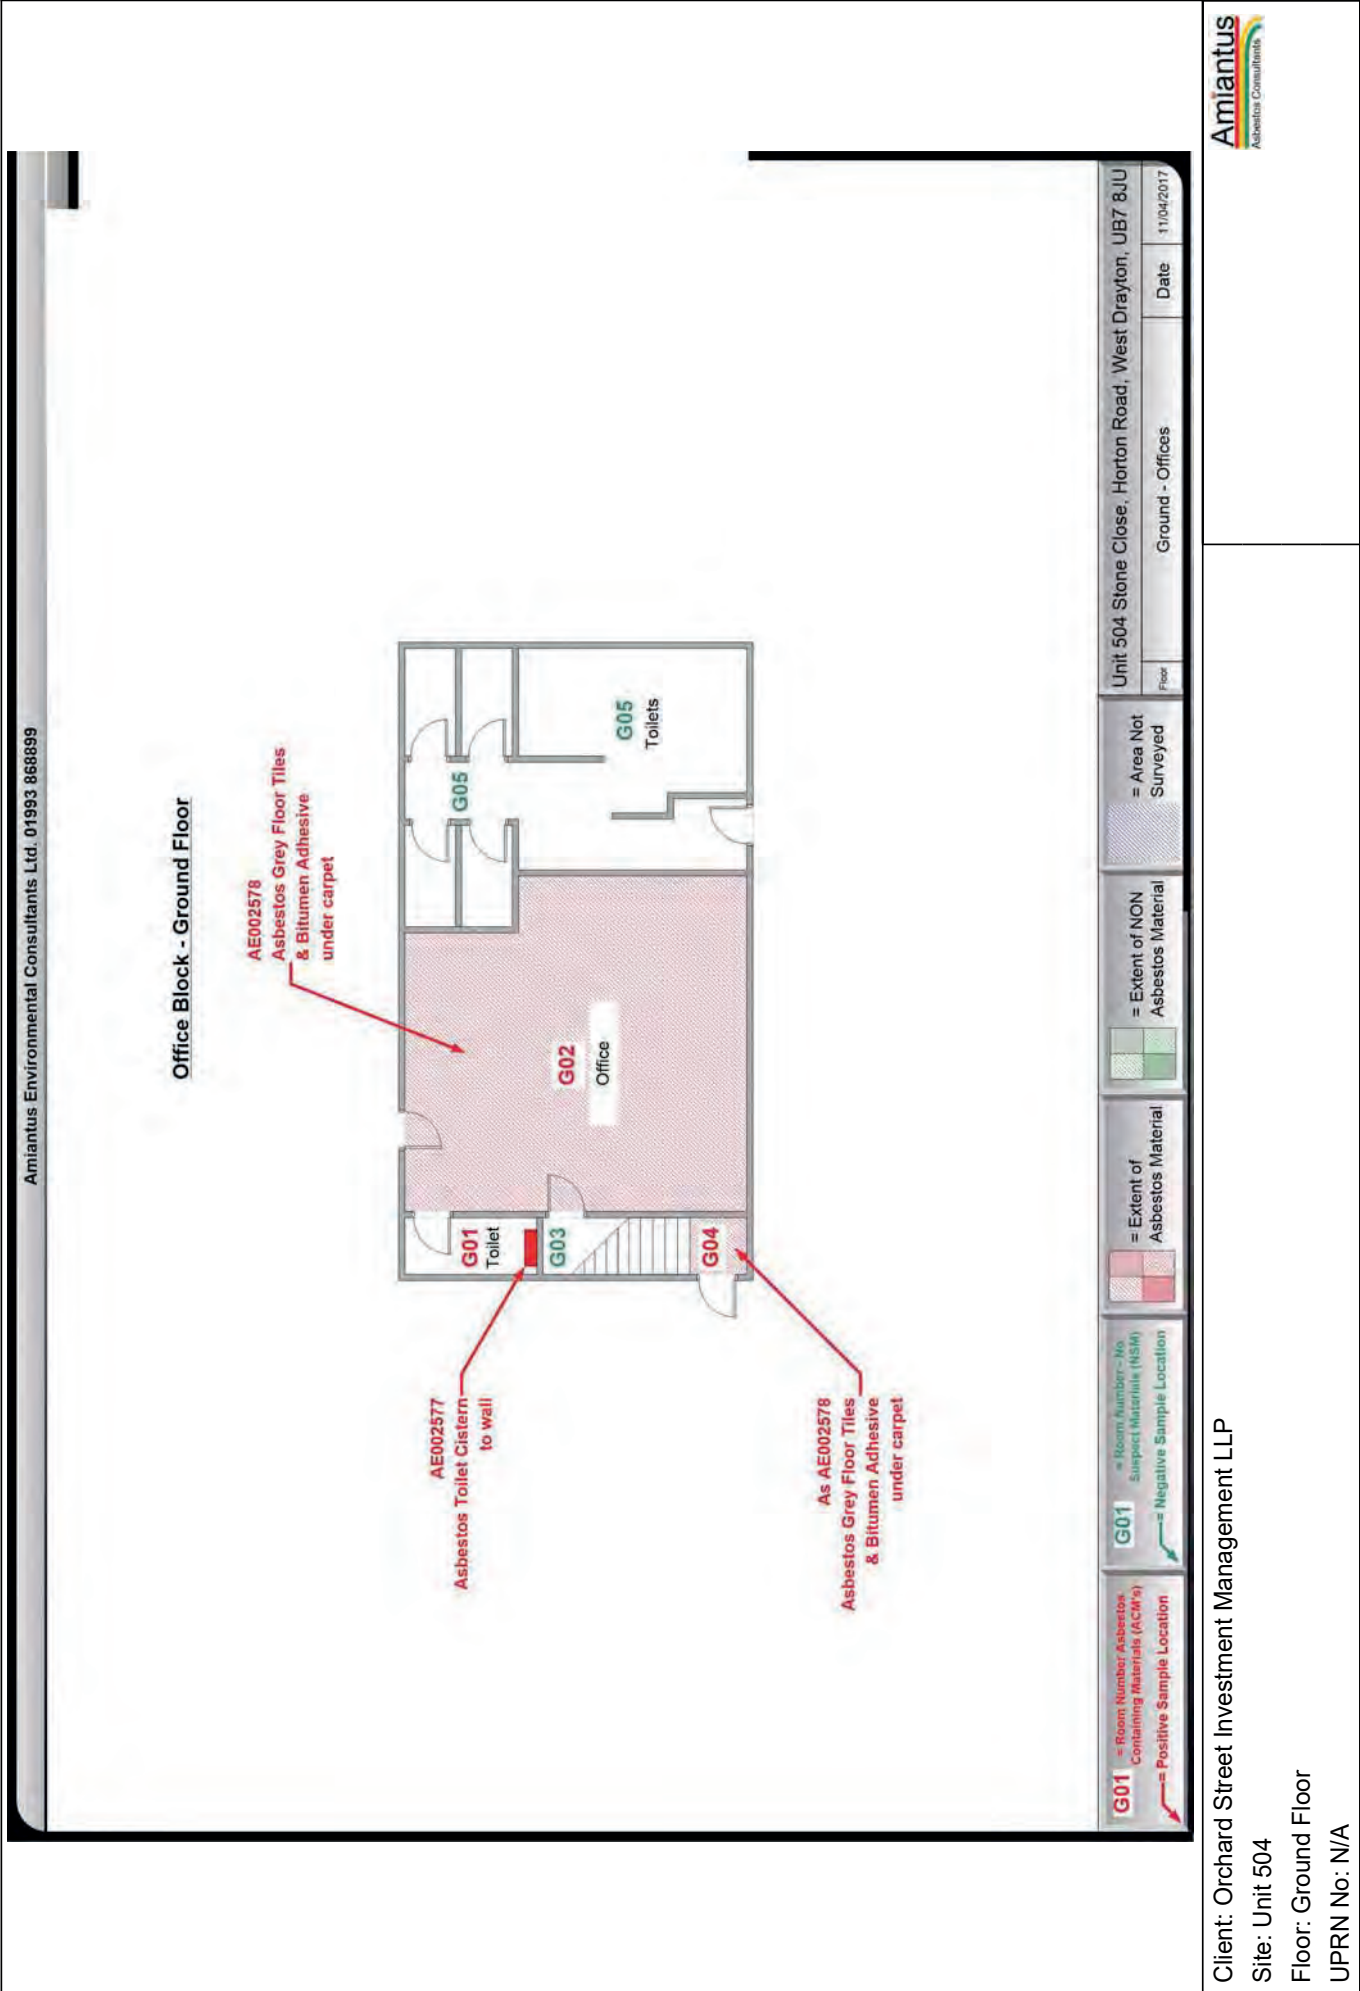

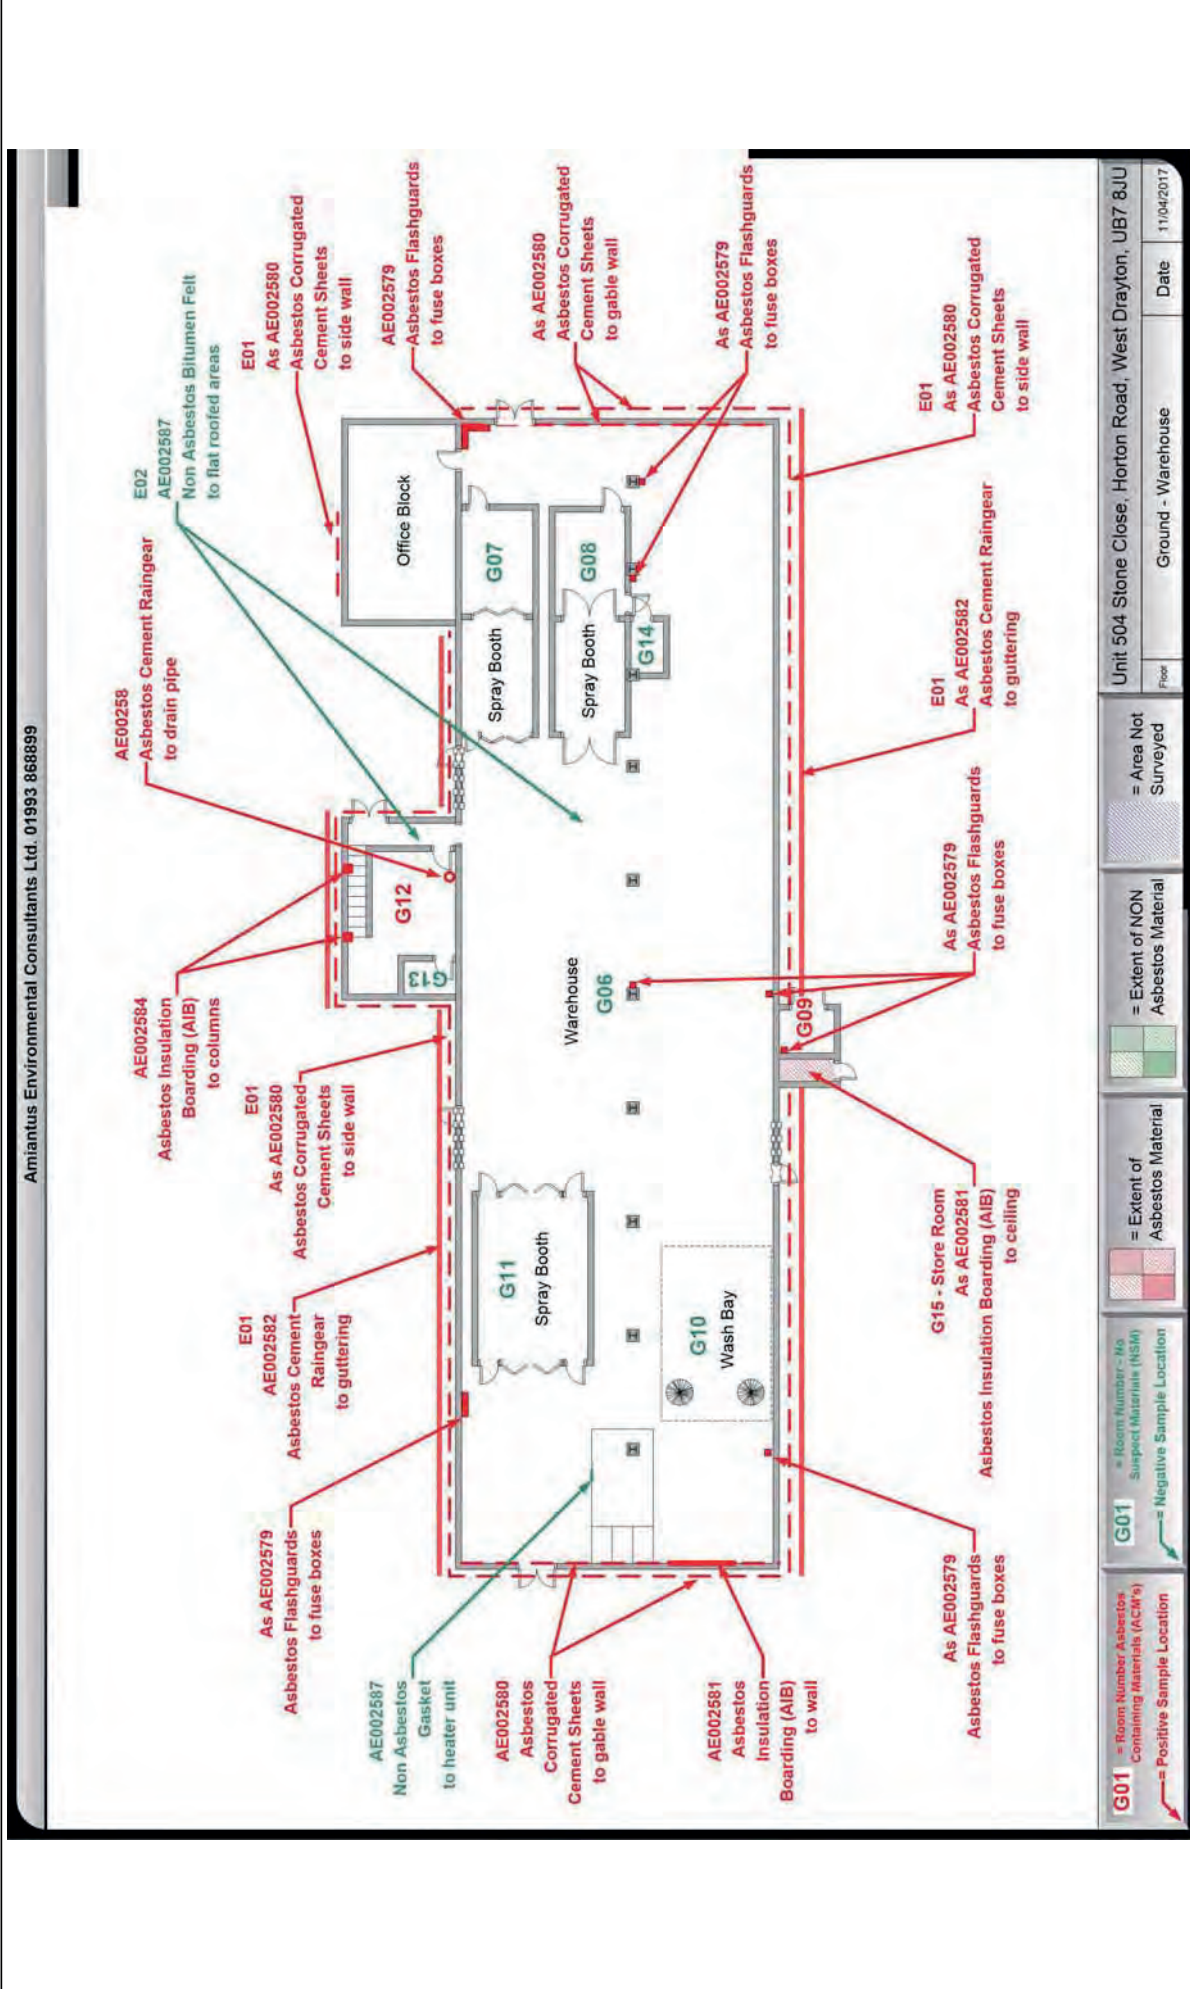

Client: Orchard Street Investment Management LLP

Site: Unit 504

Floor: Ground Floor

UPRN No: N/A

9.0 Recommendations:



9.1 To comply with and ensure that the requirements of section 2 & 3 of the Health and Safety at Work Act (as amended) 1974, the Management of Health and Safety at Work Regulations 1999, the Control of Asbestos Regulations 2012 and the Control of Substances Hazardous to Health 2002 are met, the following recommendations should be implemented:

9.2 Undertake suitable and sufficient Risk Assessments of identified asbestos containing materials against normal occupation and maintenance operations, in compliance with Regulations 3 of the Management of Health & Safety at Work Regulations 1999 and Regulation 6 of the Control of Asbestos Regulations 2012.

9.3 The findings of the survey be brought to the attention of those persons who are likely to come in contact with asbestos, in compliance with Section 2 and 3 of the Health and Safety at Work Act (as amended) 1974 and Regulation 10 of the Control of Asbestos Regulations 2012.

9.4 Implement an Asbestos Management Policy, Plan and review process in compliance Regulation 4 of the Control of Asbestos Regulations 2012.

9.5 Instigate regular inspections, to record and update details of retained asbestos containing materials.

9.6 Review the arrangement under the management plan in accordance with regulation 4 of the CAR 2012.

9.7 During the course of the survey it may not have been possible to access all areas of the site. Details of areas requiring further access are identified within the Data Sheets of this report. In accordance with HSG 264, asbestos has been presumed to be present within these areas and should be treated accordingly until further inspection and analysis of building fabric and services proves otherwise.

9.8 Where asbestos debris or asbestos in poor condition has been found it is recommended that access is restricted and or controlled to these areas in accordance with Regulation 11 and Regulation 16 of the Control of Asbestos Regulations 2012.

9.9 If we have identified asbestos materials in poor condition, it is recommended that air monitoring is carried out within a number of areas where asbestos materials have been identified in order to assess airborne fibre levels within adjacent occupied areas in relation to the clearance indicator, as documented by HSG 248 the Analyst Guide.

9.10 All identified asbestos to be appropriately identified and subject to risk assessment, management, and re-inspection.

9.11 Site specific recommendations in respect to the location and condition of asbestos materials identified during the course of this inspection are detailed in the Survey Data Sheets and Asbestos register. In considering the management of asbestos materials identified to date, these recommendations should be taken into consideration.

9.12 In accordance with the Control of Asbestos Regulations 2012 the removal of ACM's fall into one of the three categories below:

Licensed Asbestos Removal

Is defined as any work, which is undertaken on a friable asbestos product or which is likely to exceed the control limit of 0.1f/cm³. A licensed asbestos removal contractor must undertake this work and a 14-day notice must be given to the HSE prior to the commencement of the work.

Notifiable Non Licensed Works

If work on an ACM causes the deterioration of the matrix material in which the asbestos fibres are firmly linked, then these works are Notifiable Non Licensed Work (NNLW). Work of this type does not require an asbestos removal licence, but the company undertaking the work must have the following:

- Notification of the work to the relevant enforcing authority prior to the work commencing.
- Medical examinations to assess each worker's state of health to be carried out, before any possible – exposure to asbestos. Then re-examinations every three years.
- Insurance for working with asbestos containing materials.
- A register of work to be kept by the employer for each employee exposed to asbestos.

Non Notifiable Non Licensed work

-Non-Licensed Works is defined as any work, which involves short, non-continuous maintenance activities, during which only nonfriable materials are removed. It can also involve the removal of non-friable materials for refurbishment purposes. However, work of this type is only applicable where the matrix material in which the asbestos fibres are firmly linked remains intact.

-If a non-licensed contractor is appointed to undertake the removal works on the above materials, the following points must be adhered to:

-All operatives undertaking work on the material must have asbestos awareness training and practical asbestos training.

9.13 It is recommended that further intrusive investigations and sampling be carried out in accordance with HSG.264, where any major refurbishment, maintenance, installation or similar activity may expose asbestos materials that have remained inaccessible during the survey. This should be as a refurbishment/demolition survey as documented in HSG264.

9.14 The findings of this report should not be solely relied upon in obtaining costs for proposed asbestos abatement work. Any proposed abatement/removal of the asbestos should be undertaken against a detailed specification.



Notification of asbestos work

To improve the management of licensed asbestos work through auditing by the asbestos industry, HSE may share limited data provided on the ASB5 form with trade associations and relevant bodies. The data shared will be limited to: name of licensee, licence expiry date, site location, dates of work, nature of work.

Notification No	DE9B485516	Date Submitted	04/08/2019 15:38:38
-----------------	------------	----------------	---------------------

Notification type	This is a NEW notification
-------------------	-----------------------------------

About you and your licence

Licence number	111705529	Licence expiry date	29/03/2020
Licence holder name	Inner City Environmental LTD		
Address	Unit 5 Schooner Park, Schooner Court Crossways Business Park DARTFORD Kent DA2 6NW		
Phone no	01322 273517		
Email Address	Nick@innercityenvironmental.co.uk		

Job details

Name of company contracted to	R Collard Demolition
Phone number of company contracted to	01252 844688
Contact name at company contracted to	Mr Simon King
Site address	Unit 501 & 502 Stone Close Horton Road HILLINGDON West Drayton UB7 8JU
Multiple site addresses	No, there are not multiple site addresses
In which local authority is the site address (Country, Geographical Area and Local Authority)?	England, London, Hillingdon
Exact work location or description of where on the premises work is to be carried out	Unit 501 - Entrance lobby G03 ceiling, Side Entrance G06 ceiling. Unit 502 - Warehouse G06 ground floor, Ground floor parts store G12, room G15 ceiling.

Person preparing plan of work	Mr Nick Greenfield	Mobile phone	07741 264877
Site Supervisor	Mr Chris Smith	Mobile phone	07392 069019

Timing and duration of work

Actual start date of set up on site	19/08/2019	Expected finish date of work	30/08/2019
Waiver required?	No, this notification does not require a waiver		
Duration of work (no of days)	10 Days	Job start and finish times	08:00 - 16:00
Night working	No, night working is not involved	Weekend working	No, weekend working is not involved
Significant cessation/pause	No, there will not be a significant cessation or pause during the work		

About the work

ACM Type	Asbestos insulating board		
Work to be undertaken	Removal		
General condition of the asbestos material	Good		
Main type of asbestos	Chrysotile/Amosite		
Details of the type of work to be undertaken, general condition and main type of asbestos	Removal of AIB ceiling and wall panels to locations as defined in the surveys, all removals will be carried out under fully controlled conditions. Asbestos contains Amosite & Chrysotile and is in fair condition.		
Size of job (area or volume)	AIB - 35m2		
Minimum number of persons employed per shift	4	Maximum number of persons employed per shift	6

Control measures and risks

Control measures used to reduce exposure	BS8520 controlled wet surface and shadow vacuuming, decontamination enclosure of work under negative pressure, intact removal of whole AIB panels /tiles etcRPE		
How the work will be supervised and monitored	Using viewing panels via CCTVUsing enclosure entry		
Non-asbestos risks	Yes, there are non asbestos risks that make the asbestos work more complex		
Details of non-asbestos risks	Manual handling Slips, trips and falls Working at height		
Special premises	No, the asbestos removal is not taking place on special premises		

Enforcing authority

The enforcing authority is - HSE

Notifier contact details and declaration

Declaration	I declare that an ACoP compliant plan of work has been prepared		
Notifier name	Mr Nick Greenfield	Notifier position	Contracts Director



ENVIROCHEM

Analytical Laboratories Ltd

12 The Gardens, Broadcut, Fareham
Hampshire. PO16 8SS

Fibre Counting Report



1227

Tel: (01329) 287777
Fax: (01329) 287755

CLIENT: R. Collard Ltd

SITE ADDRESS: Feasibility, 501-504 Stone Close, West Drayton UB7 8JU

Our Ref: J174564 FC-5

Your Ref:

SAMPLING PROTOCOL: Reassurance

SAMPLED BY: Stefan Kitchener

ANALYSED BY (if different):

DATE OF SAMPLING: 05:09:19

DATE OF ANALYSIS (if different):

Filter No.	Pump	Head	Location	Time on	Time off	Flow (litres/min)			Volume (V) litres	Grats (n)	Fibres (N)	Calculation fibres/ml	Reported result fibres/ml
						Flow (start)	Flow (finish)	Flow (used)					
1	ENV24	SK1	Site perimeter, Northerly side of site (Between units 1/2 by AVH)	09:03	10:03	8.0	8.0	8.0	480	200	1.0	0.001	<0.01
2	ENV29	SK2	Site perimeter, Westerly side of site (Opposite Isley's)	09:04	10:04	8.0	8.0	8.0	480	200	0.0	0.000	<0.01
3	ENV42	SK3	Site perimeter, Southerly side of site (Entrance gate opposite BMW)	09:06	10:06	8.0	8.0	8.0	480	200	1.0	0.000	<0.01
4	ENV6	SK4	Site perimeter, Easterly side of site (Opposite residential houses at south end of site)	09:08	10:08	8.0	8.0	8.0	480	200	0.0	0.000	<0.01
5	ENV4	SK5	Site perimeter, Easterly side of site (Opposite residential houses at north end of site)	09:09	10:09	8.0	8.0	8.0	480	200	2.0	0.001	<0.01

1. Unless otherwise stated, the detection limit is 0.01 fibres/ml.

3. Comments, observations and opinions are outside the scope of UKAS accreditation.

5. For clearance sampling, this report must be read in conjunction with the certificate of reoccupation.

Equipment Numbers:

Microscope: Meji 12
Stage Micrometer: WSM21
Tally Counter: ☒/US

Environment:

Barometer: BTC-37
Thermometer: BTC-37
Flow Meter: FM45
Temperature (°C): 16
Pressure (mb): 1005
Correction Factor (F): -

Blank Filter

Head: SK7
Graticules:
Fibres:

Place of Analysis:

Lab
On Site
Mob Lab HK18 WLN

Comments

Reassurance air testing carried out around perimeter of site during removal of asbestos cement roof sheets. Air testing to ascertain airborne fibre concentration. Results satisfactory.

SIGNATURE:

(on behalf of Envirochem by an authorised signatory)

ENVIROCHEM/FORMS/WORKSHEETS/02/ISSUE07/NOV06

PRINT NAME: Stefan Kitchener

The Hazardous Waste Regulations 2005: Consignment Note

R. COLLARD

Eversley Haulage Park, Brickhouse Hill, Eversley RG27 0PZ

Telephone: 01252 844688 - Fax: 01252 844668

Email: james@rcollard.com - www.rcollard.com

PART A Notification details

- 1 Consignment note code: **COLLAR / 00001**
- 2 The waste described below is to be removed from (name, address, postcode, telephone, e-mail, facsimile):
**Sol - Sol4 Stoneclose
West Braydon
UR7 8JU**
- 3 Premises code (where applicable): **collar**

- 4 The waste will be taken to (name, address and postcode):
**Hills Waste Solutions
Mopes Lane Swindon
SN5 4HG**
- 5 The waste producer was (if different from 2) (name, address, postcode, telephone, e-mail, facsimile):
as per 2

PART B Description of the waste

If continuation sheet used, tick here ☐

- 1 The process giving rise to the waste(s) was: **Excavation** 2 SIC for the process giving rise to the waste: **45.21.1**
- 3 WASTE DETAILS (where more than one waste type is collected all of the information given below must be completed for each EWC identified)

Description of waste	List of wastes (EWC code)(6 digits)	Quantity (kg)	The chemical/biological components of the waste and their concentrations are:		Physical form (gas, liquid, solid, powder, sludge or mixed)	Hazard code(s)	Container type, number and size
			Component	Concentration (% or mg/kg)			
Underneath Cementwork asbestos	170605	np7	chrysotile	70.1%	Solid	np7	HPPCR

The information given below is to be completed for each EWC identified

EWC code	Packing group(s)	UN identification number(s)	Proper shipping name(s)	UN class(es)	Special handling requirements

PART C Carrier's certificate

(If more than one carrier is used, please attach schedule for subsequent carriers. If a schedule of carriers is attached tick here. ☐)

I certify that I today collected the consignment and that the details in A2, A4 and B3 are correct and I have been advised of any specific handling requirements.

1 Carrier name: **Rcollard**
On behalf of (name, address, postcode, telephone, e-mail, facsimile):

2 Carrier registration no./reason for exemption: **CRDU96607**

3 Vehicle registration no. (or mode of transport, if not road):

Signature **[Signature]**
Date **16/10/2019** Time **11:00**

PART D Consignor's certificate

I certify that the information in A, B and C above is correct, that the carrier is registered or exempt and was advised of the appropriate precautionary measures. All of the waste is packaged and labelled correctly and the carrier has been advised of any special handling requirements.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

1 Consignor name: **[Signature]**
On behalf of (name, address, postcode, telephone, e-mail, facsimile):

Signature **[Signature]**
Date **16/10/2019** Time **11:00**

PART E Consignee's certificate (where more than one waste type is collected all of the information given below must be completed for each EWC)

Individual EWC code(s) received	Quantity of each EWC code received (kg)	EWC code accepted/rejected	Waste management operation (R or D code)
170605	10600	A	Dos

1 I received this waste at the address given in A4 on: Date **16/10/2019** Time **13:21**

2 Vehicle registration no. (or mode of transport if not road): **KX17 MWF** Name: **T Jackson**
On behalf of (name, address, postcode, telephone, e-mail, facsimile):

3 Where waste is rejected please provide details:

I certify that waste management licence/permit/authorised exemption no(s):

NP3934LH

authorises the management of the waste described in B at the address given in A4.

Hills Waste Solutions
Parkgate Farm Landfill
Mopes Lane, Purton
Swindon
Wiltshire, SN5 4HG
Tel: 01252 771759

Signature **[Signature]**
Date **16/10/2019** Time **13:21**

The Hazardous Waste Regulations 2005: Consignment Note

R. COLLARD

Eversley Haulage Park, Brickhouse Hill, Eversley RG27 0PZ
Telephone: 01252 844688 - Fax: 01252 844688
Email: james@rcollard.com - www.rcollard.com

PART A Notification details

1 Consignment note code: **COLLAR / 00002**

2 The waste described below is to be removed from (name, address, postcode, telephone, e-mail, facsimile):

**501-SOL STAGE CLOSE
WEST DRAYTON
UB7 8JU**

3 Premises code (where applicable): **COLLAR**

4 The waste will be taken to (name, address and postcode):

**MICK GEORGE LTD
METAL WASTE & SOIL TREATMENT CENTRE
WITCHAM MEADLANDS LANDFILL SITE
BLACK FEN DRAVE, METAL
CAMBRIDGESHIRE CB6 2AY**

5 The waste producer was (if different from 2) (name, address, postcode, telephone, e-mail, facsimile):

AS POS 2

PART B Description of the waste

If continuation sheet used, tick here ☐

1 The process giving rise to the waste(s) was: **DEMOLITION**

2 SIC for the process giving rise to the waste: **45.2111**

3 WASTE DETAILS (where more than one waste type is collected all of the information given below must be completed for each EWC identified)

Description of waste	List of wastes (EWC code)(6 digits)	Quantity (kg)	The chemical/biological components of the waste and their concentrations are:		Physical form (gas, liquid, solid, powder, sludge or mixed)	Hazard code(s)	Container type, number and size
			Component	Concentration (% or mg/kg)			
CONTAMINATED SOIL	170503	18,000 KG.	TPH	70.1%	SOLID	HP7	TIPPER

The information given below is to be completed for each EWC identified

EWC code	Packing group(s)	UN identification number(s)	Proper shipping name(s)	UN class(es)	Special handling requirements

PART C Carrier's certificate

(If more than one carrier is used, please attach schedule for subsequent carriers. If a schedule of carriers is attached tick here. ☐)

I certify that I today collected the consignment and that the details in A2, A4 and B3 are correct and I have been advised of any specific handling requirements.

1 Carrier name: **R. COLLARD**

On behalf of (name, address, postcode, telephone, e-mail, facsimile):

2 Carrier registration no./reason for exemption: **CB0496607**

3 Vehicle registration no. (or mode of transport, if not road):

GN64 SUH

Signature **[Signature]**

Date **17/10/2019** Time **0910**

PART D Consignor's certificate

I certify that the information in A, B and C above is correct, that the carrier is registered or exempt and was advised of the appropriate precautionary measures. All of the waste is packaged and labelled correctly and the carrier has been advised of any special handling requirements.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

1 Consignor name **[Signature]**

On behalf of (name, address, postcode, telephone, e-mail, facsimile):

AS ABOVE

Signature **[Signature]**

Date **17/10/2019** Time **0910**

PART E Consignee's certificate (where more than one waste type is collected all of the information given below must be completed for each EWC)

Individual EWC code(s) received	Quantity of each EWC code received (kg)	EWC code accepted/rejected	Waste management operation (R or D code)
170503	17,700	ACCEPTED	R03

1 I received this waste at the address given in A4 on: Date **17/10/2019** Time **1134**

2 Vehicle registration no. (or mode of transport if not road):

GN64 SUH

3 Where waste is rejected please provide details:

I certify that waste management licence/permit/authorised exemption no(s).

EPN 1EP3992SP

authorises the management of the waste described in B at the address given in A4.

Name: **DAN**

On behalf of (name, address, postcode, telephone, e-mail, facsimile):

Signature **[Signature]**

Date **17/10/2019** Time **1200**

The Hazardous Waste Regulations 2005: Consignment Note

R. COLLARD

Eversley Haulage Park, Brickhouse Hill, Eversley RG27 0PZ
Telephone: 01252 844688 - Fax: 01252 844668
Email: james@rcollard.com - www.rcollard.com

PART A Notification details

1 Consignment note code: **COLLAR / 00003**

2 The waste described below is to be removed from (name, address, postcode, telephone, e-mail, facsimile):

**SD1-SD4 STONE CLOSE
WEST DRAYTON
UB7 8JH**

3 Premises code (where applicable): **COLLAR**

4 The waste will be taken to (name, address and postcode):

**MICK GEORGE LTD
METAL WASTE & SOIL TREATMENT CENTRE
WITZHAM MEADLANDS LANDFILL SITE
BLOCK FEN DRIVE, METAL
CAMBRIDGESHIRE CB6 2AY.**

5 The waste producer was (if different from 2) (name, address, postcode, telephone, e-mail, facsimile):

AS POS 2

PART B Description of the waste

If continuation sheet used, tick here ☐

1 The process giving rise to the waste(s) was: **DEMOLITION**

2 SIC for the process giving rise to the waste: **45.2111**

3 WASTE DETAILS (where more than one waste type is collected all of the information given below must be completed for each EWC identified)

Description of waste	List of wastes (EWC code)(6 digits)	Quantity (kg)	The chemical/biological components of the waste and their concentrations are:	Physical form (gas, liquid, solid, powder, sludge or mixed)	Hazard code(s)	Container type, number and size
CONTAMINATED SOIL	170503	18,000 KG.	TPH	70.1%	Solid	HP7 TIRREL

The information given below is to be completed for each EWC identified

EWC code	Packing group(s)	UN identification number(s)	Proper shipping name(s)	UN class(es)	Special handling requirements

PART C Carrier's certificate

(If more than one carrier is used, please attach schedule for subsequent carriers. If a schedule of carriers is attached tick here. ☐)

I certify that I today collected the consignment and that the details in A2, A4 and B3 are correct and I have been advised of any specific handling requirements.

1 Carrier name: **R COLLARD**

On behalf of (name, address, postcode, telephone, e-mail, facsimile):

2 Carrier registration no./reason for exemption: **CDU 98607**

3 Vehicle registration no. (or mode of transport, if not road):

Signature **K. P. WUB**

Date **17/10/2019** Time **0900**

PART D Consignor's certificate

I certify that the information in A, B and C above is correct, that the carrier is registered or exempt and was advised of the appropriate precautionary measures. All of the waste is packaged and labelled correctly and the carrier has been advised of any special handling requirements.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

1 Consignor name: **AS POS**

On behalf of (name, address, postcode, telephone, e-mail, facsimile):

Signature **K. P. WUB**

Date **17/10/2019** Time **0900**

PART E Consignee's certificate (where more than one waste type is collected all of the information given below must be completed for each EWC)

Individual EWC code(s) received	Quantity of each EWC code received (kg)	EWC code accepted/rejected	Waste management operation (R, S, D code)
170503	17.660	ACCEPTED	1203

1 I received this waste at the address given in A4 on: Date **17/10/2019** Time **1136**

2 Vehicle registration no. (or mode of transport if not road): **DAW**

Name: **DAW**
On behalf of (name, address, postcode, telephone, e-mail, facsimile):

3 Where waste is rejected please provide details:

I certify that waste management licence/permit/authorised exemption no(s).

EPR 168 349289

authorises the management of the waste described in B at the address given in A4.

Signature **cheed**

Date **17/10/2019** Time **1400**

Mick George Ltd
Metal Waste & Soil Treatment Centre
Witzham Meadlands Landfill Site
Block Fen Drive, Metal
Cambridgeshire CB6 2AY
Tel: 01252 844688
Fax: 01252 844668
Email: james@rcollard.com
www.rcollard.com

The Hazardous Waste Regulations 2005: Consignment Note

R. COLLARD

Eversley Haulage Park, Brickhouse Hill, Eversley RG27 0PZ
Telephone: 01252 844688 - Fax: 01252 844668
Email: james@rcollard.com - www.rcollard.com

PART A Notification details

1 Consignment note code: /

2 The waste described below is to be removed from (name, address, postcode, telephone, e-mail, facsimile):
*W. Collins Ltd
501-504 Grove Road
Walsby, Doncaster DN10 3WJ*

3 Premises code (where applicable):

4 The waste will be taken to (name, address and postcode):
*11-13 The Waste Management
Moor Lane
Sutton SN5 4JG*

5 The waste producer was (if different from 2) (name, address, postcode, telephone, e-mail, facsimile):
As per 2

PART B Description of the waste

If continuation sheet used, tick here ☐

1 The process giving rise to the waste(s) was: *Demolition*

2 SIC for the process giving rise to the waste:

3 WASTE DETAILS (where more than one waste type is collected all of the information given below must be completed for each EWC identified)

Description of waste	List of wastes (EWC code) (6 digits)	Quantity (kg)	The chemical/biological components of the waste and their concentrations are:		Physical form (gas, liquid, solid, powder, sludge or mixed)	Hazard code(s)	Container type, number and size
			Component	Concentration (% or mg/kg)			
<i>Concrete</i>	<i>170605</i>	<i>1000</i>	<i>Concrete</i>	<i>100%</i>	<i>Solid</i>	<i>H4</i>	<i>FD 70</i>

The information given below is to be completed for each EWC identified

EWC code	Packing group(s)	UN identification number(s)	Proper shipping name(s)	UN class(es)	Special handling requirements
<i>170605</i>	<i>2540</i>			<i>9</i>	<i>Not dangerous</i>

PART C Carrier's certificate

(If more than one carrier is used, please attach schedule for subsequent carriers. If a schedule of carriers is attached tick here. ☐)

I certify that I today collected the consignment and that the details in A2, A4 and B3 are correct and I have been advised of any specific handling requirements.

1 Carrier name: *W. Collins Ltd*

On behalf of (name, address, postcode, telephone, e-mail, facsimile):
As per A No 2

2 Carrier registration no./reason for exemption:
CA091661A

3 Vehicle registration no. (or mode of transport, if not road):
WV18 FVJ

Signature

Date Time

PART D Consignor's certificate

I certify that the information in A, B and C above is correct, that the carrier is registered or exempt and was advised of the appropriate precautionary measures. All of the waste is packaged and labelled correctly and the carrier has been advised of any special handling requirements.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

1 Consignor name: *W. Collins Ltd*

On behalf of (name, address, postcode, telephone, e-mail, facsimile):
As per A No 2

Signature

Date Time

PART E Consignee's certificate (where more than one waste type is collected all of the information given below must be completed for each EWC)

Individual EWC code(s) received	Quantity of each EWC code received (kg)	EWC code accepted/rejected	Waste management operation (R or D code)

1 I received this waste at the address given in A4 on: Date Time

2 Vehicle registration no. (or mode of transport if not road):

Name:

On behalf of (name, address, postcode, telephone, e-mail, facsimile):

3 Where waste is rejected please provide details:

I certify that waste management licence/permit/authorised exemption no(s).

authorises the management of the waste described in B at the address given in A4.

Signature

Date Time

The Hazardous Waste Regulations 2005: Consignment Note

R. COLLARD

Eversley Haulage Park, Brickhouse Hill, Eversley RG27 0PZ
Telephone: 01252 844688 - Fax: 01252 844668
Email: james@rcollard.com - www.rcollard.com

PART A Notification details

1 Consignment note code: /

2 The waste described below is to be removed from (name, address, postcode, telephone, e-mail, facsimile):

3 Premises code (where applicable):

4 The waste will be taken to (name, address and postcode):

5 The waste producer was (if different from 2) (name, address, postcode, telephone, e-mail, facsimile):

PART B Description of the waste

If continuation sheet used, tick here ☐

1 The process giving rise to the waste(s) was:

2 SIC for the process giving rise to the waste: /

3 WASTE DETAILS (where more than one waste type is collected all of the information given below must be completed for each EWC identified)

Description of waste	List of wastes (EWC code)(6 digits)	Quantity (kg)	The chemical/biological components of the waste and their concentrations are:		Physical form (gas, liquid, solid, powder, sludge or mixed)	Hazard code(s)	Container type, number and size
			Component	Concentration (% or mg/kg)			
Ben-Litrol	151101	1	Ben-Litrol	100	Liquid	H2	40L
Ben-Litrol	151101	1	Ben-Litrol	100	Liquid	H2	40L

The information given below is to be completed for each EWC identified

EWC code	Packing group(s)	UN identification number(s)	Proper shipping name(s)	UN class(es)	Special handling requirements
151101	2500			1	H2 - Corrosive
151101	2500			1	H2 - Corrosive

PART C Carrier's certificate

(If more than one carrier is used, please attach schedule for subsequent carriers. If a schedule of carriers is attached tick here. ☐)

I certify that I today collected the consignment and that the details in A2, A4 and B3 are correct and I have been advised of any specific handling requirements.

1 Carrier name:

On behalf of (name, address, postcode, telephone, e-mail, facsimile):

2 Carrier registration no./reason for exemption:

3 Vehicle registration no. (or mode of transport, if not road):

Signature

Date Time

PART D Consignor's certificate

I certify that the information in A, B and C above is correct, that the carrier is registered or exempt and was advised of the appropriate precautionary measures. All of the waste is packaged and labelled correctly and the carrier has been advised of any special handling requirements.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

1 Consignor name:

On behalf of (name, address, postcode, telephone, e-mail, facsimile):

Signature

Date Time

PART E Consignee's certificate (where more than one waste type is collected all of the information given below must be completed for each EWC)

Individual EWC code(s) received	Quantity of each EWC code received (kg)	EWC code accepted/rejected	Waste management operation (R or D code)
151101	1	151101	R
151101	1	151101	R

1 I received this waste at the address given in A4 on: Date Time

2 Vehicle registration no. (or mode of transport if not road):

Name:

On behalf of (name, address, postcode, telephone, e-mail, facsimile):

3 Where waste is rejected please provide details:

I certify that waste management licence/permit/authorised exemption no(s).

authorises the management of the waste described in B at the address given in A4.

Signature

Date Time

The Hazardous Waste Regulations 2005: Consignment Note

R. COLLARD

Eversley Haulage Park, Brickhouse Hill, Eversley RG27 0PZ
Telephone: 01252 844688 - Fax: 01252 844668
Email: james@rcollard.com - www.rcollard.com

PART A Notification details

1 Consignment note code: **CG194D/MC154**

2 The waste described below is to be removed from (name, address, postcode, telephone, e-mail, facsimile):

RECOLLARD LTD
501-504 STONE CLOSE
WEST DRAYTON UB7 8JU

3 Premises code (where applicable): **CG194D**

4 The waste will be taken to (name, address and postcode):

MILLS WASTE MANAGEMENT PARK GATE
FAIRM LAND RILL MOPES LANE.
SWINDON SN5 4HG

5 The waste producer was (if different from 2) (name, address, postcode, telephone, e-mail, facsimile):

AS PER 2..

PART B Description of the waste

If continuation sheet used, tick here ☐

1 The process giving rise to the waste(s) was: **DEMOLITION.**

2 SIC for the process giving rise to the waste: **43.11/0**

3 WASTE DETAILS (where more than one waste type is collected all of the information given below must be completed for each EWC identified)

Description of waste	List of wastes (EWC code)(6 digits)	Quantity (kg)	The chemical/biological components of the waste and their concentrations are:	Physical form (gas, liquid, solid, powder, sludge or mixed)	Hazard code(s)	Container type, number and size
CEMENT BONDED			Component	Concentration (% or mg/kg)		
ASBESTOS	170605	1	CHRYOTILE	10%	S0H1	H7 40.

The information given below is to be completed for each EWC identified

EWC code	Packing group(s)	UN identification number(s)	Proper shipping name(s)	UN class(es)	Special handling requirements
170605	2540			9	ADDI INHALATION

PART C Carrier's certificate

(If more than one carrier is used, please attach schedule for subsequent carriers. If a schedule of carriers is attached tick here. ☐)

I certify that I today collected the consignment and that the details in A2, A4 and B3 are correct and I have been advised of any specific handling requirements.

1 Carrier name: **R. COLLARD LTD.**

On behalf of (name, address, postcode, telephone, e-mail, facsimile):

R. COLLARD
AS PER PART A No 2

2 Carrier registration no./reason for exemption:

CTSDUAC6GA.

3 Vehicle registration no. (or mode of transport, if not road):

W018 FLU.

Signature

Date **09092019** Time **0745**

PART D Consignor's certificate

I certify that the information in A, B and C above is correct, that the carrier is registered or exempt and was advised of the appropriate precautionary measures. All of the waste is packaged and labelled correctly and the carrier has been advised of any special handling requirements.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

1 Consignor name: **R COLLARD**

On behalf of (name, address, postcode, telephone, e-mail, facsimile):

JOHN KING

AS ABOVE

Signature

Date **09092019** Time **0749**

PART E Consignee's certificate (where more than one waste type is collected all of the information given below must be completed for each EWC)

Individual EWC code(s) received	Quantity of each EWC code received (kg)	EWC code accepted/rejected	Waste management operation (R or D code)
170605	11020	A	D05

1 I received this waste at the address given in A4 on: Date **09092019** Time **0940**

2 Vehicle registration no. (or mode of transport if not road):

W018 FLU

3 Where waste is rejected please provide details:

I certify that waste management licence/permit/authorised exemption no(s).

NP3934LH

authorises the management of the waste described in B at the address given in A4.

Name:

On behalf of (name, address, postcode, telephone, e-mail, facsimile):

Hills Waste Solutions
Parkgate Farm Landfill
Mopes Lane, Purton
Swindon
Wiltshire, SN5 4HG
01252 771759

Signature

Date **09092019** Time **0940**

Notification details

Consignment note code: **C6194D/MC157**

The waste described below is to be removed from (name, address, postcode, telephone, e-mail, facsimile):

R. COLLARD LTD
50-504 STONE CLOSE
WEBB DENTON UB7 8JU

3 Premises code (where applicable): **C6194D**

4 The waste will be taken to (name, address and postcode):

HILLS WASTE MANAGEMENT
MOPES LANE
SWINDON SN5 4HG

5 The waste producer was (if different from 2) (name, address, postcode, telephone, e-mail, facsimile):

As Per 2

PART B Description of the waste

If continuation sheet used, tick here

1 The process giving rise to the waste(s) was: **DEMOLITION**

2 SIC for the process giving rise to the waste: **43.11/0**

3 WASTE DETAILS (where more than one waste type is collected all of the information given below must be completed for each EWC identified)

Description of waste	List of wastes (EWC code)(6 digits)	Quantity (kg)	The chemical/biological components of the waste and their concentrations are:	Physical form (gas, liquid, solid, powder, sludge or mixed)	Hazard code(s)	Container type, number and size
Concrete			Component	Concentration (% or mg/kg)		
BUNDLED BRICKS	170605	10000	CRUSHABLE	100%	SAND	H7 40 YD

The information given below is to be completed for each EWC identified

EWC code	Packing group(s)	UN identification number(s)	Proper shipping name(s)	UN class(es)	Special handling requirements
170605	2540			9	HAZARDOUS

PART C Carrier's certificate

PART D Consignor's certificate

(If more than one carrier is used, please attach schedule for subsequent carriers. If a schedule of carriers is attached tick here. ☐)

I certify that I today collected the consignment and that the details in A2, A4 and B3 are correct and I have been advised of any specific handling requirements.

1 Carrier name: **R. COLLARD LTD**

On behalf of (name, address, postcode, telephone, e-mail, facsimile):

R. COLLARD
AS PER A NO 2

2 Carrier registration no./reason for exemption:

CB099666A

3 Vehicle registration no. (or mode of transport, if not road):

WU18FLV

Signature

Date **16/10/2019** Time **0800**

I certify that the information in A, B and C above is correct, that the carrier is registered or exempt and was advised of the appropriate precautionary measures. All of the waste is packaged and labelled correctly and the carrier has been advised of any special handling requirements.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

1 Consignor name: **J. KIRK**

On behalf of (name, address, postcode, telephone, e-mail, facsimile):

R. COLLARD
AS ABOVE

Signature

Date **16/10/2019** Time **0802**

PART E Consignee's certificate (where more than one waste type is collected all of the information given below must be completed for each EWC)

Individual EWC code(s) received	Quantity of each EWC code received (kg)	EWC code accepted/rejected	Waste management operation (R or D code)
170605	9360	A	DOS

1 I received this waste at the address given in A4 on: Date **16/10/2019** Time **1009**

2 Vehicle registration no. (or mode of transport if not road): **WU18FLV**

Name: **J. Jackson**

On behalf of (name, address, postcode, telephone, e-mail, facsimile):

Hills Waste Solutions
Parkgate Farm Landfill
Mopes Lane, Purton
Swindon

Signature: **W. Jackson**, **SN5 4HG**

Date **16/10/2019** Time **1758**

I certify that waste management licence/permit/authorised exemption no(s).

authorises the management of the waste described in B at the address given in A4.

NP3934LH

tone, Puton. Swindon
SWS 4MG
The waste producer was (if different from 2) (name, address, postcode, telephone, e-mail, facsimile):
AS ABOVE

ry close
C6194D

If continuation sheet used, tick here ☐

te(s) was: **DEMOLITION**

2 SIC for the process giving rise to the waste: **43.11.1**

one waste type is collected all of the information given below must be completed for each EWC identified

Waste C code (6 digits)	Quantity (kg)	The chemical/biological components of the waste and their concentrations are:		Physical form (gas, liquid, solid, powder, sludge or mixed)	Hazard code(s)	Container type, number and size
		Component	Concentration (% or mg/kg)			
70605	18000	CRYSTALLINE	>0.1%	SOLID	H7	Porto-

completed for each EWC identified

(s)	UN identification number(s)	Proper shipping name(s)	UN class(es)	Special handling requirements

PART D Consignor's certificate

I certify that the information in A, B and C above is correct, that the carrier is registered or exempt and was advised of the appropriate precautionary measures. All of the waste is packaged and labelled correctly and the carrier has been advised of any special handling requirements.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

1 Consignor name: **K.J. King**
On behalf of (name, address, postcode, telephone, e-mail, facsimile): **24270PZ**

Signature: *[Signature]*
Date: **02/09/2019** Time: **1550**

Where more than one waste type is collected all of the information given below must be completed for each EWC

EWC code accepted/rejected	Waste management operation (R or D code)
A	D05

Waste received (kg): **160**

Waste sent in A4 on: Date **03/09/2019** Time **0804**

Waste sent for transport (if not road): **RAF2XL0**

Name: **Waste Solutions**
On behalf of: **Waste Solutions**

The Hazardous Waste Regulations 2005: Consignment Note



G. J. BOWMER
(WASTE DISPOSAL)
LIMITED

"FAIRVIEW", MAGPIE LANE, BRENTWOOD, ESSEX CM13 3DT

TEL: 01277 225428

FAX: 01277 200682

EMAIL: enquiries@bowmerwaste.co.uk

WEB: www.bowmerwaste.co.uk

PRODUCER'S / HOLDER'S / CONSIGNOR'S COPY (Delete as appropriate)

PART A Notification details

1 Consignment note code: **INNERC / 37459**

2 The waste described below is to be removed from (name, address, postcode, telephone, e-mail, facsimile):

**UNIT 501 AND 504 STONE CLOSE, HORTON ROAD,
WEST DRAYTON, UB7 8JU, UK**

3 Premises code (where applicable): **INNERC**

4 The waste will be taken to (name, address and postcode):

**37A GORMANDESS LANE
REDHILL SURREY**

5 The waste producer was (if different from 2) (name, address, postcode, telephone, e-mail, facsimile):

**INNER CITY ENVIRONMENTAL, UNIT 5 SCHOONER
PARK SCHOONER COURT, CROSSWAYS BUSINESS
PARK DARTFORD KENT DA2 6NW**

PART B Description of the waste

If continuation sheet used, tick here ☐

1 The process giving rise to the waste(s) was: **ASBESTOS REMOVAL WORK**

2 SIC for the process giving rise to the waste: **39.000**

3 WASTE DETAILS (where more than one waste type is collected all of the information given below must be completed for each EWC identified)

Description of waste	List of wastes (EWC code) (6 digits)	Quantity (kg)	The chemical/biological components of the waste and their concentrations are:		Physical form (gas, liquid, solid, powder, sludge or mixed)	Hazard code(s)	Container type, number and size
			Component	Concentration (% or mg/kg)			
BROWN ASBESTOS	1 7 0 6 0 1	2000	AMOSITE	L 20%	SOLID	HP5 HP7	16 YARD CLOSED
WHITE ASBESTOS	1 7 0 6 0 5	2000	AMOSITE	L 20%	SOLID	HP5 HP7	16 YARD CLOSED

The information given below is to be completed for each EWC identified

EWC code	UN identification number(s)	Proper shipping name(s)	UN class(es)	Packing group(s)	Special handling requirements
1 7 0 6 0 1	UN 2212	ASBESTOS AMPHIBOLE (AMOSITE)	9	PG II (E)	MANUAL ONLY
1 7 0 6 0 5	UN 2590	ASBESTOS CHRYSOTILE	9	PG III (E)	MANUAL ONLY

PART C Carrier's certificate

(If more than one carrier is used, please attach schedule for subsequent carriers. If schedule of carriers is attached tick here. ☐)

I certify that I today collected the consignment and that the details in A2, A4 and B3 are correct and I have been advised of any specific handling requirements.

Where this note comprises part of a multiple collection the round number and collection number are:

16092019

1 Carrier name: **JAMES**
On behalf of (name, address, postcode, telephone, e-mail, facsimile):

G. J. Bowmer (Waste Disposal) Ltd, Fairview, Magpie Lane, Essex, CM13 3DT

2 Carrier registration no./reason for exemption: **CBDU98031**

3 Vehicle registration no. (or mode of transport, if not road): **WHOSR03**

Signature **[Signature]**

Date **16092019** Time **1600**

PART D Consignor's certificate

I certify that the information in A, B and C has been completed and is correct, that the carrier is registered or exempt and was advised of the appropriate precautionary measures. All of the waste is packaged and labelled correctly and the carrier has been advised of any special handling requirements.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011.

1 Consignor name: **[Signature]**

On behalf of (name, address, postcode, telephone, e-mail, facsimile):

**INNER CITY ENVIRONMENTAL, UNIT 5 SCHOONER
PARK SCHOONER COURT, CROSSWAYS BUSINESS
PARK DARTFORD, KENT, DA2 6NW**

Date **16092019** Time **1600**

PART E Consignee's certificate (where more than one waste type is collected all of the information given below must be completed for each EWC)

Individual EWC code(s) received	Quantity of each EWC code received (kg)	EWC code accepted/rejected	Waste management operation (R or D code)

1 I received this waste at the address given in A4 on: Date **DDMMYY** Time **HHMM**

2 Vehicle registration no. (or mode of transport if not road):

3 Where waste is rejected please provide details:

I certify that waste permit/exempt waste operation number:

[Signature]

authorises the management of the waste described in B at the address given in A4.

Where the consignment forms part of a multiple collection, as identified in Part C, I certify that the total number of consignments forming the collection are:

Name:

On behalf of (name, address, postcode, telephone, e-mail, facsimile):

Signature

Date **DDMMYY** Time **HHMM**

The Hazardous Waste Regulations 2005: Consignment Note



G. J. BOWMER
(WASTE DISPOSAL)
LIMITED

19/08/19
**Environment
Agency**

37326
arca

BIN
G23

"FAIRVIEW", MAGPIE LANE, BRENTWOOD, ESSEX CM13 3DT
TEL: 01277 225428
FAX: 01277 200682
EMAIL: enquiries@bowmerwaste.co.uk
WEB: www.bowmerwaste.co.uk

PRODUCER'S / HOLDER'S / CONSIGNOR'S COPY (Delete as appropriate)

PART A Notification details

1 Consignment note code: **INNERC / 37326**

2 The waste described below is to be removed from (name, address, postcode, telephone, e-mail, facsimile):

**UNIT 501 AND 504 STONE CLOSE, HORTON ROAD,
WEST DRAYTON, UB7 8JU, UK**

3 Premises code (where applicable): **INNERC**

4 The waste will be taken to (name, address and postcode):

**BIFFA REDHILL CORMORANTERS LANE
NUTFIELD REDHILL SURREY**

5 The waste producer was (if different from 2) (name, address, postcode, telephone, e-mail, facsimile):

**INNER CITY ENVIRONMENTAL, UNIT 5 SCHOONER
PARK SCHOONER COURT, CROSSWAYS BUSINESS
PARK, DARTFORD, KENT, DA2 6NW**

If continuation sheet used, tick here ☐

PART B Description of the waste

1 The process giving rise to the waste(s) was: **ASBESTOS REMOVAL WORK**

2 SIC for the process giving rise to the waste: **39.00 /**

3 WASTE DETAILS (where more than one waste type is collected all of the information given below must be completed for each EWC identified)

Description of waste	List of wastes (EWC code) (6 digits)	Quantity (kg)	The chemical/biological components of the waste and their concentrations are:		Physical form (gas, liquid, solid, powder, sludge or mixed)	Hazard code(s)	Container type, number and size
			Component	Concentration (% or mg/kg)			
BROWN ASBESTOS	1 7 0 6 0 1	2000	AMOSITE	L 20%	SOLID	HP5 HP7 16 YARD CLOSED	
WHITE ASBESTOS	1 7 0 6 0 5	2000	AMOSITE	L 20%	SOLID	HP5 HP7 16 YARD CLOSED	

The information given below is to be completed for each EWC identified

EWC code	UN identification number(s)	Proper shipping name(s)	UN class(es)	Packing group(s)	Special handling requirements
1 7 0 6 0 1	UN 2212	ASBESTOS AMPHIBOLE (AMOSITE)	9	PG II (E)	MANUAL ONLY
1 7 0 6 0 5	UN 2590	ASBESTOS CHRYSOTILE	9	PG III (E)	MANUAL ONLY

PART C Carrier's certificate

(If more than one carrier is used, please attach schedule for subsequent carriers. If schedule of carriers is attached tick here. ☐)

I certify that I today collected the consignment and that the details in A2, A4 and B3 are correct and I have been advised of any specific handling requirements.

Where this note comprises part of a multiple collection the round number and collection number are:

/

1 Carrier name: **NICK WOOD**

On behalf of (name, address, postcode, telephone, e-mail, facsimile):

G. J. Bowmer (Waste Disposal) Ltd, Fairview, Magpie Lane, Essex, CM13 3DT

2 Carrier registration no./reason for exemption: **CBDU98031**

3 Vehicle registration no. (or mode of transport, if not road): **M3 GJB**

Signature **N wood**

Date **23 08 2019** Time **7 H 49**

PART D Consignor's certificate

I certify that the information in A, B and C has been completed and is correct, that the carrier is registered or exempt and was advised of the appropriate precautionary measures. All of the waste is packaged and labelled correctly and the carrier has been advised of any special handling requirements.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011.

1 Consignor name: **C SMITH**

On behalf of (name, address, postcode, telephone, e-mail, facsimile):

**INNER CITY ENVIRONMENTAL, UNIT 5 SCHOONER
PARK SCHOONER COURT, CROSSWAYS BUSINESS
PARK, DARTFORD, KENT, DA2 6NW**

Signature **[Signature]**

Date **23 08 2019** Time **7 H 49**

PART E Consignee's certificate (where more than one waste type is collected all of the information given below must be completed for each EWC)

Individual EWC code(s) received	Quantity of each EWC code received (kg)	EWC code accepted/rejected	Waste management operation (R or D code)

1 I received this waste at the address given in A4 on: Date **D D M M Y Y Y Y** Time **H H M M**

2 Vehicle registration no. (or mode of transport if not road):

3 Where waste is rejected please provide details:

I certify that waste permit/exempt waste operation number:

authorises the management of the waste described in B at the address given in A4.

Where the consignment forms part of a multiple collection, as identified in Part C, I certify that the total number of consignments forming the collection are:

Name:

On behalf of (name, address, postcode, telephone, e-mail, facsimile):

Signature

Date **D D M M Y Y Y Y** Time **H H M M**

The Hazardous Waste Regulations 2005: Consignment Note

MAG
DEMOLITION SITE SERVICES

PART A Notification details

- 1 Consignment note code: **RCOLLAIRCO10DF**
- 2 The waste described below is to be removed from (name, address, postcode, telephone, e-mail, facsimile):
R. COLLARD
STONE CLOSE, WEST DRAYTON,
UB7 8HT
- 3 The waste will be taken to (name, address and postcode):
MAG PROPERTIES SERVICES LTD
18 BURN MIA, HARLOW, ESSEX, CM20 2HS
JAMES@MAGLTD.CO.UK 07831 331769
- 4 The waste producer was (if different from 2) (name, address, postcode, telephone, e-mail, facsimile):
AS A2

PART B Description of the waste
If continuation sheet used, tick here ☐

- 1 The process giving rise to the waste(s) was: **DEMOLITION**
- 2 SIC (2007) for the process giving rise to the waste: **43.11.1**
- 3 WASTE DETAILS (where more than one waste type is collected all of the information given below must be completed for each EWC identified)

Description of waste	List of wastes (EWC code)(6 digits)	Quantity (kg)	The chemical/biological components in the waste and their concentrations are:		Physical form (gas, liquid, solid, powder, sludge or mixed)	Hazard code(s)	Container type, number and size
			Component	Concentration (% or mg/kg)			
WASTE OIL	130208	800 L	DIESEL	UP TO 100%	LIQUID	H3/14	1.0.6 x 1

The information given below is to be completed for each EWC identified

EWC code	UN identification number(s)	Proper shipping name(s)	UN class(es)	Packing group(s)	Special handling requirements
130208	1203	WASTE OIL	3	II	PPC

PART C Carrier's certificate

(If more than one carrier is used, please attach schedule for subsequent carriers. If schedule of carriers is attached tick here. ☐)

I certify that I today collected the consignment and that the details in A2, A3 and B3 are correct and I have been advised of any specific handling requirements.

Where this note comprises part of a multiple collection the round number and collection number are:

1

- 1 Carrier name: **DEAN FILLER**
On behalf of (name, address, postcode, telephone, e-mail, facsimile):
AS A3

- 2 Carrier registration no./reason for exemption: **CBDU 116034**

- 3 Vehicle registration no. (or mode of transport, if not road): **KN 17 HHB**

Signature **[Signature]**

Date **19 09 2019** Time **11:00**

PART D Consignor's certificate

I certify that the information in A, B and C has been completed and is correct, that the carrier is registered or exempt and was advised of the appropriate precautionary measures. All of the waste is packaged and labelled correctly and the carrier has been advised of any special handling requirements.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011.

- 1 Consignor name: **x J. Kneen**
On behalf of (name, address, postcode, telephone, e-mail, facsimile):
AS A2

Signature **X [Signature]**

Date **19 09 2019** Time **11:00**

PART E Consignee's certificate (where more than one waste type is collected all of the information given below must be completed for each EWC)

Individual EWC code(s) received	Quantity of each EWC code received (kg)	EWC code accepted/rejected	Waste management operation (R or D code)
130208	800 L	ACCEPTED	R13

- 1 I received this waste at the address given in A3 on: Date **19 09 2019** Time **13:00**

- 2 Vehicle registration no. (or mode of transport if not road): **KN 17 HHB**

- 3 Where waste is rejected please provide details: **-**

I certify that waste permit/exempt waste operation number:

WEX 131086

authorises the management of the waste described in B at the address given in A3.

Where the consignment forms part of a multiple collection, as identified in Part C, I certify that the total number of consignments forming the collection are: **-**

Name: **DEAN FILLER**
On behalf of (name, address, postcode, telephone, e-mail, facsimile):
AS A3

Signature **[Signature]**

Date **19 09 2019** Time **13:00**



MAG Properties Services Ltd



MAG Properties Services Ltd
52 Bullwell Crescent
Cheshunt, Hertfordshire
EN8 9HG

Office: 01707879890
Mobile: 07831331269
E-mail: Mark@magltd.co.uk
James@magltd.co.uk

CERTIFICATE OF GAS FREE TANK

<u>Company Details:</u> R. COLLARD	<u>Site Details:</u> STONE CLOSE, WEST DRAUGHTON, UB7 8HT
--	---

DATE OF TEST	19/09/19
TANK SIZE / NUMBER	1 # 2,000 L
TANK LOCATION	OUTSIDE
CONTENTS OF OIL REMOVED	DIESEL
VOLUME OF OIL REMOVED	800 L
GAS SENSOR SERIAL NO.	KA 417 - 1075924
PASS/FAIL	PASS

This document is to certify that the tanks listed as shown on certificate are in a Gas Free condition and that they are safe to dismantle and dispose of.

Engineers Signature: D. FILLER 	Notes:
Site Authorised person Signature: 	


C6194 Stone Close - Disposal log

Date	TicketNo	TippTicket	EWCCode	WasteType	Netweight	VehicleReg	OutletCode
23/10/2019	618784		170101	Concrete	19000	KX12 WGN	ERI
23/10/2019	618785		170101	Concrete	19000	KM13 NGZ	ERI
					38000		
02/09/2019 00:00	580908	583400	170201	WOOD	4240	RF12XLO	RCS
02/09/2019 00:00	580909	583629	170201	WOOD	3040	RF12XLO	RCS
					7280		
28/08/2019 00:00	579727	t003046	170401	MIXED NON FERROUS	360	RE15JZC	WOK
					360		
06/09/2019 00:00	585938	T003261\1	170405	LIGHT IRON	6400	KX64 TSZ	RCS
10/09/2019 00:00	587919	6532745	170405	LIGHT IRON	6020	RF12XLO	RCS
11/09/2019 00:00	589446	6532866	170405	SHEERING (STEEL)	8210	MC12 MCW	RCS
11/09/2019 00:00	589447	t003360\1	170405	SHEERING (STEEL)	7680	MC12 MCW	RCS
16/09/2019 00:00	352571	6533137	170405	SHEERING (STEEL)	9830	WU18FLR	RCS
16/09/2019 00:00	352573	6533189	170405	SHEERING (STEEL)	7810	WU18FLR	RCS
16/09/2019 00:00	592315	T003454\1	170405	LIGHT IRON	6280	WU18FLR	RCS
17/09/2019 00:00	592313	6533231	170405	LIGHT IRON	6200	WU18FLR	RCS
17/09/2019 00:00	593815	6533258	170405	LIGHT IRON	6490	WU18FLR	RCS
17/09/2019 00:00	593816	T003474\1	170405	LIGHT IRON	6600	WU18FLR	RCS
18/09/2019 00:00	594990	6533357	170405	LIGHT IRON	5950	WU18FLR	RCS
18/09/2019 00:00	594994	6533408	170405	SHEERING (STEEL)	7950	WU18FLR	RCS
18/09/2019 00:00	594995	6533330	170405	SHEERING (STEEL)	8150	WU18FLR	RCS
19/09/2019 00:00	596599	T003528\1	170405	SHEERING (STEEL)	10000	WU18FLR	RCS
24/09/2019 00:00	599358	6533822	170405	SHEERING (STEEL)	8720	WU18FLR	RCS
07/10/2019 00:00	606994	6534774	170405	REBAR	10720	WU18FLR	RCS
07/10/2019 00:00	606995	6534748	170405	CONSTRUCTIONAL (STEEL)	4540	WU18FLR	RCS
16/10/2019 00:00	613808	T004094\1	170405	SHEERING (STEEL)	16640	WU18FLR	RCS
					144190		

17/10/2019 00:00	614489	614489	170503	HAZARDOUS MUCK AWAY TIPPER	17760	.GF14 WUB	MICK
17/10/2019 00:00	614490	614490	170503	HAZARDOUS MUCK AWAY TIPPER	17740	.GN64 SUH	MICK
					35500		
02/09/2019 00:00	580913	486415	170605	ASBESTOS	7160	RF12XLO	RCS
09/09/2019 00:00	585909	487787	170605	ASBESTOS	11020	WU18 FLV	RES
16/10/2019 00:00	613288	497212	170605	ASBESTOS	9360	WU18 FLV	RES
					27540		
16/10/2019 00:00	614207	497232	170605	170605 ASBESTOS CONTAMINATED HARDCORE	19000	.KX17 MWLF	HILL
					19000		
02/09/2019 00:00	580904	583152	170904	GENERAL BUILDERS RUBBISH	7200	RF12XLO	RCS
10/09/2019 00:00	587920	589580	170904	GENERAL BUILDERS RUBBISH	9740	RF12XLO	RCS
10/09/2019 00:00	587922	589895	170904	GENERAL BUILDERS RUBBISH	8400	RF12XLO	RCS
16/09/2019 00:00	368712	26716507	170904	GENERAL BUILDERS RUBBISH	16840	BO55MCW	RCS
17/09/2019 00:00	594545	26720802	170904	GENERAL BUILDERS RUBBISH	15480	KX64TPU	RCS
18/09/2019 00:00	385052	26724319	170904	GENERAL BUILDERS RUBBISH	15920	RC10RRY	RCS
23/09/2019 00:00	598434	26735369	170904	GENERAL BUILDERS RUBBISH	21660	JC10RRY	RCS
24/09/2019 00:00	599354	600875	170904	GENERAL BUILDERS RUBBISH	7700	WU18FLR	RCS
					102940		

C6194 Stone Close - Disposal Chart

Description	Waste Code	Process	KG	Tonnes	%	% to landfill
Concrete	17.01.01	Recycled	38000	38.000	12.06%	
Wood	17.02.01	Recycled	7280	7.280	2.31%	
Non Ferrous Metal	17.04.01	Recycled	360	0.360	0.11%	
Light Iron	17.04.05	Recycled	144190	144.190	45.76%	
Hazardous Muck away	17.05.03	Landfill	35550	35.550	11.28%	11.28%
Asbestos	17.06.05	Landfill	5760	5.760	1.83%	1.83%
Asbestos Contaminated Hardcore	17.06.05	Landfill	19000	19.000	6.03%	6.03%
General Rubbish (Recycle)	17.09.04	98% Recycled	100881.2	100.881	32.02%	
General Rubbish (Landfill)	17.09.04	2% Landfill	2058.8	2.059	0.65%	0.65%
TOTALS				315.080	100.00%	19.79%
PERCENTAGE RECYCLED					80.21%	

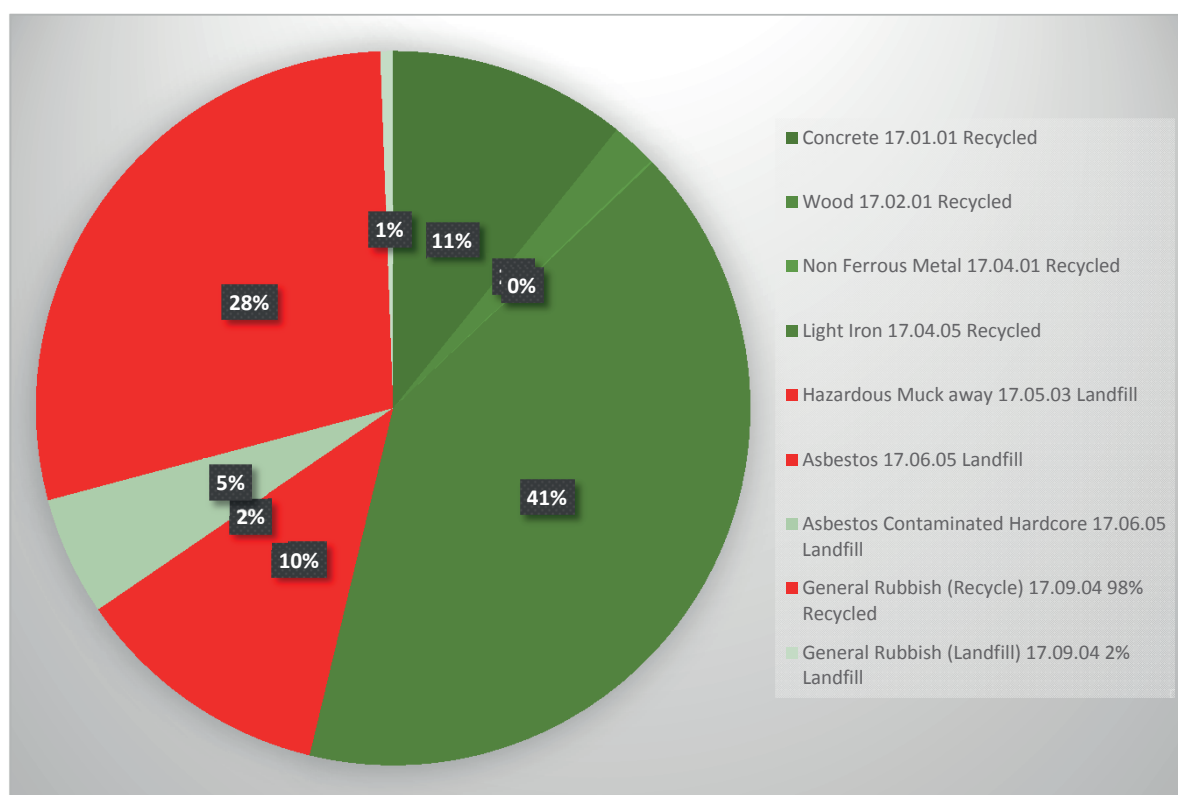

R-COLLARD

Demolish • Dispose • Recycle

R. Collard Ltd, Eversley Haulage Park, Brickhouse Hill, Eversley, Hook, Hants, RG27 0PZ

Tel 01252 844688 Fax 01252 844668

www.rcollard.com



Waste Carriers Reg. No: CBDU96607 (Expires 22/03/22) VAT Reg. No: GB 927 5290 06

'recycling the past for the future'

WASTE TRANSFER / MATERIAL DELIVERY TICKET

Customer: DEMORJC		Order No:	Date: 23/10/19	Ticket No: 618784
Container: 8 WHEEL TIPPER LORRY		Waste:	Material: CONCRETE	Vehicle Reg: .KX12 WGN
Delivery Address: SIC 43110		E.W.C. 170101	Driver: ROBIN HOWARD	Signed: <i>R Howard</i>
Demo RJC C6194 501-504 STONE CLOSE WEST DRAYTON UB7 8JU				
Time on site:	☐ 17.01.07	Clean Hardcore (Brick/Concrete)	WE ACCEPT NO LIABILITY FOR ANY DAMAGE CAUSED IF CUSTOMER(S) ASK FOR THE VEHICLE TO BE TAKEN OFF THE PUBLIC HIGHWAY. THE CUSTOMER SHALL ALSO PROVIDE AND CLEARLY INDICATE TO OUR DRIVER A SAFE ROUTE FROM THE PUBLIC HIGHWAY TO THE POINT OF DISCHARGE AND THE CUSTOMER SHALL INDEMNIFY US, OUR SERVANTS AND AGENTS FOR ANY DAMAGE OR INJURY RESULTING FROM ANY FAILURE TO DO SO. AN UNSIGNED TICKET IS NOT A VALID REASON FOR NON-PAYMENT OF INVOICE. N.B. TO CUSTOMERS, AUTHORISED AGENTS, REPRESENTATIVES, OR RESPONSIBLE PERSONS SIGNING THIS DELIVERY TICKET, THIS IS IN YOUR INTEREST. PLEASE READ THIS TICKET CAREFULLY AND INSPECT MATERIAL, AGREEING QUANTITY, LOCATION AND TIME OF DELIVERY. SATISFACTION BEFORE FINALLY SIGNING THIS RECEIPT NOTE. WE REGRET WE CANNOT UNDER ANY CIRCUMSTANCES, RETURN OR REFUND ANY MONEY CONCERNING QUANTITY OR QUALITY, ONCE THE VEHICLE HAS LEFT THE SITE AND A CLEAR SIGNATURE HAS BEEN GIVEN. WE CANNOT ACCEPT RESPONSIBILITY FOR DAMAGE CAUSED BY OUR VEHICLES WHILE DELIVERING TO YOUR SITE. ALL MATERIALS DELIVERED TO SITE REMAIN THE PROPERTY OF THE VENDOR UNTIL PAID FOR IN FULL. CERTIFIED THAT THE ABOVE PARTICULARS ARE TRUE AND RELATE TO THE AGGREGATES, SUB-BASED MATERIALS AND ARISING MATERIALS BEING CONVEYED OR DISPOSED OF IN PURSUANCE OF THE SALE. ALL RECYCLED AGGREGATES SUPPLIED HAVE BEEN PRODUCED TO A QUALITY MANAGEMENT SCHEME CONFORMING TO THE WRAP QUALITY PROTOCOL. I CONFIRM THAT I HAVE FULFILLED MY DUTY TO APPLY THE WASTE HIERARCHY AS REQUIRED BY REGULATION 12 OF THE WASTE (ENGLAND AND WALES) REGULATIONS 2011	
Time left site:	☐ 17.05.04	Soil & Stones (Inert)		
Travelling to and from site:	☐ 17.09.04	Mixed Construction (Rubbish)		
	☐ 20.02.01	Garden/Park Waste (Biodegradable)		
Address of tip / transfer point:		☐ Other (specify)		
		GROSS WEIGHT	VOLUME	NET
		TARE WEIGHT		VAT
		NET WEIGHT		TOTAL
			I understand and accept the conditions of hire printed above.	
			I confirm that the description of waste and the above details are correct.	
			Signed	<i>[Signature]</i>
			Print Name	Howe
			Date	

This ticket is issued subject to the company's Terms & Conditions printed above

White - Accounts Pink - Tip Green - File Yellow - Customer

Std doc 041 Revision 01

Demolish • Dispose • Recycle

R.Collard Ltd, Eversley Haulage Park, Brickhouse Hill, Eversley, Hook, Hants, RG27 0PZ

Tel 01252 844688 **Fax** 01252 844668

www.rcollard.com



'recycling the past for the future'

WASTE TRANSFER / MATERIAL DELIVERY TICKET

Waste Carriers Reg. No: CBDU96607 (Expires 22/03/22) VAT Reg. No: GB 927 5290 06

Customer: DEMORJJC		Order No: 170101				Ticket No: 618785	
Container: A WHEEL TIPPER		Waste: LORRY				Vehicle Reg: KM13 NGZ	
Delivery Address: SIC 43110		E.W.C. 170101		Driver: LUKE TRUSSLER		Signed:	
Demo RJC C6194						We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a safe route from the public highway to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.	
501-504 STONE CLOSE						An unsigned ticket is not a valid reason for non-payment of invoice.	
WEST DRAYTON						N.B. to customers, authorised agents, representatives, or responsible persons signing this delivery ticket, this is in your interest, please read this ticket carefully, and inspect material agreeing quantity, condition and description. If you are not satisfied with the quantity, condition or description, we cannot, under any circumstances, entertain any claims concerning quantity or quality, once the vehicle has left the site and a clear signature has been given.	
UB7 8JU						We cannot accept responsibility for damage caused by our vehicles while delivering to your site. All materials delivered to site remain the property of the vendor until paid for in full.	
Time on site:		☐ 17.01.07		Clean Hardcore (Brick/Concrete)		Certified that the above particulars are true and relate to the aggregates, sub-based materials and arising materials being conveyed or disposed of in pursuance of the sale.	
Time left site:		☐ 17.05.04		Soil & Stones (net)		All recycled aggregates supplied have been produced to a quality management scheme conforming to the WRAP quality protocol.	
Travelling to and from site:		☐ 17.09.04		Mixed Construction (Rubbish)		I confirm that I have fulfilled my duty to apply the waste hierarchy as required by regulation 12 of the waste (England and Wales) regulations 2011.	
		☐ 20.02.01		Garden/Park Waste (Biodegradable)			
		☐ Other (specify)					
Address of tip / transfer point:				VOLUME		NET	
				GROSS WEIGHT		VAT	
				TARE WEIGHT			
				NET WEIGHT		TOTAL	
						Signed	
						Print Name	
						Date	
						I understand and accept the conditions of hire printed above.	
						I confirm that the description of waste and the above details are correct.	

This ticket is issued subject to the company's Terms & Conditions printed above

White - Accounts Pink - Tip Green - File Yellow - Customer



R COLLARD SKIPS EVERSLEY
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
RG27 0PZ
Phone : 01252 844688
Fax : 01252 844668
Email : info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE

Order No: 350303

Ticket Number: 580908

Cash Sale: No

Date: 02/09/2019

Product: 40YD ROLL ON-OFF

Customer Order No: simon

Time On Site: 10:48

Time Start:

Time Stop:

Time Complete: 10:54

Waste Type: 170201 - WOOD

170201 - WOOD

Parking Ticket: No

Parking Ticket Value: £0.00

Cancelled: No

Cancelled Reason:

Skip Col No: 25b

Skip Del No: na

Notes:

Tally 1:

Tally 2:

Gross Weight: 21,660.00

Tare Weight: 17,420.00

Net Weight: 4,240.00

SIC Code: 43110

EWG Code: 170201

Disposal Site: QUARRY WOOD SHREDDING IN

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of Invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: RF12XLO

Driver: NICK FRY

Waste Management Licence No. EPR/QP3490EA/V002

Waste Carrier Licence No. CBDU/96607

Customer: J King

Driver: NICK FRY



R COLLARD SKIPS EVERSLEY
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
RG27 0PZ
Phone : 01252 844688
Fax : 01252 844668
Email : info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE

Order No: 350303

Ticket Number: 580909

Cash Sale: No

Date: 02/09/2019

Product: 40YD ROLL ON-OFF

Customer Order No: simon

Time On Site: 13:45

Time Start:

Time Stop:

Time Complete: 13:59

Waste Type: 170201 - WOOD

170201 - WOOD

Parking Ticket: No

Parking Ticket Value: £0.00

Cancelled: No

Cancelled Reason:

Skip Col No: 008

Skip Del No: 35b

Notes:

Tally 1:

Tally 2:

Gross Weight: 20,460.00

Tare Weight: 17,420.00

Net Weight: 3,040.00

SIC Code: 43110

EWG Code: 170201

Disposal Site: QUARRY WOOD SHREDDING IN

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY, SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: RF12XLO

Driver: NICK FRY

Waste Management Licence No. EPR/QP3490EA/V002

Waste Carrier Licence No. CBDU/96607

Customer: J King

Driver: NICK FRY



3.5 TONNER
Fax : 01252 844668
Email : info@rcollard.com
Company Reg. No. : 3002310

Type: WAIT & LOAD

Order No: 350180

Ticket Number: 579727

Cash Sale: No

Date: 28/08/2019

Product: 3.5 TONNER

Customer Order No:

Time On Site: 10:10

Time Start:

Time Stop:

Time Complete: 10:10

Waste Type: 16-MIXED NON FERROUS
MIXED NON FERROUS

Parking Ticket: No

Parking Ticket Value: £0.00

Cancelled: No

Cancelled Reason:

Skip Col No:

Skip Del No:

Notes: Collect Mixed Non Ferrous from
Stone Close, West Drayton, UB7 8JU and
Deliver to Wokingham Scrap Yard

Tally 1:

Tally 2:

Gross Weight: 0.00

Tare Weight: 0.00

Net Weight: 360.00

SIC Code: 000002

EWC Code: 170401

Disposal Site: Wokingham Scrap Yard

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVs, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of Invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
FEASIBILITY 501-504
UB7 8JU

Vehicle: RE15JZC

Driver: DAVE CORDERY

Waste Management Licence No.

Waste Carrier Licence No. CBDU/96607

Customer: Jking

Driver: DAVE CORDERY

J K

D



R COLLARD SKIPS EVERSLEY
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
RG27 0PZ
Phone : 01252 844688
Fax : 01252 844668
Email : info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE	Order No: 350720	Ticket Number: 587919	
Cash Sale: No	Date: 10/09/2019	Product: 40YD ROLL ON-OFF	Customer Order No: simon
Time On Site: 12:10	Time Start:	Time Stop:	Time Complete: 12:11
Waste Type: 20-LIGHT IRON LIGHT IRON			
Parking Ticket: No	Parking Ticket Value: £0.00	Cancelled: No	Cancelled Reason:
Skip Col No: 54	Skip Del No: yard	Notes:	
Tally 1:	Tally 2:		
Gross Weight: 0.00	Tare Weight: 0.00	Net Weight: 6,020.00	
SIC Code: 43110	EWC Code: 170405	Disposal Site: EMR BRENTFORD	

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of Invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: RF12XLO

Driver: CHARLES CAHILL

Waste Management Licence No. EPR/QP3490EA/V002

Waste Carrier Licence No. CBDU/96607

Customer: John king

Driver: CHARLES CAHILL



R COLLARD SKIPS EVERSLEY
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
RG27 0PZ
Phone : 01252 844688
Fax : 01252 844668
Email : info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE

Order No: 352547

Ticket Number: 613808

Cash Sale: No

Date: 16/10/2019

Product: 40YD ROLL ON-OFF

Customer Order |

Time On Site: 13:14

Time Start:

Time Stop:

Time Complete: .

Waste Type: 20-SHEERING (STEEL)
SHEERING STEEL

Parking Ticket: No

Parking Ticket Value: £0.00

Cancelled: No

Cancelled Reaso

Skip Col No: na

Skip Del No: na

Notes:

Tally 1:

Tally 2:

Gross Weight: 0.00

Tare Weight: 0.00

Net Weight: 16,640.00

SIC Code: 43110

EWC Code: 170405

Disposal Site: Wokingham Scrap Yard

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for th vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the poi of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of Invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: WU18FLR

Driver: ANTHONY BROWN

Waste Management Licence No. EPR/QP3490EA/V002

Waste Carrier Licence No. CBDU/96607

Customer: John

Driver: ANTHONY BROWN



R COLLARD SKIPS EVERSLEY
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
RG27 0PZ
Phone : 01252 844688
Fax : 01252 844668
Email : info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE

Order No: 350720

Ticket Number: 585938

Cash Sale: No

Date: 06/09/2019

Product: 40YD ROLL ON-OFF

Customer Order

Time On Site: 12:50

Time Start:

Time Stop:

Time Complete:

Waste Type: 20-LIGHT IRON
LIGHT IRON

Parking Ticket: No

Parking Ticket Value: £0.00

Cancelled: No

Cancelled Reason:

Skip Col No: yard

Skip Del No: rc25

Notes:

Tally 1:

Tally 2:

Gross Weight: 0.00

Tare Weight: 0.00

Net Weight: 6,400.00

SIC Code: 43110

EWC Code: 170405

Disposal Site: Wokingham Scrap Yard

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of Invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: KX64 TSZ

Driver: CHARLES CAHILL

Waste Management Licence No. EPR/QP3490EA/V002

Waste Carrier Licence No. CBDU/96607

Customer: John King

Driver: CHARLES CAHILL



R COLLARD SKIPS EVERSLEY
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
RG27 0PZ
Phone : 01252 844688
Fax : 01252 844668
Email : info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE	Order No: 351030	Ticket Number: 589446	
Cash Sale: No	Date: 11/09/2019	Product: 40YD ROLL ON-OFF	Customer Order No: simon
Time On Site: 13:11	Time Start:	Time Stop:	Time Complete: 13:27
Waste Type: 20-SHEERING (STEEL) SHEERING STEEL			
Parking Ticket: No	Parking Ticket Value: £0.00	Cancelled: No	Cancelled Reason:
Skip Col No: na	Skip Del No: na	Notes:	
Tally 1:	Tally 2:		
Gross Weight: 0.00	Tare Weight: 0.00	Net Weight: 8,210.00	
SIC Code: 43110	EWC Code: 170405	Disposal Site: EMR BRENTFORD	

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY, (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY, SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: MC12 MCW

Driver: NICK FRY

Waste Management Licence No. EPR/QP3490EA/V002

Waste Carrier Licence No. CBDU/96607

Customer: J King

Driver: NICK FRY



R COLLARD SKIPS EVERSLEY
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
RG27 0PZ
Phone : 01252 844688
Fax : 01252 844668
Email : Info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE

Order No: 351030

Ticket Number: 589447

Cash Sale: No

Date: 11/09/2019

Product: 40YD ROLL ON-OFF

Customer Order No: simon

Time On Site: 15:23

Time Start:

Time Stop:

Time Complete: 15:23

Waste Type: 20-SHEERING (STEEL)
SHEERING STEEL

Parking Ticket: No

Parking Ticket Value: £0.00

Cancelled: No

Cancelled Reason:

Skip Col No: na

Skip Del No: na

Notes:

Tally 1:

Tally 2:

Gross Weight: 0.00

Tare Weight: 0.00

Net Weight: 7,680.00

SIC Code: 43110

EWG Code: 170405

Disposal Site: Wokingham Scrap Yard

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of Invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: MC12 MCW

Driver: NICK FRY

Waste Management Licence No. EPR/QP3490EA/V002

Waste Carrier Licence No. CBDU/96607

Customer: J King

Driver: NICK FRY



R COLLARD SKIPS EVERSLEY
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
RG27 0PZ
Phone : 01252 844688
Fax : 01252 844668
Email : Info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE	Order No: 351030	Ticket Number: 352571	
Cash Sale: No	Date: 16/09/2019	Product: 40YD ROLL ON-OFF	Customer Order No: simon
Time On Site: 14:06	Time Start:	Time Stop:	Time Complete: 14:07
Waste Type: 20-SHEERING (STEEL) SHEERING STEEL			
Parking Ticket: No	Parking Ticket Value: £0.00	Cancelled: No	Cancelled Reason:
Skip Col No: na	Skip Del No: na	Notes:	
Tally 1:	Tally 2:		
Gross Weight: 0.00	Tare Weight: 0.00	Net Weight: 9,830.00	
SIC Code: 43110	EWC Code: 170405	Disposal Site: EMR BRENTFORD	

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: WU18FLR

Driver: NICK FRY

Waste Management Licence No. EPR/QP3490EA/V002

Waste Carrier Licence No. CBDU/96607

Customer: King

Driver: NICK FRY



R COLLARD SKIPS EVERSLEY
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
RG27 0PZ
Phone : 01252 844688
Fax : 01252 844668
Email : info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE

Order No: 351030

Ticket Number: 352573

Cash Sale: No

Date: 16/09/2019

Product: 40YD ROLL ON-OFF

Customer Order No: simon

Time On Site: 10:21

Time Start:

Time Stop:

Time Complete: 10:27

Waste Type: 20-SHEERING (STEEL)
SHEERING STEEL

Parking Ticket: No

Parking Ticket Value: £0.00

Cancelled: No

Cancelled Reason:

Skip Col No: na

Skip Del No: na

Notes:

Tally 1:

Tally 2:

Gross Weight: 0.00

Tare Weight: 0.00

Net Weight: 7,810.00

SIC Code: 43110

EWC Code: 170405

Disposal Site: EMR BRENTFORD

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: WU18FLR

Driver: NICK FRY

Waste Management Licence No. EPR/QP3490EA/V002

Waste Carrier Licence No. CBDU/96607

Customer: King

Driver: NICK FRY



R COLLARD SKIPS EVERSLEY
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
RG27 0PZ
Phone : 01252 844688
Fax : 01252 844668
Email : info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE	Order No: 350720	Ticket Number: 592315	
Cash Sale: No	Date: 16/09/2019	Product: 40YD ROLL ON-OFF	Customer Order No: simon
Time On Site: 16:13	Time Start:	Time Stop:	Time Complete: 16:14
Waste Type: 20-LIGHT IRON LIGHT IRON			
Parking Ticket: No	Parking Ticket Value: £0.00	Cancelled: No	Cancelled Reason:
Skip Col No: na	Skip Del No: yard bin	Notes:	
Tally 1:	Tally 2:		
Gross Weight: 0.00	Tare Weight: 0.00	Net Weight: 6,280.00	
SIC Code: 43110	EWC Code: 170405	Disposal Site: Wokingham Scrap Yard	

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: WU18FLR

Driver: NICK FRY

Waste Management Licence No. EPR/QP3490EA/V002

Waste Carrier Licence No. CBDU/96607

Customer: J King

Driver: NICK FRY



R COLLARD SKIPS EVERSLEY
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
RG27 0PZ
Phone : 01252 844688
Fax : 01252 844668
Email : info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE

Order No: 350720

Ticket Number: 592313

Cash Sale: No

Date: 17/09/2019

Product: 40YD ROLL ON-OFF

Customer Order No: simon

Time On Site: 08:56

Time Start:

Time Stop:

Time Complete: 09:00

Waste Type: 20-LIGHT IRON
LIGHT IRON

Parking Ticket: No

Parking Ticket Value: £0.00

Cancelled: No

Cancelled Reason:

Skip Col No: 54e

Skip Del No: 43e

Notes:

Tally 1:

Tally 2:

Gross Weight: 0.00

Tare Weight: 0.00

Net Weight: 6,200.00

SIC Code: 43110

EWC Code: 170405

Disposal Site: EMR BRENTFORD

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: WU18FLR

Driver: NICK FRY

Waste Management Licence No. EPR/QP3490EA/V002

Waste Carrier Licence No. CBDU/96607

Customer: J King

Driver: NICK FRY



R COLLARD SKIPS EVERSLEY
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
RG27 0PZ
Phone : 01252 844688
Fax : 01252 844668
Email : Info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE	Order No: 350720	Ticket Number: 593815	
Cash Sale: No	Date: 17/09/2019	Product: 40YD ROLL ON-OFF	Customer Order No: simon
Time On Site: 10:49	Time Start:	Time Stop:	Time Complete: 11:02
Waste Type: 20-LIGHT IRON LIGHT IRON			
Parking Ticket: No	Parking Ticket Value: £0.00	Cancelled: No	Cancelled Reason:
Skip Col No: 54er	Skip Del No: yard bin		Notes:
Tally 1:	Tally 2:		
Gross Weight: 0.00	Tare Weight: 0.00	Net Weight: 6,490.00	
SIC Code: 43110	EWC Code: 170405	Disposal Site: EMR BRENTFORD	

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: WU18FLR

Driver: NICK FRY

Waste Management Licence No. EPR/QP3490EA/V002

Waste Carrier Licence No. CBDU/96607

Customer: J King

Driver: NICK FRY



R COLLARD SKIPS EVERSLEY
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
RG27 0PZ
Phone : 01252 844688
Fax : 01252 844668
Email : info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE

Order No: 350720

Ticket Number: 593816

Cash Sale: No

Date: 17/09/2019

Product: 40YD ROLL ON-OFF

Customer Order No: simon

Time On Site: 13:41

Time Start:

Time Stop:

Time Complete: 13:41

Waste Type: 20-LIGHT IRON
LIGHT IRON

Parking Ticket: No

Parking Ticket Value: £0.00

Cancelled: No

Cancelled Reason:

Skip Col No: 54r

Skip Del No: yard

Notes:

Tally 1:

Tally 2:

Gross Weight: 0.00

Tare Weight: 0.00

Net Weight: 6,600.00

SIC Code: 43110

EWG Code: 170405

Disposal Site: Wokingham Scrap Yard

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: WU18FLR

Driver: NICK FRY

Waste Management Licence No. EPR/QP3490EA/V002

Waste Carrier Licence No. CBDU/96607

Customer: J King

Driver: NICK FRY



R COLLARD SKIPS EVERSLEY
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
RG27 0PZ
Phone : 01252 844688
Fax : 01252 844668
Email : info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE	Order No: 350720	Ticket Number: 594990	
Cash Sale: No	Date: 18/09/2019	Product: 40YD ROLL ON-OFF	Customer Order No: simon
Time On Site: 10:07	Time Start:	Time Stop:	Time Complete: 10:14
Waste Type: 20-LIGHT IRON LIGHT IRON			
Parking Ticket: No	Parking Ticket Value: £0.00	Cancelled: No	Cancelled Reason:
Skip Col No: yard	Skip Del No: 43e	Notes:	
Tally 1:	Tally 2:		
Gross Weight: 0.00	Tare Weight: 0.00	Net Weight: 5,950.00	
SIC Code: 43110	EWC Code: 170405	Disposal Site: EMR BRENTFORD	

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of Invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: WU18FLR

Driver: NICK FRY

Waste Management Licence No. EPR/QP3490EA/V002

Waste Carrier Licence No. CBDU/96607

Customer: J King

Driver: NICK FRY



R COLLARD SKIPS EVERSLEY
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
RG27 0PZ
Phone : 01252 844688
Fax : 01252 844668
Email : info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE

Order No: 351030

Ticket Number: 594994

Cash Sale: No

Date: 18/09/2019

Product: 40YD ROLL ON-OFF

Customer Order No: simon

Time On Site: 13:22

Time Start:

Time Stop:

Time Complete: 13:23

Waste Type: 20-SHEERING (STEEL)
SHEERING STEEL

Parking Ticket: No

Parking Ticket Value: £0.00

Cancelled: No

Cancelled Reason:

Skip Col No: na

Skip Del No: na

Notes:

Tally 1:

Tally 2:

Gross Weight: 0.00

Tare Weight: 0.00

Net Weight: 7,950.00

SIC Code: 43110

EWC Code: 170405

Disposal Site: EMR BRENTFORD

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of Invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: WU18FLR

Driver: NICK FRY

Waste Management Licence No. EPR/QP3490EA/V002

Waste Carrier Licence No. CBDU/96607

Customer: J King

Driver: NICK FRY



R COLLARD SKIPS EVERSLEY
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
RG27 0PZ
Phone : 01252 844688
Fax : 01252 844668
Email : Info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE

Order No: 351030

Ticket Number: 594995

Cash Sale: No

Date: 18/09/2019

Product: 40YD ROLL ON-OFF

Customer Order No: simon

Time On Site: 08:07

Time Start:

Time Stop:

Time Complete: 08:22

Waste Type: 20-SHEERING (STEEL)
SHEERING STEEL

Parking Ticket: No

Parking Ticket Value: £0.00

Cancelled: No

Cancelled Reason:

Skip Col No: na

Skip Del No: 33e

Notes:

Tally 1:

Tally 2:

Gross Weight: 0.00

Tare Weight: 0.00

Net Weight: 8,150.00

SIC Code: 43110

EWC Code: 170405

Disposal Site: EMR BRENTFORD

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of Invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: WU18FLR

Driver: NICK FRY

Waste Management Licence No. EPR/QP3490EA/V002

Waste Carrier Licence No. CBDU/96607

Customer: J King

Driver: NICK FRY



R COLLARD SKIPS EVERSLEY
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
RG27 0PZ
Phone : 01252 844688
Fax : 01252 844668
Email : info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE	Order No: 351622	Ticket Number: 596599	
Cash Sale: No	Date: 19/09/2019	Product: 40YD ROLL ON-OFF	Customer Order No: simon
Time On Site: 11:45	Time Start:	Time Stop:	Time Complete: 11:46
Waste Type: 20-SHEERING (STEEL) SHEERING STEEL			
Parking Ticket: No	Parking Ticket Value: £0.00	Cancelled: No	Cancelled Reason:
Skip Col No: yard	Skip Del No: na	Notes:	
Tally 1:	Tally 2:		
Gross Weight: 0.00	Tare Weight: 0.00	Net Weight: 10,000.00	
SIC Code: 43110	EWC Code: 170405	Disposal Site: Wokingham Scrap Yard	

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: WU18FLR

Driver: NICK FRY

Waste Management Licence No. EPR/QP3490EA/V002

Waste Carrier Licence No. CBDU/96607

Customer: J King

Driver: NICK FRY



R COLLARD SKIPS EVERSLEY
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
RG27 0PZ
Phone : 01252 844688
Fax : 01252 844668
Email : Info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE	Order No: 352547	Ticket Number: 606994	
Cash Sale: No	Date: 07/10/2019	Product: 40YD ROLL ON-OFF	Customer Order No: simon
Time On Site: 11:38	Time Start:	Time Stop:	Time Complete: 11:38
Waste Type: 20-REBAR REBAR			
Parking Ticket: No	Parking Ticket Value: £0.00	Cancelled: No	Cancelled Reason:
Skip Col No: na	Skip Del No: na		Notes:
Tally 1:	Tally 2:		
Gross Weight: 0.00	Tare Weight: 0.00	Net Weight: 10,720.00	
SIC Code: 43110	EWC Code: 170405	Disposal Site: EMR BRENTFORD	

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: WU18FLR

Driver: NICK FRY

Waste Management Licence No. EPR/QP3490EA/V002

Waste Carrier Licence No. CBDU/96607

Customer: J King

Driver: NICK FRY



R COLLARD SKIPS EVERSLEY
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
RG27 0PZ
Phone : 01252 844688
Fax : 01252 844668
Email : info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE	Order No: 351829	Ticket Number: 606995	
Cash Sale: No	Date: 07/10/2019	Product: 40YD ROLL ON-OFF	Customer Order No: simon
Time On Site: 09:50	Time Start:	Time Stop:	Time Complete: 10:10
Waste Type: 20-CONSTRUCTIONAL (STEEL) CONSTRUCTIONAL (STEEL)			
Parking Ticket: No	Parking Ticket Value: £0.00	Cancelled: No	Cancelled Reason:
Skip Col No: 33e	Skip Del No: na	Notes:	
Tally 1:	Tally 2:		
Gross Weight: 0.00	Tare Weight: 0.00	Net Weight: 4,540.00	
SIC Code: 43110	EWC Code: 170405	Disposal Site: EMR BRENTFORD	

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of Invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: WU18FLR

Driver: NICK FRY

Waste Management Licence No. EPR/QP3490EA/V002

Waste Carrier Licence No. CBDU/96607

Customer: J King

Driver: NICK FRY



R COLLARD SKIPS EVERSLEY
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
RG27 0PZ
Phone : 01252 844688
Fax : 01252 844668
Email : Info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE

Order No: 351829

Ticket Number: 599358

Cash Sale: No

Date: 24/09/2019

Product: 40YD ROLL ON-OFF

Customer Order No: simon

Time On Site: 10:01

Time Start:

Time Stop:

Time Complete: 10:02

Waste Type: 20-SHEERING (STEEL)
SHEERING STEEL

Parking Ticket: No

Parking Ticket Value: £0.00

Cancelled: No

Cancelled Reason:

Skip Col No: na

Skip Del No: 33e

Notes:

Tally 1:

Tally 2:

Gross Weight: 0.00

Tare Weight: 0.00

Net Weight: 8,720.00

SIC Code: 43110

EW Code: 170405

Disposal Site: EMR BRENTFORD

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: WU18FLR

Driver: NICK FRY

Waste Management Licence No. EPR/QP3490EA/V002

Waste Carrier Licence No. CBDU/96607

Customer: J King

Driver: NICK FRY

R. COLLARD

Demolish • Dispose • Recycle

R. Collard Ltd, Eversley Haulage Park, Brickhouse Hill, Eversley, Hants, RG27 0PZ

Tel 01252 844688 Fax 01252 844668

www.rcollard.com



'recycling the past for the future'

Waste Carriers Reg. No: CBDU96607 (Expires 22/03/22) VAT Reg. No: GB 927 5290 06

WASTE TRANSFER / MATERIAL DELIVERY TICKET

Customer: USMORJC		Order No:	Date: 17/10/19	Ticket No: 614490
Container: 8 WHEEL TIPPER LORRY		Waste:	Material: HAZARDOUS MUCK AWAY	Vehicle Reg: .GN64 SUH
Delivery Address: SIC 43110 Demo RJ C6194 501-504 STONE CLOSE WEST DRAYTON UB7 8JU		E.W.C. 170503	Driver: DAVE GLOSSOP	Signed:
WE ACCEPT NO LIABILITY FOR ANY DAMAGE CAUSED IF CUSTOMER(S) ASK FOR THE VEHICLE TO BE TAKEN OFF THE SITE. THE VEHICLE IS TO BE TAKEN OFF THE SITE AT THE CUSTOMER'S RISK AND AT THE CUSTOMER'S EXPENSE. THE CUSTOMER(S) MUST PROVIDE A CLEAR ROUTE TO THE PUBLIC HIGHWAY TO THE POINT OF DISCHARGE OF THE WASTE. THE CUSTOMER(S) MUST INDEMNIFY US, OUR SERVANTS AND AGENTS FOR ANY DAMAGE OR INJURY RESULTING FROM ANY FAILURE TO DO SO. AN UNSIGNED TICKET IS NOT A VALID REASON FOR NON-PAYMENT OF INVOICE. N.B. TO CUSTOMERS, AUTHORISED AGENTS, REPRESENTATIVES, OR RESPONSIBLE PERSONS SIGNING THIS DELIVERY TICKET, THIS IS IN YOUR INTEREST, PLEASE READ THIS TICKET CAREFULLY AND IN FULL. THE TICKET IS YOUR PROPERTY AND IT MUST BE RETURNED TO US WITHIN 14 DAYS OF THE DATE OF DELIVERY. IF IT IS NOT, WE WILL BE FORCED TO RE-PRINT THE TICKET AND CHARGE YOU THE COST OF DOING SO. WE CANNOT ACCEPT RESPONSIBILITY FOR DAMAGE CAUSED BY OUR VEHICLES WHILE DELIVERING TO YOUR SITE. ALL MATERIALS DELIVERED TO SITE REMAIN THE PROPERTY OF THE VENDOR UNTIL PAID FOR IN FULL. CERTIFIED THAT THE ABOVE PARTICULARS ARE TRUE AND RELATE TO THE AGGREGATES, SUB-BASED MATERIALS AND ARISING MATERIALS BEING CONVEYED OR DISPOSED OF IN PURSUANCE OF THE SALE. ALL RECYCLED AGGREGATES SUPPLIED HAVE BEEN PRODUCED TO A QUALITY MANAGEMENT SCHEME CONFORMING TO THE WRAP QUALITY PROTOCOL. I CONFIRM THAT I HAVE FULFILLED MY DUTY TO APPLY THE WASTE HIERARCHY AS REQUIRED BY REGULATION 12 OF THE WASTE (ENGLAND AND WALES) REGULATIONS 2011				
Time on site: ☐ 17.01.97 ☐ 17.05.04 ☐ 17.09.04 ☐ 20.02.01 ☐ Other (specify)		Clean Hardcore (Brick/Concrete) Soil & Stones (Inert) Mixed Construction (Rubbish) Garden/Park Waste (Biodegradable)		
Time left site:				
Travelling to and from site:				
Address of tip / transfer point: TIPPING @ NICK GEORGE WAF139 92.		NET VOLUME VAT TOTAL		
I understand and accept the conditions of hire printed above.		I confirm that the description of waste and the above details are correct.		
Signed		Signed		
Print Name		Print Name		
Date		Date		

This ticket is issued subject to the company's Terms & Conditions printed above

White - Accounts Pink - Tip Green - File Yellow - Customer

Std doc 041, Revision 01

R-COLLARD

Dr molish • Dispose • Recycle

R. Collard Ltd, Ever
Stage Park, Brickhouse Hill, Eversley, Hook, Hants, RG27 0PZ
Tel 01252 844588 Fax 01252 844568
www.rcollard.com



recycling the past for t

Waste Certificate No: CBU96607 (Expires 22/03/22) VAT Reg. No: GB 927 5290 06

TRANSFER / MATERIAL DELIVERY TICKET

Customer: DEMURJC	Order No:	Date: 17/10/19	Ticket No: 614489
Container: 8 WHEEL - 6E	Waste: 4.1.1.1	Material: HAZARDOUS MUCK AWAY	Vehicle Reg: .GF14 WUB
Delivery Address: Demo RJ CG194 501- W. T. ATTON	E.W.C. 170503	Driver: DANIEL HASKINS	Signed:
WE ACCEPT NO LIABILITY FOR ANY DAMAGE CAUSED IF CUSTOMER(S) ASK FOR THE VEHICLE TO BE TAKEN TO THE TIP. THE CUSTOMER SHALL ALSO PROVIDE AND CLEARLY INDICATE TO OUR DRIVER A SAFE ROUTE TO THE TIP. WE WILL NOT BE RESPONSIBLE FOR ANY DAMAGE OR INJURY RESULTING FROM ANY FAILURE TO DO SO. AN UNSIGNED TICKET IS NOT A VALID REASON FOR NON-PAYMENT OF INVOICE. N.B. TO CUSTOMERS, AUTHORISED AGENTS, REPRESENTATIVES, OR RESPONSIBLE PERSONS, SIGNING THIS TICKET, THIS IS IN YOUR INTEREST PLEASE READ THIS TICKET CAREFULLY AND INSPECT MATERIAL AGREEING QUALITY AND THAT EVERYTHING IS TO YOUR SATISFACTION BEFORE FINALLY SIGNING THIS RECEIPT NOTE. WE CANNOT UNDER ANY CIRCUMSTANCES ENTERTAIN ANY CLAIMS CONCERNING QUANTITY OR QUALITY. VEHICLE HAS LEFT THE SITE AND A CLEAR SIGNATURE HAS BEEN GIVEN. WE CANNOT ACCEPT RESPONSIBILITY FOR DAMAGE CAUSED BY OUR VEHICLES WHILE DELIVERING TO YOU MATERIALS DELIVERED TO SITE REMAIN THE PROPERTY OF THE VENDOR UNTIL PAID FOR IN FULL. CERTIFIED THAT THE ABOVE PARTICULARS ARE TRUE AND RELATE TO THE AGGREGATES, SUB-BASED MATERIALS BEING CONVEYED OR DISPOSED OF IN FULLSANCE OF THE SALE. ALL RECYCLED AGGREGATES SUPPLIED HAVE BEEN PRODUCED TO A QUALITY MANAGEMENT SCHEME CONFIRMED BY THE WRAP QUALITY PROTOCOL. I CONFIRM THAT I HAVE FULFILLED MY DUTY TO APPLY THE WASTE HIERARCHY AS REQUIRED BY REGULATION 11 OF THE WASTE (ENGLAND AND WALES) REGULATIONS 2011.			
Address of tip / transfer point: TIPPING @ HICK GEORGE WAF139 92.		VOLUME	NET
GROSS WEIGHT		I understand and accept the conditions printed above.	
TARE WEIGHT		I confirm that the description of waste and the above details are correct.	
NET WEIGHT		Signed <u>DM</u>	
		Print Name <u>DM</u>	
		Date <u>17/10/19</u>	

White - Accounts Pink - Tip Green - File Yellow - Customer This ticket is issued subject to the company's Terms & Conditions printed

Type: COLLECTION	Order No: 350304	Ticket Number: 613288	
Cash Sale: No	Date: 16/10/2019	Product: 40YD ROLL ON-OFF	Customer Order I
Time On Site: 07:59	Time Start:	Time Stop:	Time Complete: (
Waste Type: 170605 170605 ASBESTOS			
Parking Ticket: No	Parking Ticket Value: £0.00	Cancelled: No	Cancelled Reaso
Skip Col No: 008	Skip Del No:		Notes:
Tally 1:	Tally 2:		
Gross Weight: 0.00	Tare Weight: 0.00	Net Weight: 9,360.00	
SIC Code: 43110	EWC Code: 170605	Disposal Site: HILLS	

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for th vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the poi of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of Invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: WU18 FLV

Driver: MERVYN PRIOR

Waste Management Licence No. EPR/EB3500KB

Waste Carrier Licence No. CBDU/96607

Customer: Jking

Driver: MERVYN PRIOR



READING SKIPS
128 CARDIFF ROAD
READING
RG1 8PQ
Phone : 01189590252
Fax : 01252 844668
Email : Info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE

Order No: 350304

Ticket Number: 580913

Cash Sale: No

Date: 02/09/2019

Product: 40YD ROLL ON-OFF

Customer Order No: simon

Time On Site: 15:43

Time Start:

Time Stop:

Time Complete: 15:44

Waste Type: 170605

170605 ASBESTOS

Parking Ticket: No

Parking Ticket Value: £0.00

Cancelled: No

Cancelled Reason:

Skip Col No: na

Skip Del No: 008

Notes:

Tally 1:

Tally 2:

Gross Weight: 0.00

Tare Weight: 0.00

Net Weight: 7,160.00

SIC Code: 43110

EWC Code: 170605

Disposal Site: HILLS

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of invoice.

Account Address:

DEMO RJC

Delivery Address:

DEMO RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: RF12XLO

Driver: NICK FRY

Waste Management Licence No. EPR/EB3500KB

Waste Carrier Licence No. CBDU/96607

Customer: J King

Driver: NICK FRY



READING SKIPS
128 CARDIFF ROAD
READING
RG1 8PQ
Phone : 01189590252
Fax : 01252 844668
Email : info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE	Order No: 350304	Ticket Number: 585909	
Cash Sale: No	Date: 09/09/2019	Product: 40YD ROLL ON-OFF	Customer Order No: simon
Time On Site: 07:48	Time Start:	Time Stop:	Time Complete: 07:49
Waste Type: 170605 170605 ASBESTOS			
Parking Ticket: No	Parking Ticket Value: £0.00	Cancelled: No	Cancelled Reason:
Skip Col No: rc	Skip Del No: rc	Notes:	
Tally 1:	Tally 2:		
Gross Weight: 0.00	Tare Weight: 0.00	Net Weight: 11,020.00	
SIC Code: 43110	EWC Code: 170605	Disposal Site: HILLS	

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: WU18 FLV

Driver: MERVYN PRIOR

Waste Management Licence No. EPR/EB3500KB

Waste Carrier Licence No. CBDU/96607

Customer: John King

Driver: MERVYN PRIOR

R-COLLARD

Demolish • Dispose • Recycle

R. Collard Ltd, Eversley Haulage Park, Brickhouse Hill, Eversley, Hook, Hants, RG27 0PZ

Tel 01252 844688 Fax 01252 844668

www.rcollard.com



'recycling the past for the future'

Waste Carriers Reg. No: CBDU96607 (Expires 22/03/22) VAT Reg. No: GB 927 5290 06

WASTE TRANSFER / MATERIAL DELIVERY TICKET

Customer: DEMORJC	Order No:	Date:	Ticket No:
Container: 8 WHEEL TIPPER LORRY	Waste:	Material:	Vehicle Reg:
Delivery Address: SIC 43110 Demo RJ CG194 501-504 STONE CLOSE WEST DRAYTON UB7 8JU	E.W.C.	170605 COLLIN SIMMONS	614207 RX17 HWP
Signed:		Signed:	
WE ACCEPT NO LIABILITY FOR ANY DAMAGE CAUSED IF CUSTOMER(S) ASK FOR THE VEHICLE TO BE TAKEN TO A PUBLIC HIGHWAY OR TO A PUBLIC PLACE (INCLUDING THE PUBLIC HIGHWAY) TO THE POINT OF DISCHARGE AND THE CUSTOMER SHALL INDEMNIFY US, OUR SERVANTS AND AGENTS FOR ANY DAMAGE OR INJURY RESULTING FROM ANY FAILURE TO DO SO. AN UNSIGNED TICKET IS NOT A VALID REASON FOR NON-PAYMENT OF INVOICE. N.B. TO CUSTOMERS, AUTHORISED AGENTS, REPRESENTATIVES, OR RESPONSIBLE PERSONS SIGNING THIS TICKET, THIS IS IN YOUR INTEREST, PLEASE READ THIS TICKET CAREFULLY AND INSPECT MATERIAL, AGREEING QUALITY, AND THAT EVERYTHING IS TO YOUR SATISFACTION BEFORE FINALLY SIGNING THIS RECEIPT. NOTE, A SIGNATURE ON THE TICKET DOES NOT ENTITLE ANY CLAIMS CONCERNING QUANTITY OR QUALITY, OR THE VEHICLE HAS LEFT THE SITE AND A CLEAR SIGNATURE HAS BEEN GIVEN. WE CANNOT ACCEPT RESPONSIBILITY FOR DAMAGE CAUSED BY OUR VEHICLES WHILE DELIVERING TO YOU MATERIALS DELIVERED TO SITE REMAIN THE PROPERTY OF THE VENDOR UNTIL PAID FOR IN FULL. CERTIFIED THAT THE ABOVE PARTICULARS ARE TRUE AND RELATE TO THE AGGREGATES, SUB-BASED MATERIALS ARISING MATERIALS BEING CONVEYED OR DISPOSED OF IN PURSUANCE OF THE SALE. ALL RECYCLED AGGREGATES SUPPLIED HAVE BEEN PRODUCED TO A QUALITY MANAGEMENT SCHEME CONFIRMED BY THE WRAP QUALITY PROTOCOL. I CONFIRM THAT I HAVE FULFILLED MY DUTY TO APPLY THE WASTE HIERARCHY AS REQUIRED BY REGULATION 11 OF THE WASTE (ENGLAND AND WALES) REGULATIONS 2011			
Time on site: ☐ 17.01.07 ☐ 17.05.04 ☐ 17.09.04 ☐ 20.02.01 ☐ Other (specify)		I understand and accept the conditions of hire printed above.	
Time left site: ☐ 17.01.07 ☐ 17.05.04 ☐ 17.09.04 ☐ 20.02.01 ☐ Other (specify)		I confirm that the description of waste is correct.	
Travelling to and from site:		Signed	
Address of tip / transfer point: Tipping into Hills Purton		Print Name	
GROSS WEIGHT		Date	
TARE WEIGHT		TOTAL	
NET WEIGHT			

White - Accounts Pink - Tip Green - File Yellow - Customer This ticket is issued subject to the company's Terms & Conditions printed on the back of this document.

Std doc 041, Revision 01



R COLLARD SKIPS EVERSLEY
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
RG27 0PZ
Phone : 01252 844688
Fax : 01252 844668
Email : info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE

Order No: 350302

Ticket Number: 599354

Cash Sale: No

Date: 24/09/2019

Product: 40YD ROLL ON-OFF

Customer Order No: simon

Time On Site: 15:55

Time Start:

Time Stop:

Time Complete: 15:55

Waste Type: 170904

170904 - GENERAL BUILDERS RUBBISH

Parking Ticket: No

Parking Ticket Value: £0.00

Cancelled: No

Cancelled Reason:

Skip Col No: 45

Skip Del No: na

Notes:

Tally 1:

Tally 2:

Gross Weight: 24,740.00

Tare Weight: 17,040.00

Net Weight: 7,700.00

SIC Code: 43110

EWG Code: 170904

Disposal Site: EVERSLEY YARD IN

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of Invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: WU18FLR

Driver: NICK FRY

Waste Management Licence No. EPR/QP3490EAV002

Waste Carrier Licence No. CBDU/96607

Customer: J King

Driver: NICK FRY



BULKER
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
EVERSLEY
RG27 0PZ
Fax : 01252 844668
Email : info@rcollard.com
Company Reg. No. : 3002310

Type: WAIT & LOAD

Order No: 351285

Ticket Number: 598434

Cash Sale: No

Date: 23/09/2019

Product: BULKER LORRY

Customer Order No:

Time On Site: 10:39

Time Start:

Time Stop:

Time Complete: 10:39

Waste Type: 170904

170904 - GENERAL BUILDERS RUBBISH

Parking Ticket: No

Parking Ticket Value: £0.00

Cancelled: No

Cancelled Reason:

Skip Col No:

Skip Del No:

Notes: please collect full load of general waste and take to fcc

Tally 1:

Tally 2:

Gross Weight: 0.00

Tare Weight: 0.00

Net Weight: 21,660.00

SIC Code: 43110

EWC Code: 170904

Disposal Site: WASTE RECYCLING GROUP

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: JC10RRY

Driver: GRAHAM APPS

Waste Management Licence No.

Waste Carrier Licence No. CBDU/96607

Customer: Me

Driver: GRAHAM APPS



BULKER
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
EVERSLEY
RG27 0PZ
Fax : 01252 844668
Email : info@rcollard.com
Company Reg. No. : 3002310

Type: WAIT & LOAD

Order No: 351285

Ticket Number: 385052

Cash Sale: No

Date: 18/09/2019

Product: BULKER LORRY

Customer Order No:

Time On Site: 10:53

Time Start:

Time Stop:

Time Complete: 12:58

Waste Type: 170904

170904 - GENERAL BUILDERS RUBBISH

Parking Ticket: No

Parking Ticket Value: £0.00

Cancelled: No

Cancelled Reason:

Skip Col No:

Skip Del No:

Notes: please collect full load of general waste and take to fcc

Tally 1:

Tally 2:

Gross Weight: 0.00

Tare Weight: 0.00

Net Weight: 15,920.00

SIC Code: 43110

EWG Code: 170904

Disposal Site: WASTE RECYCLING GROUP

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of Invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: RC10RRY

Driver: PHIL CONNOR

Waste Management Licence No.

Waste Carrier Licence No. CBDU/96607

Customer: Phil

Driver: PHIL CONNOR



BULKER
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
EVERSLEY
RG27 0PZ
Fax : 01252 844668
Email : info@rcollard.com
Company Reg. No. : 3002310

Type: WAIT & LOAD

Order No: 351285

Ticket Number: 594545

Cash Sale: No

Date: 17/09/2019

Product: BULKER LORRY

Customer Order No:

Time On Site: 10:39

Time Start:

Time Stop:

Time Complete: 11:19

Waste Type: 170904

170904 - GENERAL BUILDERS RUBBISH

Parking Ticket: No

Parking Ticket Value: £0.00

Cancelled: No

Cancelled Reason:

Skip Col No:

Skip Del No:

Notes: please collect full load of general waste and take to fcc

Tally 1:

Tally 2:

Gross Weight: 0.00

Tare Weight: 0.00

Net Weight: 15,480.00

SIC Code: 43110

EWG Code: 170904

Disposal Site: WASTE RECYCLING GROUP

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: KX64TPU

Driver: COLIN SIMONDS

Waste Management Licence No.

Waste Carrier Licence No. CBDU/96607

Customer: John King

Driver: COLIN SIMONDS



BULKER
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
EVERSLEY
RG27 0PZ
Fax : 01252 844668
Email : info@rcollard.com
Company Reg. No. : 3002310

Type: WAIT & LOAD

Order No: 351285

Ticket Number: 368712

Cash Sale: No

Date: 16/09/2019

Product: BULKER LORRY

Customer Order No:

Time On Site: 12:27

Time Start:

Time Stop:

Time Complete: 12:27

Waste Type: 170904

170904 - GENERAL BUILDERS RUBBISH

Parking Ticket: No

Parking Ticket Value: £0.00

Cancelled: No

Cancelled Reason:

Skip Col No:

Skip Del No:

Notes: please collect full load of general waste and bring back to Eversley and please weigh off on Weybridge

Tally 1:

Tally 2:

Gross Weight: 0.00

Tare Weight: 0.00

Net Weight: 16,840.00

SIC Code: 43110

EWG Code: 170904

Disposal Site: WASTE RECYCLING GROUP

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: BO55MCW

Driver: JIMMY THOMPSON

Waste Management Licence No.

Waste Carrier Licence No. CBDU/96607

Customer: Steve

Driver: JIMMY THOMPSON



R COLLARD SKIPS EVERSLEY
EVERSLEY HAULAGE PARK
BRICKHOUSE HILL
RG27 0PZ
Phone : 01252 844688
Fax : 01252 844668
Email : info@rcollard.com
Company Reg. No. : 3002310

Type: EXCHANGE

Order No: 350302

Ticket Number: 580904

Cash Sale: No

Date: 02/09/2019

Product: 40YD ROLL ON-OFF

Customer Order No: simon

Time On Site: 08:20

Time Start:

Time Stop:

Time Complete: 08:24

Waste Type: 170904

170904 - GENERAL BUILDERS RUBBISH

Parking Ticket: No

Parking Ticket Value: £0.00

Cancelled: No

Cancelled Reason:

Skip Col No: 25e

Skip Del No: mc bin

Notes:

Tally 1:

Tally 2:

Gross Weight: 24,620.00

Tare Weight: 17,420.00

Net Weight: 7,200.00

SIC Code: 43110

EWG Code: 170904

Disposal Site: EVERSLEY YARD IN

NO ASBESTOS, NO FRIDGES, NO FREEZERS, NO TVS, NO MONITORS, NO LIQUIDWASTE, NO TYRES OR ANY OTHER HAZARDOUS MATERIALS AS DEFINED FROM TIME TO TIME BY THE ENVIRONMENTAL AGENCY. (UNLESS BY PRIOR ARRANGEMENT).

NO FIRES IN CONTAINERS, LEVEL LOADS ONLY. SKIP HIRE CHARGE INCLUDES UP TO 7 DAYS HIRE.

The customer is responsible for any necessary lights required during the hours of darkness. We accept no liability for any damage caused if customer(s) ask for the vehicle to be taken off the public highway. The customer shall also provide and clearly indicate to our driver a SAFE route FROM THE PUBLIC HIGHWAY to the point of discharge and the customer shall indemnify us, our servants and agents for any damage or injury resulting from any failure to do so.

I confirm that I have fulfilled my duty to apply the waste hierarchy as required by Regulation 12 of the Waste (England and Wales) Regulations 2011

An unsigned ticket is not a valid reason for non-payment of Invoice.

Account Address:

Demo RJC

Delivery Address:

Demo RJC
C6194
C6194
501-504 STONE CLOSE
UB7 8JU

Vehicle: RF12XLO

Driver: NICK FRY

Waste Management Licence No. EPR/QP3490EA/V002

Waste Carrier Licence No. CBDU/96607

Customer: J King

Driver: NICK FRY