

NO	TREE SPECIES	TREE SPECIES	HEIGHT	SPREAD	Clear	DIA	N	CAT.	Life	Life	NOTES	RECOMMENDATIONS
	Common Name	Scientific Name	m	m	stem (m)	mm			Stage	exp yrs		
G1	Sycamore	Acer pseudoplatanus	5	3	-	190	N	C1	Early-Mature	40+	Coppiced, 2No.	FELL
T2	Sycamore	Acer pseudoplatanus	5	3	-	125	N	C1	Early-Mature	40+	Coppiced	FELL
T3	Cherry	Prunus sp.	7	5	2	200		U		0	Offsite. Major dieback, Ivy covered	
T4	Lawson Cypress	Chamaecyparis lawsoniana	5	2	-	200		C1	Early-Mature	40+	Offsite.	
G5	Cherry Laurel	Prunus laurocerasus	5	4	-	220	N	C1	Young	40+	Multi-stemmed, 5No., Clipped to 2m	
T6	Elder	Sambucus sp.	5	2	-	150	N	C1	Young	40+	Multi-stemmed, Clipped	
T7	Cherry Laurel	Prunus laurocerasus	4	2	-	100		C1	Young	40+	Clipped to drive	
T8	Cherry Laurel	Prunus laurocerasus	3	2	-	100		C1	Young	40+	Clipped to drive	

Northern Boundary: Existing fence/replacement close boarded fence to be retained through entire construction (orange line) or install temporary protection fencing as shown (green line) prior to commencement of any construction works



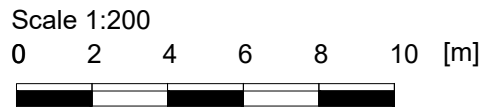


Figure 2 Default specification for protective barrier

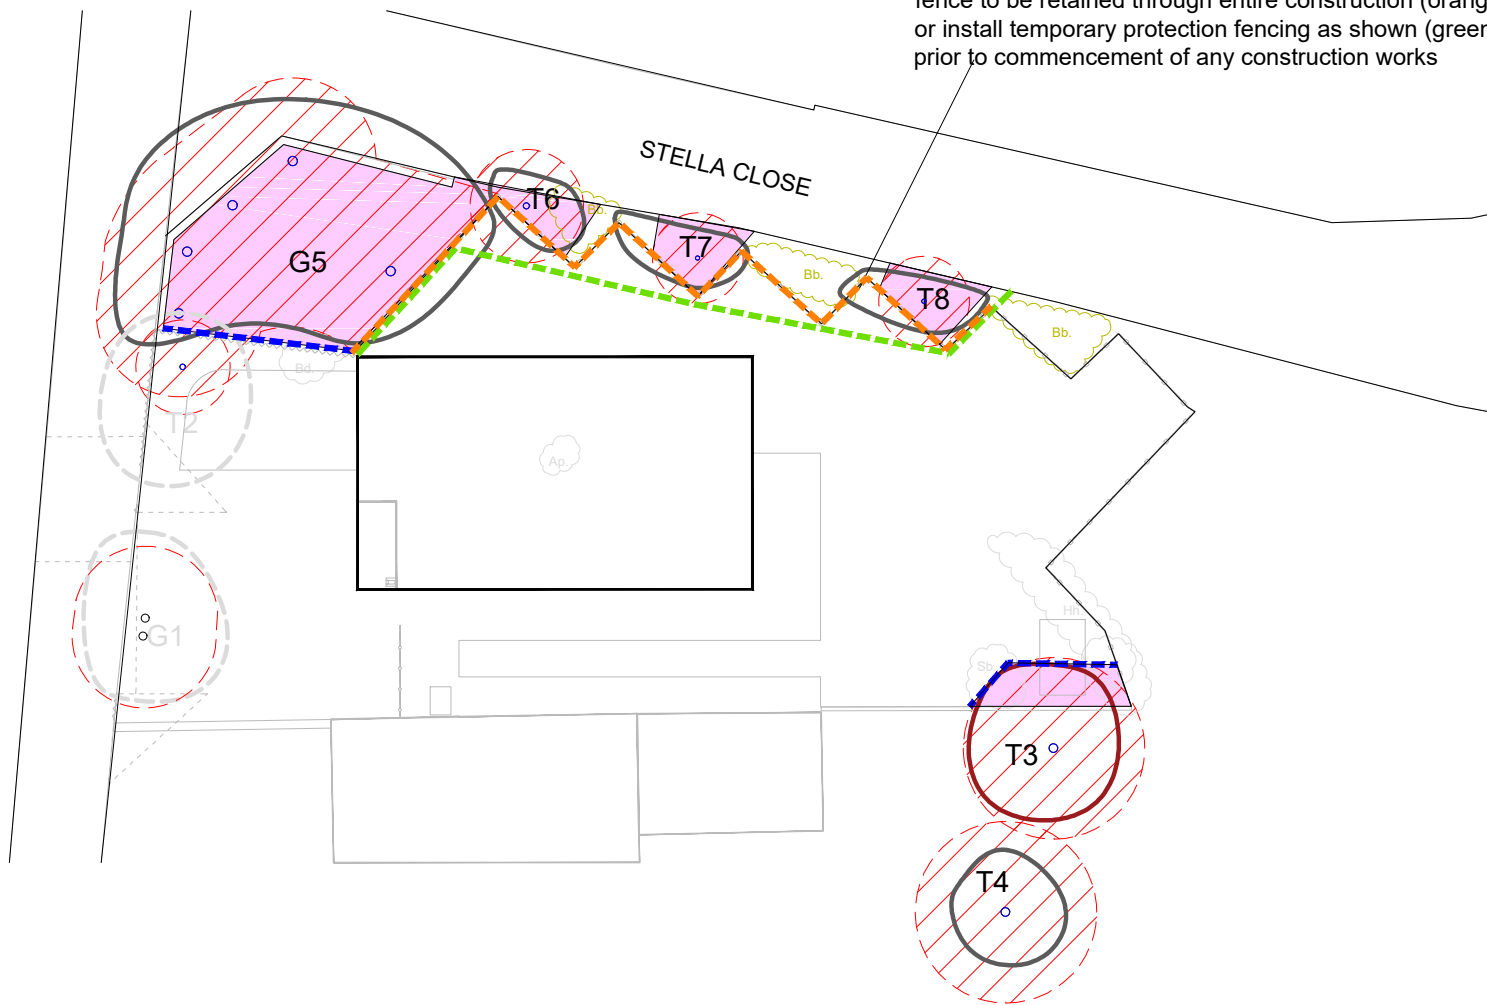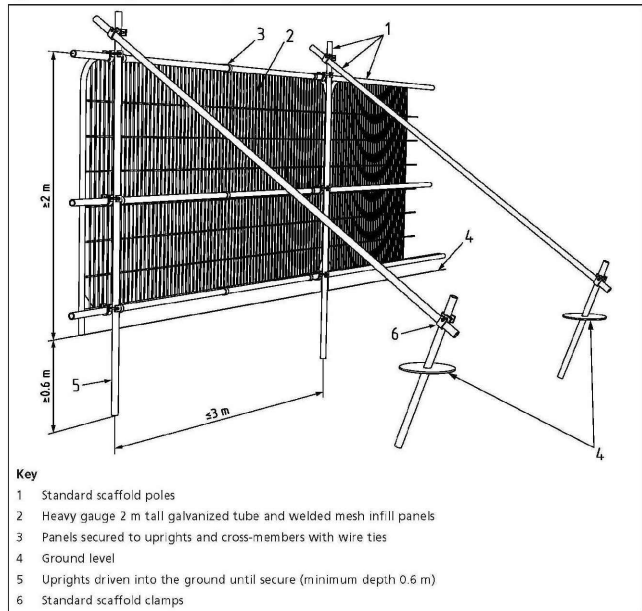

BS5837:2012 Figure 2

TREE SURVEY TO BS5837:2012

KEY	COLOUR	QUALITY	DESCRIPTION
GREEN		A: HIGH retention most desirable	Vigorous healthy good form, visually important, historic or rare
BLUE		B: MODERATE retention desirable	Slightly impaired condition, numerous immature, 'A' potential
GREY		C: LOW could be retained	Adequate condition requiring minimal surgery
RED		U: FELL Unsuitable for retention	Dead dying, dangerous insecure rooting, significant fungal disease
GREEN		SHRUBS	
SUB-CATEGORY:			
1 ARBORICULTURAL			
2 LANDSCAPE			
3 CULTURAL/CONSERVATION			

--- Site Boundary

In accordance with BS5837:2012 'Trees in relation to design, demolition and construction', offsite trees within a distance equal to 12x stem diameter from boundary should be surveyed. In accordance with good working practice, all trees within 12m of the site boundary have been surveyed.

The original of this drawing is produced in colour - a monochrome copy should not be relied upon.

LIMITATION OF THIS SURVEY
This survey records amenity quality and desirability of tree retention in relation to proposed construction by visual inspection from ground level where accessible.

It does not constitute a Tree Inspection or detailed report on condition.

Tree heights and spread approximate. The diameter of single stem trees is taken at 1.5m above ground level. For the diameter of multistemmed trees, each multistem is measured at 1.5m above ground level and calculated to give a notional diameter as if all multistems were fused into one stem.

The branch spread is an accurate representation of the crown as clause 4.4.2.5 (e)

Tree inspections should take place annually in September/October when trees are in leaf.

Tree positions are approximate and are to be verified by topographic survey.

TREE CONSTRAINTS

ROOT PROTECTION AREA (RPA)
Root Protection Areas have been calculated on the following basis:

Single stems: Area equivalent to circle of radius 12 x (& Notional) stem diameter at 1.5m

Multistems: Area equivalent to circle of radius 10 x diameter at ground level.

Root Protection Areas shaped due to obstruction to root spread e.g. retaining wall, water course.

RPA of pollarded or topped trees has been reduced to an area appropriate to actual canopy spread.

TREE PROTECTION

TREES TO BE REMOVED (with root protection area)

Scaffold Protective Fence as BS5837:2012 Figure 2 or 3

Based on MEPK Architects drawing no. 19109 P-01, dated 24/03/2020

Weddle Landscape Design	
LANDSCAPE	ARCHITECTURE
ENVIRONMENTAL	PLANNING
Mews Studio, Charnwood House,	Tel (0114) 250 1181
8 Kenwood Bank, Sheffield S7 1NU	Fax (0114) 250 1188
www.weddles.co.uk	mail@weddles.co.uk

Job **STELLA CLOSE, UXBRIDGE**

Title **TREE PROTECTION PLAN AND METHOD STATEMENT**

scale@A3	drawn	date	job number	number	revision
1:200	EH	MAY 21	1238	SCU 02	-