


## KEY - BS 5837 : 2012 Categories

- Tree Category A - High Quality
- A Category - Hedgerow, Group, Woodland
- Tree Category B - Moderate Quality
- B Category - Hedgerow, Group, Woodland
- Tree Category C - Low Quality
- C Category - Hedgerow, Group, Woodland
- Tree Category U - Unsuitable for Retention
- Default Root Protection Area to BS:5837:2012
- Adjusted Root Protection Area to BS:5837:2012
- Shrub Mass / Offsite Tree

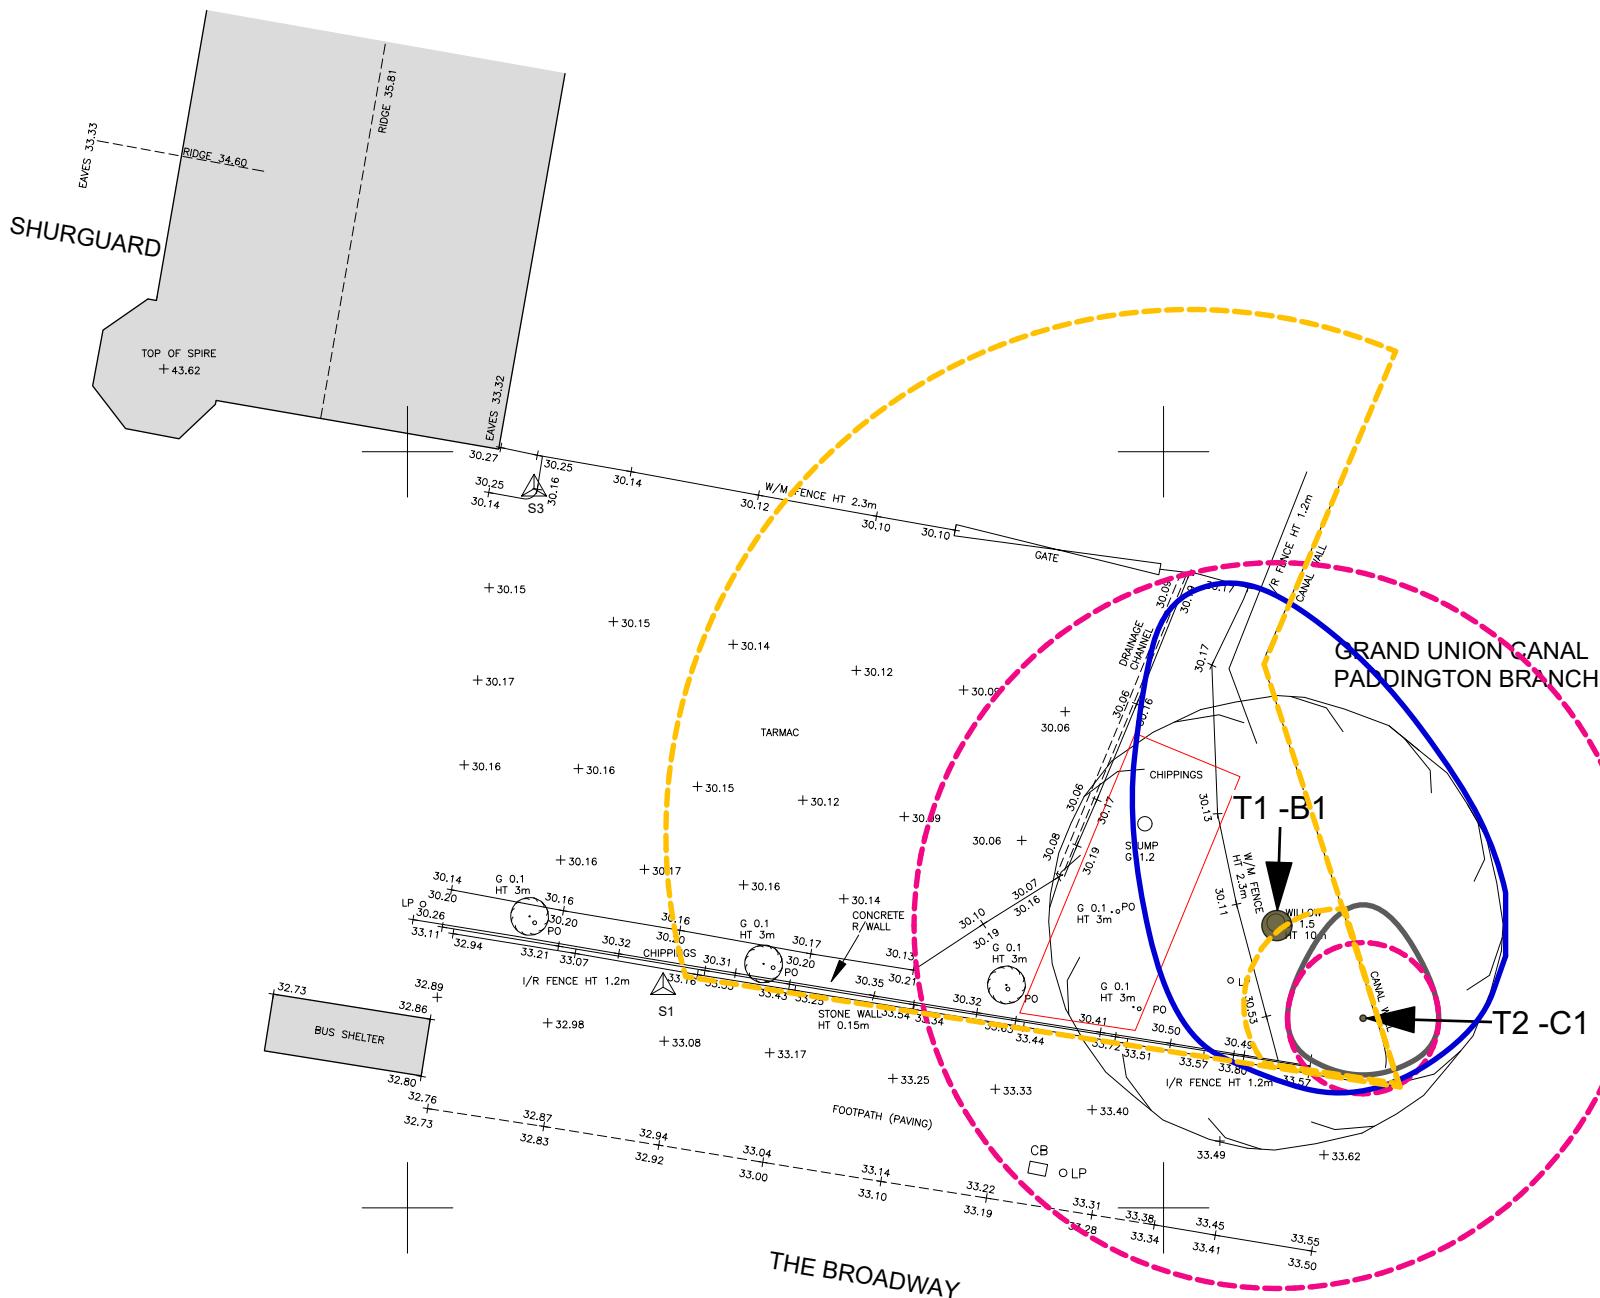

Ref no.	Species	Ht. (m)	Stem				Category Grading	Crown Spread (m)							Life stage	ULE	Physiological Condition	Structural Condition	General Observations and Notes	
			Stem Count	Stem dia. (mm)	RPA radius	RPA area		N	E	S	W	Ht. 1st Br. (m)	Est.	1st Br. Direction	Ht. Can. (m)					
T1	Willow	14.0	1	800	9.6	290	B1	7.5	6.0	4.0	5.0	N/A	-	N/A	0.0	M	20+	Good	Fair	Stem leans north east. Stem estimated using diameter tape cross section as unable to access to wrap tape around stem. Dense ivy on stem into crown. Dense crown, canopy leans north.
T2	Cypress	7.0	1	170	2.0	13	C1	3.0	2.0	1.5	2.0	N/A	-	N/A	1.0	SM	<10	Fair	Poor	Topped and pruned, unsustainable location, poor quality tree.