

Monitoring Details:

Level Monitoring

Provider Name: SML Subsidence

Monitoring Interval: Every 8 weeks

Instruction Date: 22/07/2024

Number of Visits: 10

Reading Date: 27/01/2026

Visits Completed: 9

Date of Issue: 28/01/2026

Visits Outstanding: 1

Client Details:

Client: Sedgwick

Engineer / Handler: -

Job Reference:


Monitored Address:

Address: 22 Wieland Road, NORTHWOOD, Middlesex, HA6 3QU

Front Elevation



Site Plan

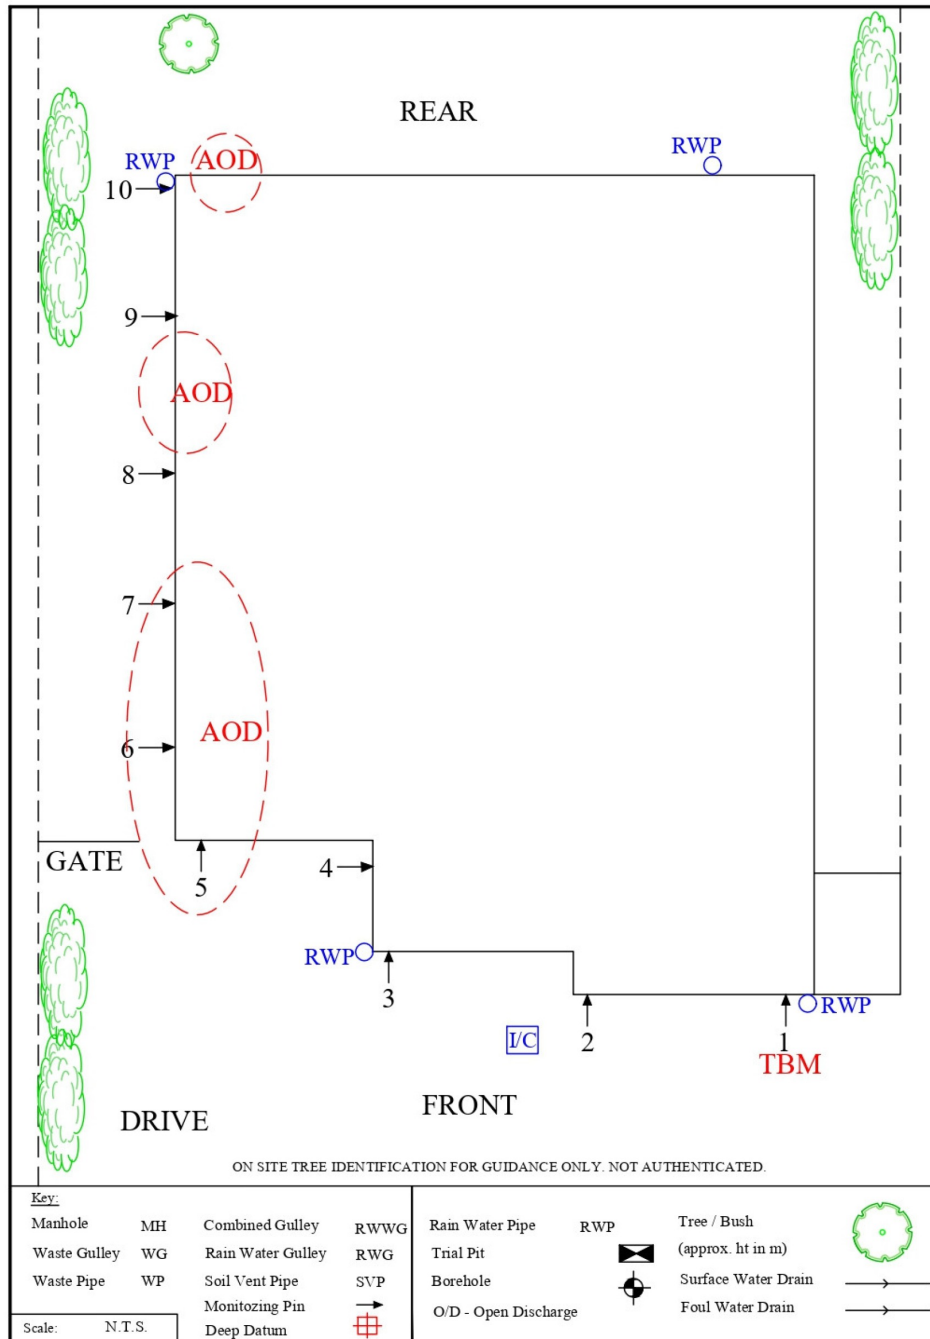

Visit Notes

Visit	Surveyors Note
Visit 7	All movement has been checked at this visit.

Level Readings

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	20/08/24	10/10/24	19/11/24	22/01/25	03/04/25	11/06/25	28/08/25	25/11/25
TBM1	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000
2	9.9948	9.9952	9.9949	9.9953	9.9945	9.9941	9.9951	9.9945
3	9.9847	9.9844	9.9840	9.9849	9.9842	9.9839	9.9821	9.9833
4	9.9852	9.9855	9.9853	9.9864	9.9858	9.9844	9.9834	9.9845
5	9.9709	9.9707	9.9705	9.9719	9.9713	9.9710	9.9606	9.9619
6	9.9530	9.9528	9.9525	9.9534	9.9536	9.9531	9.9370	9.9423
7	9.9498	9.9498	9.9496	9.9506	9.9506	9.9503	9.9351	9.9396
8	9.9414	9.9414	9.9414	9.9425	9.9427	9.9424	9.9312	9.9335
Taken by	RF	DD	NA	GJ	NA	PL	DD	TF
Serial number	1813	121193	523936	524764	523936	1201050	525106	118

Level Movement (Displayed in Millimeters)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	20/08/24	10/10/24	19/11/24	22/01/25	03/04/25	11/06/25	28/08/25	25/11/25
TBM1	0	0	0	0	0	0	0	0
2	0	+0.4	+0.1	+0.5	-0.3	-0.7	+0.3	-0.3
3	0	-0.3	-0.7	+0.2	-0.5	-0.8	-2.6	-1.4
4	0	+0.3	+0.1	+1.2	+0.6	-0.8	-1.8	-0.7
5	0	-0.2	-0.4	+1	+0.4	+0.1	-10.3	-9
6	0	-0.2	-0.5	+0.4	+0.6	+0.1	-16	-10.7
7	0	0	-0.2	+0.8	+0.8	+0.5	-147	-10.2
8	0	0	0	+1.1	+1.3	+1	-10.2	-79

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	20/08/24	10/10/24	19/11/24	22/01/25	03/04/25	11/06/25	28/08/25	25/11/25
9	9.9318	9.9319	9.9319	9.9328	9.9331	9.9326	9.9262	9.9270
10	9.9319	9.9320	9.9328	9.9339	9.9337	9.9333	9.9276	9.9285
Taken by	RF	DD	NA	GJ	NA	PL	DD	TF
Serial number	1813	121193	523936	524764	523936	1201050	525106	118

[illegible]

Visit Notes

No visit notes have been entered for any visits


Level Readings

	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	27/01/26							
TBM1	10.0000							
2	9.9950							
3	9.9843							
4	9.9848							
5	9.9650							
6	9.9455							
7	9.9431							
8	9.9356							
Taken by	TF							
Serial number	1180							


Level Movement (Displayed in Millimeters) - Continuation of readings

	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	27/01/26							
TBM1	0							
2	+0.2							
3	-0.4							
4	-0.4							
5	-5.9							
6	-7.5							
7	-6.7							
8	-5.8							

Level Readings Chart (Points TBM 1 - 10)

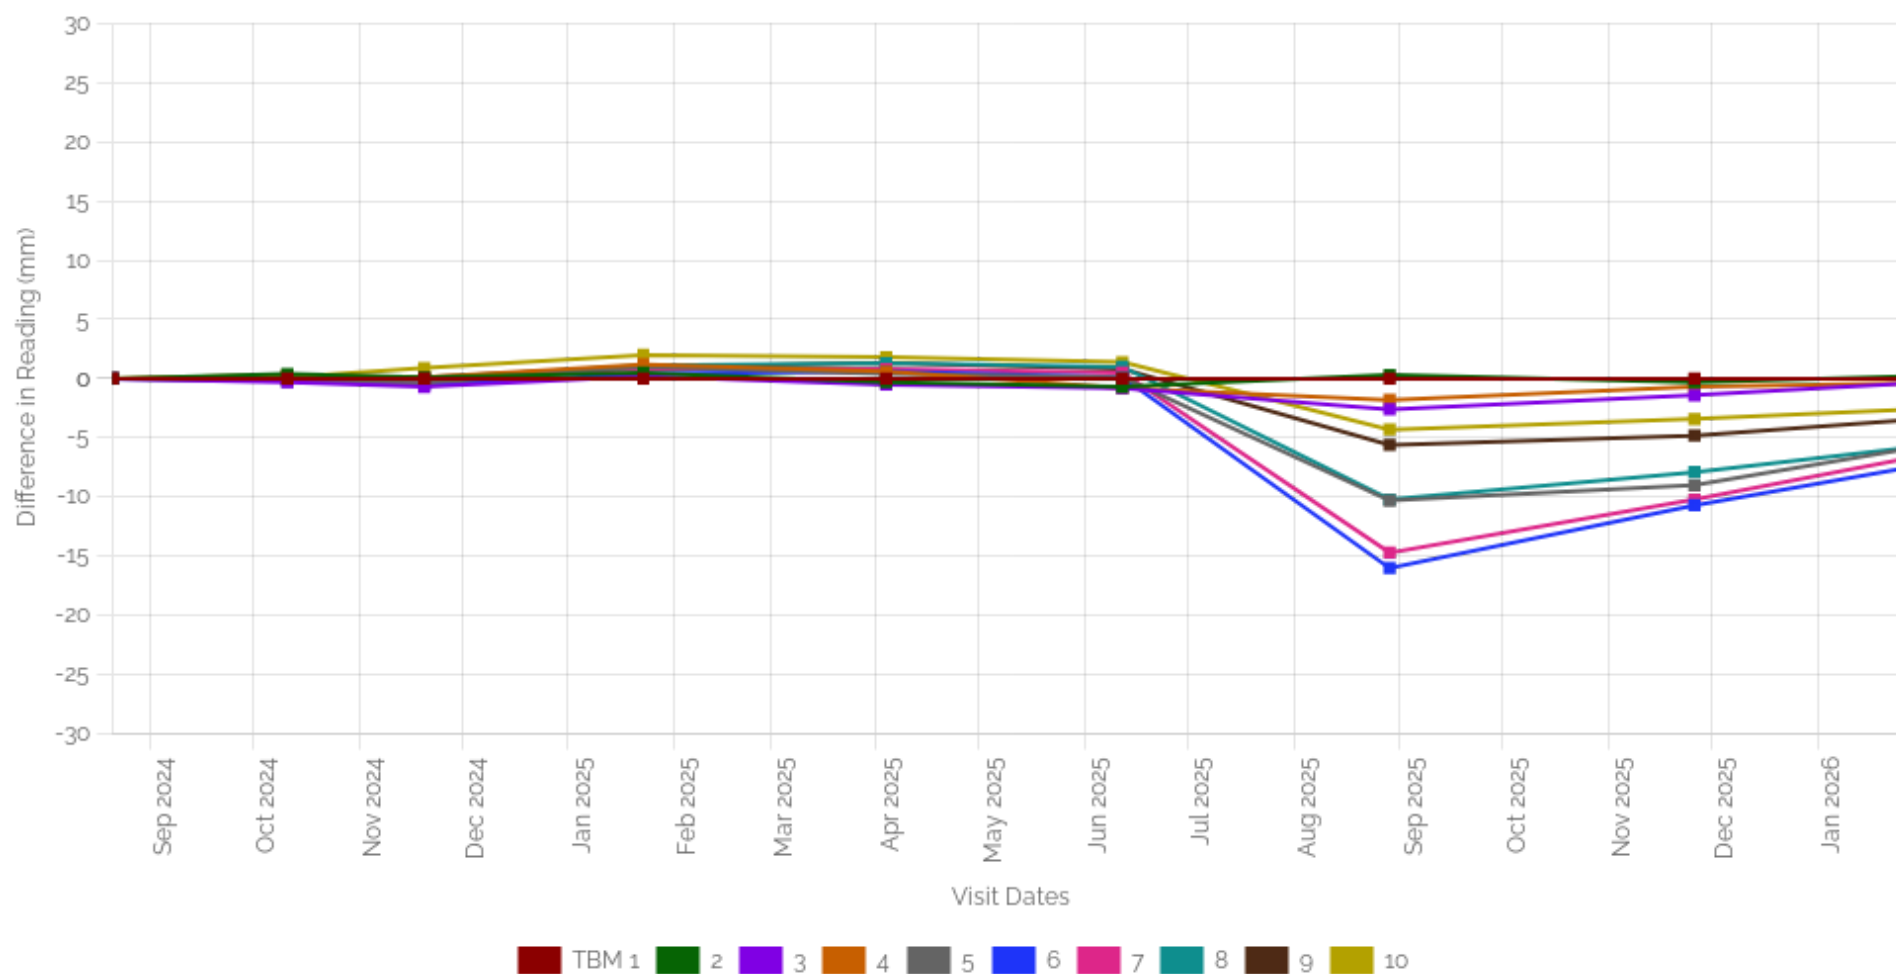

Relative Movement (Relative Survey, for illustration purposes only)

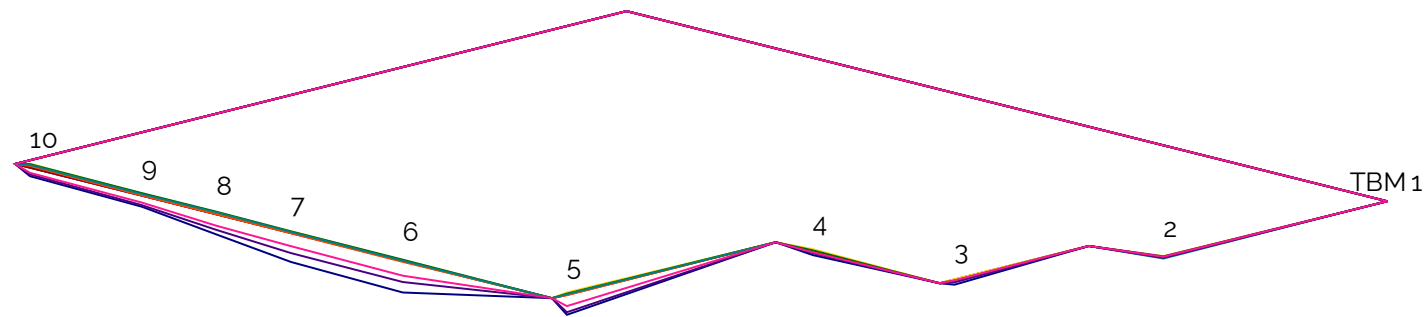

19/08/2024

09/10/2024

19/11/2024

22/01/2025

02/04/2025

10/06/2025

27/08/2025

25/11/2025

27/01/2026